

U.S. Department of the Interior  
BUREAU OF LAND MANAGEMENT

<b>Well Name:</b> JICARILLA I	<b>Well Location:</b> T23N / R2W / SEC 23 / NENE /	<b>County or Parish/State:</b> SANDOVAL / NM
<b>Well Number:</b> 1	<b>Type of Well:</b> CONVENTIONAL GAS WELL	<b>Allottee or Tribe Name:</b> JICARILLA APACHE
<b>Lease Number:</b> JIC163	<b>Unit or CA Name:</b>	<b>Unit or CA Number:</b>
<b>US Well Number:</b> 3004305197	<b>Well Status:</b> Producing Gas Well	<b>Operator:</b> DJR OPERATING LLC

**Notice of Intent**

**Sundry ID:** 2696916

**Type of Submission:** Notice of Intent

**Type of Action:** Plug and Abandonment

**Date Sundry Submitted:** 10/06/2022

**Time Sundry Submitted:** 02:10

**Date proposed operation will begin:** 10/06/2022

**Procedure Description:** This request is being submitted for engineering & geological review prior to onsite inspection as approved by Dave M. of the BLM. DJR Operating, LLC requests permission to Plug & Abandon the subject well according to the attached Procedure, Current & Proposed Wellbore Diagram.

**Surface Disturbance**

**Is any additional surface disturbance proposed?:** No

**NOI Attachments**

**Procedure Description**

Jic\_I\_163\_1\_PA\_BLM\_Submittal\_20221006140941.pdf

<b>Well Name:</b> JICARILLA I	<b>Well Location:</b> T23N / R2W / SEC 23 / NENE /	<b>County or Parish/State:</b> SANDOVAL / NM
<b>Well Number:</b> 1	<b>Type of Well:</b> CONVENTIONAL GAS WELL	<b>Allottee or Tribe Name:</b> JICARILLA APACHE
<b>Lease Number:</b> JIC163	<b>Unit or CA Name:</b>	<b>Unit or CA Number:</b>
<b>US Well Number:</b> 3004305197	<b>Well Status:</b> Producing Gas Well	<b>Operator:</b> DJR OPERATING LLC

**Conditions of Approval**

**Specialist Review**

- General\_Requirement\_PxA\_20221021093751.pdf
- 23N2W23\_Jicarilla\_I\_163\_1\_Geo\_KGR\_20221021093706.pdf
- 2696916\_NOIA\_I\_1\_3004305197\_KR\_10212022\_20221021093634.pdf

**Operator**

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a

**Operator Electronic Signature:** SHAW-MARIE FORD **Signed on:** OCT 06, 2022 02:09 PM

**Name:** DJR OPERATING LLC

**Title:** Regulatory Specialist

**Street Address:** 1 Road 3263

**City:** Aztec **State:** NM

**Phone:** (505) 632-3476

**Email address:** sford@djrlc.com

**Field**

**Representative Name:**

**Street Address:**

**City:** **State:** **Zip:**

**Phone:**

**Email address:**

**BLM Point of Contact**

**BLM POC Name:** KENNETH G RENNICK **BLM POC Title:** Petroleum Engineer

**BLM POC Phone:** 5055647742 **BLM POC Email Address:** krennick@blm.gov

**Disposition:** Approved **Disposition Date:** 10/21/2022

**Signature:** Kenneth Rennick

**DJR Operating, LLC  
Plug and Abandonment Procedure  
Jicarilla I 163 1  
API # 30-043-05197  
NE/NE, Unit A, Sec. 23, T23N, R2W  
Sandoval County, NM**

1. Hold Pre job meeting, comply with all NMOCD, BLM and environmental regulations.
2. MIRU rig.
3. Check and record tubing, casing and bradenhead pressures.
4. Remove existing piping from casing valve, RU blow lines from casing valves and blow down casing pressure. Kill well as necessary. Ensure that well is dead or on a vacuum.
5. ND WH, NU BOP, function test BOP.
6. Trip out of hole with 1-1/4" tubing. LD tubing to be sent in for storage/salvage.
7. PU bit and 4-1/2" casing scraper on workstring and make sure it will go past 2970'.  
TOOH.
8. Plug 1 (Perforations): TIH with CR and set near 2970'. Pressure test tubing to 1000 psi. Sting out of CR. Roll hole Pressure test casing to 600 psi. Sting back into CR and attempt to squeeze below CR with 10 sx. Sting out and pump water to ensure that tubing is clear. TOOH.
9. MIRU logging truck. Run CBL log from CR to surface. Hold 600 psi on casing if possible. Electronic copy of CBL to be sent to Ken Rennick [krennick@blm.gov](mailto:krennick@blm.gov), Monica Kueling [monica.kueling@state.nm.us](mailto:monica.kueling@state.nm.us), Loren Diede [ldiede@djrlc.com](mailto:ldiede@djrlc.com), and [slindsay@djrlc.com](mailto:slindsay@djrlc.com). Plugs may be adjusted per log results.
10. Plug 2 (Pictured Cliffs, Fruitland, Kirtland, and Ojo Alamo): TIH and spot blind plug on top of CR to 2565'. Pump water to ensure that tubing is clear. TOOH.
11. Plug 3 ( Nacimiento): Perforate holes at 1740'. PU and TIH with 4-1/2" CR and set near 1720'. Mix and pump sufficient volume to bring TOC to 1640', inside and outside. Pump water to ensure tubing is clear.
12. Plug 4 (Surface casing shoe and surface plug): Perforate holes at 144'. Tie on to 4 1/2" casing and mix and pump sufficient volume to bring cement to surface, inside and outside.
13. RD cementing equipment. Cut off wellhead, fill any exposed annulus with cement, as necessary. **Install P&A marker as per BIA requirements.** Record GPS coordinates for

P&A marker and the Final P&A Report. Photograph the P&A marker and attach to the report.

14. RD and MO all rig and cement equipment. Assure that location is free of trash before moving off.

15. Send all reports and attachments to DJR Aztec office for regulatory filings.

**Note: All cement is to be Class G mixed at 15.8 ppg, yield 1.15 cu ft / sx. Cement volumes are based on inside capacities + 50' excess and outside capacities + 100% excess.**

**PxA marker it to be 12"x18" with rounded corners and installed below grade no deeper than 2'.**

**Current Wellbore Diagram**  
**DJR Operating, LLC**  
**Jicarilla I 163 1**  
**API # 30-043-05197**  
**NE/NE, Unit A, Sec 23, T23N, R2W**  
**Sandoval County, NM**

GL 7333'  
 KB N/A  
 Spud Date 10/28/1962

SURF CSG


Hole size 10-3/4"\*  
 Csg Size: 8-5/8"  
 Wt: 24#  
 Grade: N/A  
 ID: 8.097"  
 Depth 94'  
 cap cf/ft: 0.3575  
 TOC: N/A  
 \*Estimated

FORMATION TOPS

San Jose	Surf
Nacimiento	1690'
Ojo Alamo	2615'
Kirtland	2818'
Fruitland	2956'
Pictured Cliffs	2992'

PROD CSG

Hole size 6-3/4"\*  
 Csg Size: 4-1/2"  
 Wt: 9.5#  
 Grade: N/A  
 ID: 4.090"  
 Depth 3117'  
 cap cf/ft: 0.0912  
 Csg/Csg Ann, cf/ft: 0.2318  
 Csg/OH Ann, cf/ft: 0.1381  
 TOC: 2484' (calc)  
 \*Estimated

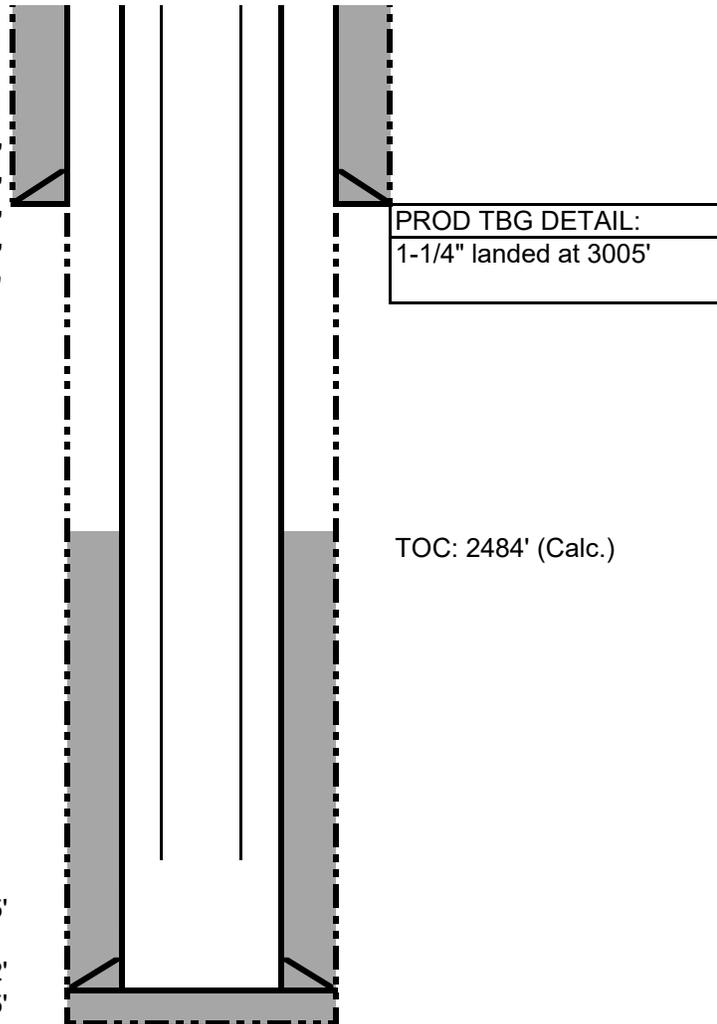

**Proposed Wellbore Diagram**  
**DJR Operating, LLC**  
**Jicarilla I 163 1**  
**API # 30-043-05197**  
**NE/NE, Unit A, Sec 23, T23N, R2W**  
**Sandoval County, NM**

GL 7333'  
 KB N/A  
 Spud Date 10/28/1962


SURF CSG  
 Hole size 10-3/4"\*  
 Csg Size: 8-5/8"  
 Wt: 24#  
 Grade: N/A  
 ID: 8.097"  
 Depth 94'  
 cap cf/ft: 0.3575  
 TOC: N/A  
 \*Estimated

PROD CSG  
 Hole size 6-3/4"\*  
 Csg Size: 4-1/2"  
 Wt: 9.5#  
 Grade: N/A  
 ID: 4.090"  
 Depth 3117'  
 cap cf/ft: 0.0912  
 Csg/Csg Ann, cf/ft: 0.2318  
 Csg/OH Ann, cf/ft: 0.1381  
 TOC: 2484' (calc)  
 \*Estimated

FORMATION TOPS	
San Jose	Surf
Nacimiento	1690'
Ojo Alamo	2615'
Kirtland	2818'
Fruitland	2956'
Pictured Cliffs	2992'

TOC: 2484' (Calc.)

CR near 2990'  
 Perfs 2986-3015'  
 PBTD 3092'  
 TD 3125'

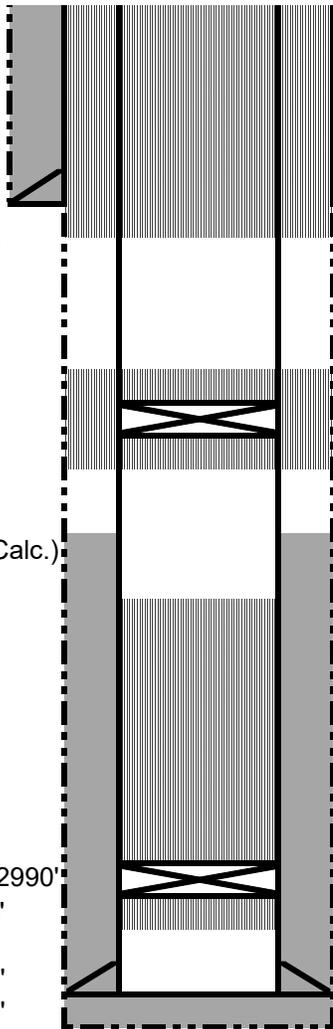

Plug 4 (Surface shoe and surface plug): Perf holes at 144'. Tie onto 4-1/2" casing and mix and pump sufficient volume to bring TOC to surface, inside and outside.

Plug 3 (Nacimiento): Perf holes at 1740'. Set CR near 1720'. Mix and pump sufficient volume to bring TOC to 1640', inside and outside

Plug 2 (Pictured Cliffs, Fruitland, Kirtland and Ojo Alamo): Spot blind plug from top of CR to 2565'.

Plug 1 (Perfs): Set CR near 2970'. Attempt to squeeze 10 sx below CR. Run CBL.

**Note: Inside plugs will include 50' excess cement, while outside plugs will include 100% excess**

**GENERAL REQUIREMENTS FOR  
PERMANENT ABANDONMENT OF WELLS ON FEDERAL AND INDIAN LEASES  
FARMINGTON FIELD OFFICE**

- 1.0 The approved plugging plans may contain variances from the following minimum general requirements.
- 1.1 Modification of the approved plugging procedure is allowed only with the prior approval of the Authorized Officer, Farmington Field Office.
  - 1.2 Requirements may be added to address specific well conditions.
- 2.0 Materials used must be accurately measured. (densometer/scales)
- 3.0 A tank or lined pit must be used for containment of any fluids from the wellbore during plugging operations and all pits are to be fenced with woven wire. These pits will be fenced on three sides and once the rig leaves location, the fourth side will be fenced.
- 3.1 Pits are not to be used for disposal of any hydrocarbons. If hydrocarbons are present in the pit, the fluids must be removed prior to filling in.
- 4.0 All cement plugs are to be placed through a work string. Cement may be bull-headed down the casing with prior approval. Cement caps on top of bridge plugs or cement retainers may be placed by dump bailer.
- 4.1 The cement shall be as specified in the approved plugging plan.
  - 4.2 All cement plugs placed inside casing shall have sufficient volume to fill a minimum of 100' of the casing, or annular void(s) between casings, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug.
  - 4.3 Surface plugs may be no less than 50' in length.
  - 4.4 All cement plugs placed to fill annular void(s) between casing and the formation shall be of sufficient volume to fill a minimum of 100' of the annular space plus 100% excess, calculated using the bit size, or 100' of annular capacity, determined from a caliper log, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug.
  - 4.5 All cement plugs placed to fill an open hole shall be of sufficient volume to fill a minimum of 100' of hole, as calculated from a caliper log, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug. In the absence of a caliper log, an excess of 100% shall be required.
  - 4.6 **A cement bond log or other accepted cement evaluation tool is required to be run if one had not been previously ran or cement did not circulate to surface during the original casing cementing job or subsequent cementing jobs.**

5.0 All cement plugs spotted across, or above, any exposed zone(s), when; the wellbore is not full of fluid or the fluid level will not remain static, and in the case of lost circulation or partial returns during cement placement, shall be tested by tagging with the work string.

5.1 The top of any cement plug verified by tagging must be at or above the depth specified in the approved plan, without regard to any excess.

5.2 Testing will not be required for any cement plug that is mechanically contained by use of a bridge plug and/or cement retainer, if casing integrity has been established.

5.3 Any cement plug which is the only isolating medium, for a fresh water interval or a zone containing a prospectively valuable deposit of minerals, shall be tested by tagging.

5.4 If perforations are required below the surface casing shoe, a 30 minute minimum wait time will be required to determine if gas and/or water flows are present. If flow is present, the well will be shut-in for a minimum of one hour and the pressure recorded. Short or long term venting may be necessary to evacuate trapped gas. **If only a water flow occurs with no associated gas, shut well in and record the pressures. Contact the Engineer as it may be necessary to change the cement weight and additives.**

6.0 Before setting any cement plugs the hole needs to be rolled. All wells are to be controlled by means of a fluid that is to be of a weight and consistency necessary to stabilize the wellbore. This fluid shall be left in place as filler between all plugs.

6.1 Drilling mud may be used as the wellbore fluid in open hole plugging operations.

6.2 The wellbore fluid used in cased holes shall be of sufficient weight to balance known pore pressures in all exposed formations.

7.0 A blowout preventer and related equipment (BOPE) shall be installed and tested prior to working in a wellbore with any exposed zone(s); (1) that are over pressured, (2) where the pressures are unknown, or (3) known to contain H<sub>2</sub>S.

8.0 Within 30 days after plugging work is completed, file a Sundry Notice, Subsequent Report of Abandonment (Form 3160-5), five copies, with the Field Manager, Bureau of Land Management, 6251 College Blvd., Suite A, Farmington, NM 87402. The report should show the manner in which the plugging work was carried out, the extent, by depth(s), of cement plugs placed, and the size and location, by depth(s), of casing left in the well. Show date well was plugged.

9.0 All permanently abandoned wells are to be marked with a permanent monument as specified in 43 CFR 3162.6(d). Unless otherwise approved.

10.0 If this well is located in a Specially Designated Area (SDA), compliance with the appropriate seasonal closure requirements will be necessary.

All of the above are minimum requirements. Failure to comply with the above conditions of approval may result in an assessment for noncompliance and/or a Shut-in Order being issued pursuant to 43 CFR 3163.1. You are further advised that any instructions, orders or decisions issued by the Bureau of Land Management are subject to administrative review pursuant to 43 CFR 3165.3 and appeal pursuant to 43 CFR 3165.4 and 43 CFR 4.700.

(October 2012 Revision)

**UNITED STATES DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT  
FARMINGTON DISTRICT OFFICE  
6251 COLLEGE BLVD.  
FARMINGTON, NEW MEXICO 87402**

AFMSS 2 Sundry ID 2696916

Attachment to notice of Intention to Abandon

Well: Jicarilla I 1

**CONDITIONS OF APPROVAL**

1. Plugging operations authorized are subject to the attached "General Requirements for Permanent Abandonment of Wells on Federal and Indian Lease."
2. Farmington Office is to be notified at least 24 hours before the plugging operations commence at (505) 564-7750.

You are also required to place cement excesses per 4.2 and 4.4 of the attached General Requirements.

Office Hours: 7:45 a.m. to 4:30 p.m.

K. Rennick 10/21/2022

**BLM FLUID MINERALS  
P&A Geologic Report**

**Date Completed:** 10/21/2022

Well No. Jicarilla I 163 1 (API# 30-043-05197)		Location	NENE			
Lease No. JIC163		Sec. 23	T23N			R2W
Operator DJR Operating, LLC		County	Sandoval	State	New Mexico	
Total Depth 3125'	PBTD 3092'	Formation Pictured Cliffs				
Elevation (GL) 7333'		Elevation (KB) NA				

Geologic Formations	Est. Top	Est. Bottom	Log Top	Log Bottom	Remarks
San Jose Fm					Surface/freshwater sands
Nacimiento Fm			1690		Possible freshwater sands
Ojo Alamo Ss			2615		Aquifer (possible freshwater)
Kirtland Shale			2818		
Fruitland Fm			2956		Coal/Gas/Possible water
Pictured Cliffs Ss			2992		Gas
Lewis Shale					
Chacra					Gas
Cliff House Ss					Water/Possible gas
Menefee Fm					Coal/Ss/Water/Possible O&G
Point Lookout Ss					Probable water/Possible O&G
Mancos Shale					
Gallup					O&G/Water
Greenhorn					
Graneros Shale					
Dakota Ss					O&G/Water

Remarks:  
P & A

Reference Well:

- Picture Cliffs perforations 2986 – 3015'.

**Prepared by: Kenneth Rennick**

**District I**  
 1625 N. French Dr., Hobbs, NM 88240  
 Phone:(575) 393-6161 Fax:(575) 393-0720  
**District II**  
 811 S. First St., Artesia, NM 88210  
 Phone:(575) 748-1283 Fax:(575) 748-9720  
**District III**  
 1000 Rio Brazos Rd., Aztec, NM 87410  
 Phone:(505) 334-6178 Fax:(505) 334-6170  
**District IV**  
 1220 S. St Francis Dr., Santa Fe, NM 87505  
 Phone:(505) 476-3470 Fax:(505) 476-3462

**State of New Mexico**  
**Energy, Minerals and Natural Resources**  
**Oil Conservation Division**  
**1220 S. St Francis Dr.**  
**Santa Fe, NM 87505**

CONDITIONS

Action 152648

**CONDITIONS**

Operator: DJR OPERATING, LLC 1 Road 3263 Aztec, NM 87410	OGRID: 371838
	Action Number: 152648
	Action Type: [C-103] NOI Plug & Abandon (C-103F)

**CONDITIONS**

Created By	Condition	Condition Date
kpickford	CBL required	10/24/2022
kpickford	Notify NMOCD 24 Hours Prior to beginning operations	10/24/2022
kpickford	Adhere to BLM approved COAs and plugs. See BLM COAs and GEO report.	10/24/2022