Received by Opp Po Appropriate District	5:51 PM State of	New Mexico	Form C-103
Office District I – (575) 393-6161	Energy, Minerals	and Natural Resources	Revised July 18, 2013
1625 N. French Dr., Hobbs, NM 88240			WELL API NO.
<u>District II</u> – (575) 748-1283 811 S. First St., Artesia, NM 88210	OIL CONSERV	VATION DIVISION	30-025-10422 5. Indicate Type of Lease
<u>District III</u> – (505) 334-6178 1000 Rio Brazos Rd., Aztec, NM 87410	1220 South	n St. Francis Dr.	STATE   FEE
<u>District IV</u> – (505) 476-3460	Santa F	e, NM 87505	6. State Oil & Gas Lease No.
1220 S. St. Francis Dr., Santa Fe, NM 87505			
SUNDRY NO	OTICES AND REPORTS OF		7. Lease Name or Unit Agreement Name
(DO NOT USE THIS FORM FOR PRO DIFFERENT RESERVOIR. USE "API			Langlie Mattix Penrose Sand Unit
PROPOSALS.)  1. Type of Well: Oil Well	Gas Well  Other		8. Well Number 31
2. Name of Operator		TINC I D	9. OGRID Number
3. Address of Operator	GACY RESERVES OPERA	TING LP	240974 10. Pool name or Wildcat
	SMITH ROAD, SUITE 3000	), MIDLAND, TX 79705	Langlie Mattix; 7 Rvrs-Q-Grayburg
4. Well Location	-		
Unit Letter <u>H</u>	: <u>1980</u> feet from the	NORTH line and	860 feet from the <u>EAST</u> line
Section 22	Township	22S Range 37E	NMPM County LEA
		hether DR, RKB, RT, GR, etc.	.)
	3	355' GR	
12 Checi	χ Annronriate Roy to Ir	dicate Nature of Notice,	Report or Other Data
12. Clicci	Appropriate Box to in	idicate Nature of Notice,	Report of Other Data
	INTENTION TO:		SSEQUENT REPORT OF:
PERFORM REMEDIAL WORK			<del>_</del>
TEMPORARILY ABANDON	CHANGE PLANS		
·	☐ MULTIPLE COMPL	CASING/CEMEN	II JOB
	] ¬		
OTHER:	_	☐ OTHER:	
			nd give pertinent dates, including estimated date
		.14 NMAC. For Multiple Co	empletions: Attach wellbore diagram of
proposed completion or	recompletion.		
1. MIRU. Pull Injection string and	d AD-1 packer from 3195'.		
2. PUMU 6.625" AW scraper. RI			
3. PUMU 6.625" CIBP. RIH and		VOC 0 T 11 d	
4. MIRU cementers. RIH with tul 5. Circ hole with MLF and P/T ca			
6. Spot 25 sx cmt @2658'-2558'.		тчиось тер.	
7. Spot 71 sx cmt @ 2488-2098'.	WOC & Tag (Transil (B-sal		
8. Perf & Sqz 59 sx cmt @ 1273'-			z holes)
9. Perf & Sqz 30 sx cmt @ 300'-2		(Shoe)	
10. Spot 25 sx cmt @ 100'. (Surfa 11. Cut off well head, verify cmt		marker	
4" diameter 4' tall Above G	ound Marker		
Spud Date:	Dia		ACHED CONDITIONS
Spud Date.	Kig I	Release Date: OF APPR	COVAL
I hereby certify that the informati	on above is true and comple	te to the best of my knowledg	ge and belief.
, , ,	1	·	
SIGNATURE Melani	e Reyes TIT	LE Regulatory Tech	DATE <u>01/18/2023</u>
Type or print name MELAN For State Use Only	<u>IE REYES</u> E-mai	address: <u>mreyes(a)legacy</u>	reserves.com PHONE: 432-221-6358
1 of State Ose Only	1 4		
APPROVED BY:	TOUTHER TITE	E Compliance Officer A	DATE 2/15/23
Conditions of Approval (if any):		575-263-6633	

# CONDITIONS OF APPROVAL FOR PLUGGING AND ABANDONMENT OCD - Southern District

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office I (Hobbs) at (575)-263-6633 at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down.

# Company representative will be on location during plugging procedures.

- 1. A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.
- **2.** Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
- **3.** Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private- shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
- 4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
- **5.** A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can +be released.
- **6.** If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
- 7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
- **8.** Produced water will not be used during any part of the plugging operation.
- 9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
- **10.** All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- 11. Class 'C' cement will be used above 7500 feet.
- 12. Class 'H' cement will be used below 7500 feet.
- **13.** A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
- **14.** All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.
- **16.** When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
- 17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
- **18.** A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).

- 19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
- 20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
- A) Fusselman
- B) Devonian
- C) Morrow
- D) Wolfcamp
- E) Bone Springs
- F) Delaware
- G) Any salt sections
- H) Abo
- I) Glorieta
- J) Yates.
- K) Potash---(In the R-111-P Area (Potash Mine Area),

A solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.

**21.** If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing.

# DRY HOLE MARKER REQ.UIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

- 1. Operator name
- 2. Lease and Well Number
- 3. API Number
- 4. Unit letter
- 5. Quarter Section (feet from the North, South, East or West)
- 6. Section, Township and Range
- 7. Plugging Date
- 8. County

# SPECIAL CASES ----AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

## SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION

Page 1

# **Wellbore Schematic**

Printed: 11/30/2022

API # 3002510422 **LMPSU # 31** BOLO ID: 300029.03.01 GL Elev. 3,355.00 KOP: 1980 FNL & 860 FEL LMPSU # 31, 11/30/2022 EOC: Section 22, Township 22S, Range 37E County, State: Lea, NM Fill Depth: Aux ID: 41900 PBTD: 3,685.00 KB' correction: ; All Depths Corr To: TD: 3,654.00 BOP: **Hole Size** Diameter **Date Drilled** Top At Btm At 15.0000 0.00 250.00 Bore size estimated. 10.7500 250.00 1,048.00 Bore size estimated. 7.8750 1,048.00 3,380.00 Bore size estimated. 3,685.00 6.0000 3,380.00 Open Hole. 1,000 Date Ran: 10/24/2008 Surface Casing Description # Diameter Weight Grade Length Btm At Top At Casing 12.5000 250.00 250.00 50.00 0.00 Date Ran: Intermediate Casing 10/24/2008 W eight Description Diameter Grade Length Top At Btm At Casing 8.2500 32.00 1,048.00 0.00 1,048.00 Date Ran: Production Casing 10/24/2008 2,000 Description Diameter W eight Grade Length Top At Btm At Casing 7.0000 20.00 3.380.00 0.00 3.380.00 7" by log and conservative estimate. 6.625" 24# by well file. Cement Top At O D #Sx Wt. Btm At ΙD **TOC Per** #-Type Class 250.00 12.500 15.000 10 90 TOC Unknown.; TOC Unknown. 20 1,048.00 8.250 10.750 150 TOC Unknown.; TOC Unknown. 3,000 0.00 1,190.00 7.875 Circ 30 160 7.875 40 250 3,380.00 6.625 TOC Unknown.; TOC Unknown. Zone and Perfs **SEVEN RIVERS** Comments / Completion Summary 3/3/1937: Acidize open hole. Well record comments that this had no effect. 4.000 3/10/1937: Shot OH with Nitro. 11/22/1955: Frac treatment (sand-oil) on OH. Perforations Bottom #/Ft Ttl# Top **Formation** Status Opened Closed 3,845.00 Penrose Sand 3,380.00 **Tubing** Date Ran: 10/7/2008 Description # Diameter Weight Grade Length Top At Btm At Tubing 97 2.3750 3,191.00 0.00 3,191.00 5.000

Packer

6.6250


4.00

3,191.00

3,195.00



Langlie-Mattix Penrose Sand Unit #31		API#:	30-025-10422			
Field/Pool:	Langlie-Mattix	Section:		22		
County:	Lea	Township:	<b>22S</b>	Range:	37E	
State:	New Mexico	Location:	1980' FNL x 860' FWL		Author:	
Spud Date:	8/11/1936	GL:	3355'	PBTD:	3680'	J. Valdez

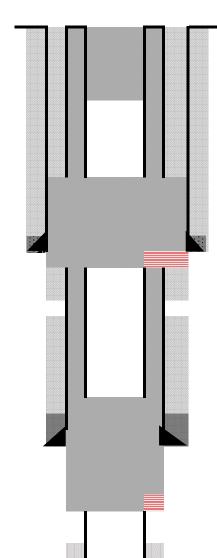

Description	O.D.	Weight	Тор	Depth	Hole	Cmt Sx	TOC
Surface	12.5	50	0	250	15	90 sx	0' calc
Intermediate	8.625	32	0	1120	9.875	200 sx	Top Job 2008
Production	6.625	24	0	3380	8.125	250 sx	2148' Log
Open Hole	6"				6"	ОН	N/A

- 9. Cut off well head, verify cmt at surface, weld on dry hole marker.
- 8. Spot 25 sx cmt @ 100'. (Surface Plug)
- 12.5" Surface Casing @ 250'
- 7. Perf & Sqz 30 sx cmt @ 300'-200'. WOC & Tag. (Surf Csg Shoe)

Top job in 2008- 30 sx pumped through 1" string in 8.625" x 12.25" annulus. Fill to surface

Formation Tops:		
Rustler (T-Salt)	1223'*	
Transil (B-Salt)	2438'*	
Yates	2608'*	
7Rivers	2804'*	
Queen	3374'*	

<sup>\*</sup> Used offset well LMPSU #141

8.625" Intermediate Casing @ 1120'

 $6.625^{\prime\prime}$  csg squeezed with 160 sx to surface @ 1190' in Oct 2008

6. Perf & Sqz 59 sx cmt @ 1273'-1070'. WOC & Tag (Rustler T-salt/ Int. Casing Shoe/ Sqz holes)

Cement bridges seen in log @ 1510'

Cement bridges seen in log @ 1694'

Est TOC 2148' (log)

5. Spot 71 sx cmt @ 2488-2098'. WOC & Tag (Transil (B-salt)/ Est TOC in 6.625")

- 4. Spot 25 sx cmt @2658'-2558'. (Yates)
- 3. Circ hole with MLF and P/T casing to 500 # witnessed by NMOCD rep.
- 2. MIRU cementers. RIH with tubing, tag CIBP, spot 25 sx. WOC & Tag-record depth.
- 1. PUMU 6.625" CIBP. RIH and set @ 3300'.

6.625" Production Casing @ 3380'

6" Open Hole Completion 3380'-3680'

PBTD= 3680' TD =3685'

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

**State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division** 1220 S. St Francis Dr. **Santa Fe, NM 87505** 

COMMENTS

Action 177559

# **COMMENTS**

Operator:	OGRID:
LEGACY RESERVES OPERATING, LP	240974
15 Smith Road	Action Number:
Midland, TX 79705	177559
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

### COMMENTS

Ī	Created By		Comment Date
	plmartinez	DATA ENTRY PM	2/16/2023

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

**State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division** 1220 S. St Francis Dr. **Santa Fe, NM 87505** 

CONDITIONS

Action 177559

# **CONDITIONS**

Operator:	OGRID:
LEGACY RESERVES OPERATING, LP	240974
15 Smith Road	Action Number:
Midland, TX 79705	177559
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

### CONDITIONS

Created By		Condition Date
kfortner	See attached COA	2/15/2023