office	State of New Mexico	Form C-103
<u>District I</u> – (575) 393-6161	Energy, Minerals and Natural Resources	Revised July 18, 2013
1625 N. French Dr., Hobbs, NM 88240 <u>District II</u> – (575) 748-1283	OIL CONSERVATION DIVISION	WELL API NO. 30-025-42448
811 S. First St., Artesia, NM 88210 District III – (505) 334-6178	1220 South St. Francis Dr.	5. Indicate Type of Lease
1000 Rio Brazos Rd., Aztec, NM 87410	Santa Fe, NM 87505	STATE FEE
<u>District IV</u> – (505) 476-3460 1220 S. St. Francis Dr., Santa Fe, NM 87505	Santa Fe, INVI 87505	6. State Oil & Gas Lease No.
SUNDRY NOT	ICES AND REPORTS ON WELLS	7. Lease Name or Unit Agreement Name
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		
		MADERA SWD 8. Well Number #1
1. Type of Well: Oil Well Gas Well Other SWD		9. OGRID Number 308339
2. Name of Operator OWL SWD	OPERATING. LLC	9. OGRID Number 508539
OWL SWD OPERATING, LLC 3. Address of Operator		10. Pool name or Wildcat
8201 Preston Rd, Suite 520; Dalla	as, TX 75225	SWD; DEVONIAN (96101)
4. Well Location		
Unit Letter N_:	_433feet from theSOUTH line and	_1970feet from theWESTline
Section 14	Township 24 S Range 34 E	NMPM County LEA
	11. Elevation (Show whether DR, RKB, RT, GR, etc.))
	3464' GR	
12 Chastr	Ammoniate Day to Indicate Nature of Nation	Demont on Othen Date
12. Check A	Appropriate Box to Indicate Nature of Notice,	Report or Other Data
NOTICE OF IN	ITENTION TO: SUB	SEQUENT REPORT OF:
PERFORM REMEDIAL WORK	PLUG AND ABANDON	K 🛛 ALTERING CASING 🗌
TEMPORARILY ABANDON	CHANGE PLANS COMMENCE DR	ILLING OPNS. P AND A
PULL OR ALTER CASING	MULTIPLE COMPL CASING/CEMEN	T JOB 🛛
DOWNHOLE COMMINGLE		
CLOSED-LOOP SYSTEM		
OTHER:	OTHER:	
of starting any proposed w	oleted operations. (Clearly state all pertinent details, an ork). SEE RULE 19.15.7.14 NMAC. For Multiple Con	
proposed completion or rec	completion.	
8/27/21 – Ran Injection Survey Loc		
9/12/21 – MIRU Workover rig. NU/	/test BOPs	
9/13/21 – Attempted to latch onto fi	sh top/hanger. Pulled 16.6" tubing.	
9/14/21 – RIH, tag fish @51.65'. At	ttempt to latch onto fish.	
9/15/21 – RU casing crew. RIH, late	ch onto fish. Retrieved 84' tubing	
9/16/21 – Attempt to work tools over	er fish at 225'	
Spud Date:	Rig Release Date:	
Spud Date.		
I hereby certify that the information	above is true and complete to the best of my knowledg	e and belief.
SIGNATURE LUCAS S	heward TITLE Operations Engineer	DATE12/10/2021
Type or print name _Lucas Sheward For State Use Only	L_E-mail address:lsheward@oilfieldwaterlogistics.	com_ PHONE: _432-242-8991
APPROVED BY: Yung 40 Conditions of Approval (if affy):	TITLE Compliance Officer	A
Conditions of Approval (if any):		

•

9/17/21 - Run W/L through tubing

9/18/21 - Rig Down workover rig

10/27/21-10/30/21 MIRU

10/31/21 - RIH w/ fishing tools. Tag fish @ 247'. RIH w/ jet cutter. Attempted cut at 17,315'. POOH. RIH w/ 2nd cutter. Cut 5.5" tubing at 10,060'. POOH w/ tubing.

11/1/21 – Finish POOH w/ 5.5" tubing.

11/2/21 - RIH w/ camera. Found part in 10.75" at 150' with 7' void @ 157'. RIH w/ dress off tool

11/3/21 – Resume fishing operations

11/5/21 – Fishing 5.5" tubing

11/6/21 – Finish pulling 5.5" tubing and complete seal assembly. RIH with 10.75" scraper.

11/7/21 - Attempt to RIH w/ 7.625" packer

11/8/21 – Attempt to RIH with 7.625" retrievable bridge plug, unable to get through 10.75".

11/9/21 - RU to pump test 13-5/8". Gravity fed 40 bbls fresh water. 16" and 13-5/8" not full after 40 bbls.

11/10/21 - RIH with 7-5/8" tubing. Tagged at 10,168'.

11/11/21 - POOH w/7-5/8" tubing. TIH w/ 6 ½" bit

11/12/21 – TIH w/ 4 ¹/₂" DP & Bit. Make hydraulic repairs on rig. Tagged at 10,181'. Cont'd TIH to 10,400'. POOH and did not see overpull at 10,181' when POOH.

11/13/21 – Resume POOH. PU 12 jts 7 5/8" csg. TIH through 10 ³/4" part. RU/WL to make GR and plug run. Tagged liner at 10,186'. Worked through to 10,406'. POOH w/ WL. PU and RIH w/ 7 5/8" WL RBP. Set plug at roughly 10,300'. POOH w/ WL. POOH w/ 12 jts 7 5/8" csg.

11/14/21 – Rig repairs and downtime. TIH w/ 4'' DP to 6213'. RU Halliburton cementers. Pump 35 bbl gel spacer, 5bpm @ 300psi. Pump 145 sacks #15.6 cmt 4 bpm @ 200 psi. Pump 7 bbl gel spacer 8 bpm @ 130 psi. Pump 74 bbls displacement 8 bpm @ 130 psi. Shut down pumps. POOH to 4916'. Circulated 3 wellbore volumes no cmt came across shakers. Shut down pumps. POOH to 4547' and WOC.

11/15/21 - POOH w/ DP. RU slickline. RIH w/ slickline tag plug @ 5843'. POOH. Rig downtime. Prep for backoff casing job on 10 ³/₄''.

11/16/21 - PU/MU fishing spear for 10 ³/₄". Latched into 10 ³/₄" and POOH. Recovered 132' of 10 ³/₄". PU spear, grapple and RIH to backoff 10 ³/₄" below 1300'.

11/17/21 – Continue backoff job. POOH 1595' of 10 ³/₄'' casing and LD. Total of 1727' 10 3/4'' recovered from well. RIH w/ WL and perform CBL & casing inspection log from 1700' to surface. Tools not working POOH.

11/18/21 - Continue RIH w/ WL to perform log. Send log to office and review possible casing part at 141'. Wait on orders.

11/19/21 – Wait on orders. Rig repairs and downtime. RIH w/ 4 $\frac{1}{2}$ " DP and 12 $\frac{3}{4}$ " OD on/off tool to attempt to run through casing part before setting RBP. Could not get through part. Wait on 13 5/8" spear.

11/20/21 - Wait on spear. Rig repairs and downtime.

11/21/21 - RU spear, RIH w/ spear and engage. Pulled 150k over and no movement. Unable to pull top parted fish of 13 5/8". POOH w/ spear. Wait on string mill to arrive. RIH w/ 12 ³/₄" string mill through part down to 185'. POOH w/ string mill. PU and RIH w/ DP and 12 ³/₄" on/off tool. Unable to get through part with tool. POOH w/ tool. Wait on casing jacks to arrive for 13 5/8".

11/22/21 - Jacks will not work. Unable to locate jacks for 13 5/8". Wait on orders. Order larger string mill.

11/23/21 – PU/RIH w/ 12.40" OD string mill. Work mill through part down to 200'. POOH w/ string mill. PU/RIH w/ 13 5/8" RBP on DP.

11/24/21 – Continue RIH w/ DP and 13 5/8" RBP to 1600'. Set plug @ 1600'. POOH w/ setting tool. RIH w/ pkr and test plug. Good test. Dump sand on top of plug. POOH w/ pkr. RU/WL and RIH to 1490-91' to shoot squeeze holes. POOH w/ WL. PU DP and RIH to 1504'. Wait on Halliburton.

11/25/21 – RU Halliburton cementers. Pump 20 bbl gel spacer 3 bpm @ 110 psi. Pump 38 bbls cmt #14.8 4 bpm @ 140 psi. Pump 2 bbl spacer 3 bpm @ 23 psi. Displace w/ 11 bbls 4 bpm @ 72 psi. Shut down pumps. POOH w/ DP. MU/PU 13 5/8" pkr and RIH to 300' set pkr. Pump displacement @ 1 bpm pressure up to 2300 psi. Held pressure for 2 hours. Bleed off and release pkr. POOH w/ pkr.

11/26/21 – WOC. RIH w/ DP and 12 ¼" bit. Tag TOC @ 1279'. Drill out cmt. POOH w/ bit. RU/WL for CBL to 1548'. Wait on orders

11/27/21 – RU/WL for another CBL from 1548' to surface. RIH log, POOH. Wait on orders. Perforate 1100-1101' squeeze holes. PU/MU pkr. RIH w/ pkr to 599'and set. Perform injection test. 4 bpm @ 116 psi. 5 bpm @ 215 psi. Release packer and POOH. RIH w/ 13 5/8 retainer and set @ 966'. POOH. RIH w/ stinger.

11/28/21 – RU Halliburton cementers. Pump 20 bbls gel spacer. Pump 100 bbls #14.8 cmt 5 bpm @ 650 psi. Displace w/ 11 bbls brine. Shut down pumps. POOH and circulate. WOC.

11/29/21 - WOC. RIH w/ bit and DP. Begin drilling out retainer.

11/30/21 – Drilling out retainer and cement.

12/1/21 – Drilling out retainer and cement.

12/2/21 – POOH w/ bit and DP. RU/WL and RIH CBL from 1550' to surface. Wait on orders.

12/3/21 – Wait on orders.

12/4/21 – RIH w/ pkr and test RBP. Good test. POOH. Lost pkr in hole. Fish out pkr. RIH w/ pkr/plug test multiple intervals between squeeze holes. Downtime rig repairs. Continue testing casing w/ plug/pkr. POOH. RIH w/ DP to 1550' fill pipe and circulate while finish building LCM/HI-VIS pill.

12/5/21 – RU Halliburton cementers. Pump 18 bbls gel spacer 4 bpm @ 160 psi. Pump 33 bbls #12.7 cmt 4 bpm @ 150 psi. Pump 14 bbls displacement 5 bpm @ 115 psi. SD pumps. POOH to surface. WOC.

12/6/21 – RIH w/ bit to tag TOC @ 1383'. POOH to surface. RIH w/ retainer to 1010' and set. POOH. RIH w/ stinger and sting into retainer. Pump 20 bbls gel spacer 3 bpm @ 350 psi. Pump 80 bbls #12.5 cmt 3 bpm @ 275-500 psi. Wait 20 mins and pump another 20 bbls #12.5 cmt 3 bpm @ 350 psi. Displace w/ 12 bbls @ 430 psi. Red dye is seen circulating at surface as well as good cement returns to surface during job. Sting out of retainer. Circulate and POOH to surface. WOC.


12/7/21 – WOC. PU/MU bit. Drill out retainer and cmt to 1383'. POOH to surface.

12/8/21 - RU/WL and RIH CBL from 1300' to surface. Good cement bond from 1300' to 516' per HES. Wait on orders.

12/9/21 – Drill out cmt plug from 1383' to 1560'.

12/10/21 – Continue DO plug from 1383' to 1560'. CHC and POOH to surface. RU/WL and RIH CBL from 1550' to surface. Good cement bond from 1540' to 1350' and from 1250' to 250' per HES technical team. Prep to retrieve 13 5/8 RBP at 1600'.

Received by OCD: 12/10/2021 9:16:35 PM

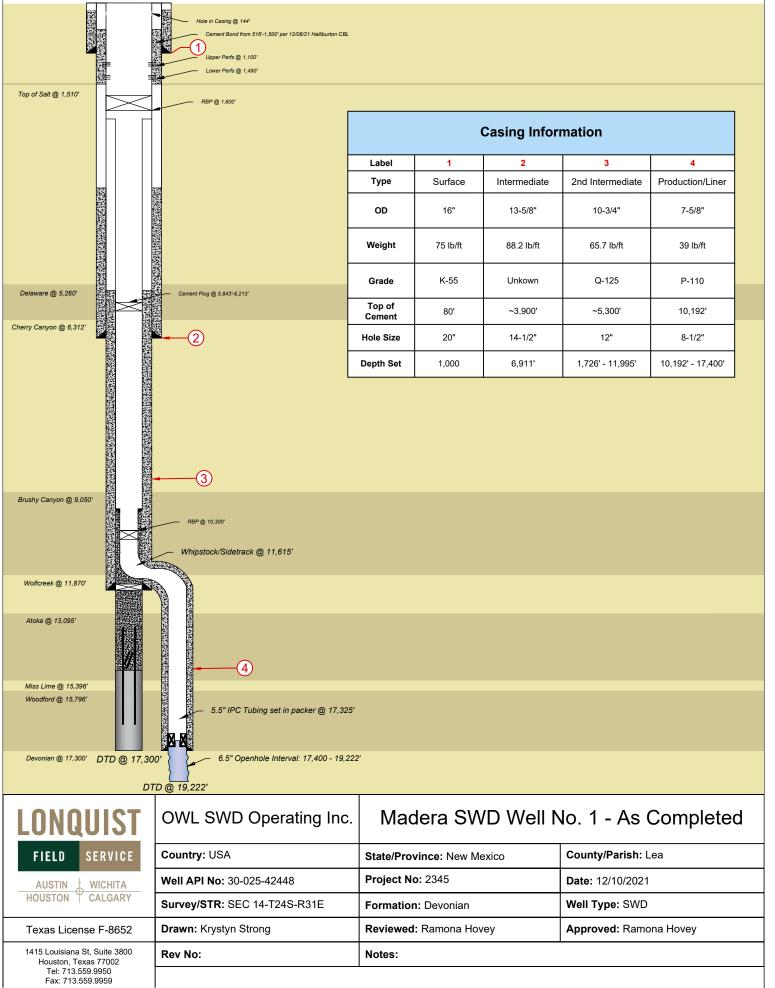

ceived by OCD; 12/10/2021 9:16:3	State of New Mexico	Form C-103 of
Office District I – (575) 393-6161	Energy, Minerals and Natural Resources	Revised July 18, 2013
1625 N. French Dr., Hobbs, NM 88240 District II – (575) 748-1283	OIL CONSERVATION DIVISION	WELL API NO. 30-025-42448
811 S. First St., Artesia, NM 88210 District III – (505) 334-6178		5. Indicate Type of Lease
$\frac{D13trict III}{1000 \text{ Rio Brazos Rd., Aztec, NM 87410}}$	1220 South St. Francis Dr.	STATE FEE
<u>District IV</u> – (505) 476-3460 1220 S. St. Francis Dr., Santa Fe, NM 87505	Santa Fe, NM 87505	6. State Oil & Gas Lease No.
	ICES AND REPORTS ON WELLS	7. Lease Name or Unit Agreement Name
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH		MADERA SWD
PROPOSALS.)		8. Well Number #1
1. Type of Well: Oil Well Gas Well Other SWD 2. Name of Operator		9. OGRID Number 308339
	OPERATING. LLC	9. OGKID Nulliber 308339
OWL SWD OPERATING, LLC 3. Address of Operator		10. Pool name or Wildcat
8201 Preston Rd, Suite 520; Dallas, TX 75225		SWD; DEVONIAN (96101)
4. Well Location		
Unit Letter N :	433 feet from the SOUTH line and	1970 feet from the WEST line
Section 14	Township 24 S Range 34 E	
	11. Elevation (Show whether DR, RKB, RT, GR, etc.	
	3464' GR	
12 Charle	Appropriate Box to Indicate Nature of Notice,	Parant or Other Data
12. Check	Appropriate Box to indicate Nature of Notice,	Report of Other Data
NOTICE OF IN	NTENTION TO: SUB	SEQUENT REPORT OF:
PERFORM REMEDIAL WORK	PLUG AND ABANDON	K 🛛 🛛 ALTERING CASING 🗌
TEMPORARILY ABANDON	CHANGE PLANS COMMENCE DR	ILLING OPNS. P AND A
PULL OR ALTER CASING	MULTIPLE COMPL CASING/CEMEN	T JOB
DOWNHOLE COMMINGLE		
CLOSED-LOOP SYSTEM	_	
OTHER:		
	pleted operations. (Clearly state all pertinent details, an ork). SEE RULE 19.15.7.14 NMAC. For Multiple Con- completion	
8/27/21 – Ran Injection Survey Loc		
8/27/21 – Ran Injection Survey Loc 9/12/21 – MIRU Workover rig. NU		
	/test BOPs	
9/12/21 – MIRU Workover rig. NU 9/13/21 – Attempted to latch onto fi	/test BOPs ish top/hanger. Pulled 16.6" tubing.	
9/12/21 – MIRU Workover rig. NU	/test BOPs ish top/hanger. Pulled 16.6" tubing. ttempt to latch onto fish.	
9/12/21 – MIRU Workover rig. NU 9/13/21 – Attempted to latch onto fi 9/14/21 – RIH, tag fish @51.65'. A	/test BOPs ish top/hanger. Pulled 16.6" tubing. ttempt to latch onto fish. ch onto fish. Retrieved 84' tubing	
9/12/21 – MIRU Workover rig. NU 9/13/21 – Attempted to latch onto fi 9/14/21 – RIH, tag fish @51.65'. A 9/15/21 – RU casing crew. RIH, late 9/16/21 – Attempt to work tools ove	/test BOPs ish top/hanger. Pulled 16.6" tubing. ttempt to latch onto fish. ch onto fish. Retrieved 84' tubing er fish at 225'	
9/12/21 – MIRU Workover rig. NU 9/13/21 – Attempted to latch onto fi 9/14/21 – RIH, tag fish @51.65'. A 9/15/21 – RU casing crew. RIH, late 9/16/21 – Attempt to work tools ove	/test BOPs ish top/hanger. Pulled 16.6" tubing. ttempt to latch onto fish. ch onto fish. Retrieved 84' tubing	
9/12/21 – MIRU Workover rig. NU 9/13/21 – Attempted to latch onto fi 9/14/21 – RIH, tag fish @51.65'. A 9/15/21 – RU casing crew. RIH, late 9/16/21 – Attempt to work tools ove Spud Date:	/test BOPs ish top/hanger. Pulled 16.6" tubing. ttempt to latch onto fish. ch onto fish. Retrieved 84' tubing er fish at 225' Rig Release Date:	re and belief
9/12/21 – MIRU Workover rig. NU 9/13/21 – Attempted to latch onto fi 9/14/21 – RIH, tag fish @51.65'. A 9/15/21 – RU casing crew. RIH, late 9/16/21 – Attempt to work tools ove Spud Date:	/test BOPs ish top/hanger. Pulled 16.6" tubing. ttempt to latch onto fish. ch onto fish. Retrieved 84' tubing er fish at 225'	e and belief.
9/12/21 – MIRU Workover rig. NU 9/13/21 – Attempted to latch onto fi 9/14/21 – RIH, tag fish @51.65'. A 9/15/21 – RU casing crew. RIH, late 9/16/21 – Attempt to work tools ove Spud Date:	/test BOPs ish top/hanger. Pulled 16.6" tubing. ttempt to latch onto fish. ch onto fish. Retrieved 84' tubing er fish at 225' Rig Release Date:	ye and belief.
9/12/21 – MIRU Workover rig. NU. 9/13/21 – Attempted to latch onto fi 9/13/21 – RIH, tag fish @51.65'. At 9/14/21 – RIH, tag fish @51.65'. At 9/15/21 – RU casing crew. RIH, late 9/16/21 – Attempt to work tools over Spud Date: I hereby certify that the information SIGNATURE Lucas	/test BOPs ish top/hanger. Pulled 16.6" tubing. ttempt to latch onto fish. ch onto fish. Retrieved 84' tubing er fish at 225' Rig Release Date:	DATE12/10/2021
9/12/21 – MIRU Workover rig. NU. 9/13/21 – Attempted to latch onto fi 9/13/21 – RIH, tag fish @51.65'. At 9/14/21 – RIH, tag fish @51.65'. At 9/15/21 – RU casing crew. RIH, late 9/16/21 – Attempt to work tools over Spud Date: I hereby certify that the information SIGNATURE Lucas Sheward	/test BOPs ish top/hanger. Pulled 16.6" tubing. ttempt to latch onto fish. ch onto fish. Retrieved 84' tubing er fish at 225' Rig Release Date: above is true and complete to the best of my knowledg Chward TITLEOperations Engineer	DATE12/10/2021

•

9/17/21 - Run W/L through tubing

9/18/21 - Rig Down workover rig

10/27/21-10/30/21 MIRU

10/31/21 - RIH w/ fishing tools. Tag fish @ 247'. RIH w/ jet cutter. Attempted cut at 17,315'. POOH. RIH w/ 2nd cutter. Cut 5.5" tubing at 10,060'. POOH w/ tubing.

11/1/21 – Finish POOH w/ 5.5" tubing.

11/2/21 - RIH w/ camera. Found part in 10.75" at 150' with 7' void @ 157'. RIH w/ dress off tool

11/3/21 – Resume fishing operations

11/5/21 – Fishing 5.5" tubing

11/6/21 – Finish pulling 5.5" tubing and complete seal assembly. RIH with 10.75" scraper.

11/7/21 - Attempt to RIH w/ 7.625" packer

11/8/21 – Attempt to RIH with 7.625" retrievable bridge plug, unable to get through 10.75".

11/9/21 - RU to pump test 13-5/8". Gravity fed 40 bbls fresh water. 16" and 13-5/8" not full after 40 bbls.

11/10/21 - RIH with 7-5/8" tubing. Tagged at 10,168'.

11/11/21 - POOH w/7-5/8" tubing. TIH w/ 6 ½" bit

11/12/21 – TIH w/ 4 ¹/₂" DP & Bit. Make hydraulic repairs on rig. Tagged at 10,181'. Cont'd TIH to 10,400'. POOH and did not see overpull at 10,181' when POOH.

11/13/21 – Resume POOH. PU 12 jts 7 5/8" csg. TIH through 10 ³/4" part. RU/WL to make GR and plug run. Tagged liner at 10,186'. Worked through to 10,406'. POOH w/ WL. PU and RIH w/ 7 5/8" WL RBP. Set plug at roughly 10,300'. POOH w/ WL. POOH w/ 12 jts 7 5/8" csg.

11/14/21 – Rig repairs and downtime. TIH w/ 4'' DP to 6213'. RU Halliburton cementers. Pump 35 bbl gel spacer, 5bpm @ 300psi. Pump 145 sacks #15.6 cmt 4 bpm @ 200 psi. Pump 7 bbl gel spacer 8 bpm @ 130 psi. Pump 74 bbls displacement 8 bpm @ 130 psi. Shut down pumps. POOH to 4916'. Circulated 3 wellbore volumes no cmt came across shakers. Shut down pumps. POOH to 4547' and WOC.

11/15/21 - POOH w/ DP. RU slickline. RIH w/ slickline tag plug @ 5843'. POOH. Rig downtime. Prep for backoff casing job on 10 ³/₄''.

11/16/21 - PU/MU fishing spear for 10 ³/₄". Latched into 10 ³/₄" and POOH. Recovered 132' of 10 ³/₄". PU spear, grapple and RIH to backoff 10 ³/₄" below 1300'.

11/17/21 – Continue backoff job. POOH 1595' of 10 ³/₄'' casing and LD. Total of 1727' 10 3/4'' recovered from well. RIH w/ WL and perform CBL & casing inspection log from 1700' to surface. Tools not working POOH.

11/18/21 - Continue RIH w/ WL to perform log. Send log to office and review possible casing part at 141'. Wait on orders.

11/19/21 – Wait on orders. Rig repairs and downtime. RIH w/ 4 $\frac{1}{2}$ " DP and 12 $\frac{3}{4}$ " OD on/off tool to attempt to run through casing part before setting RBP. Could not get through part. Wait on 13 5/8" spear.

11/20/21 - Wait on spear. Rig repairs and downtime.

11/21/21 - RU spear, RIH w/ spear and engage. Pulled 150k over and no movement. Unable to pull top parted fish of 13 5/8". POOH w/ spear. Wait on string mill to arrive. RIH w/ 12 ³/₄" string mill through part down to 185'. POOH w/ string mill. PU and RIH w/ DP and 12 ³/₄" on/off tool. Unable to get through part with tool. POOH w/ tool. Wait on casing jacks to arrive for 13 5/8".

11/22/21 - Jacks will not work. Unable to locate jacks for 13 5/8". Wait on orders. Order larger string mill.

11/23/21 – PU/RIH w/ 12.40" OD string mill. Work mill through part down to 200'. POOH w/ string mill. PU/RIH w/ 13 5/8" RBP on DP.

11/24/21 – Continue RIH w/ DP and 13 5/8" RBP to 1600'. Set plug @ 1600'. POOH w/ setting tool. RIH w/ pkr and test plug. Good test. Dump sand on top of plug. POOH w/ pkr. RU/WL and RIH to 1490-91' to shoot squeeze holes. POOH w/ WL. PU DP and RIH to 1504'. Wait on Halliburton.

11/25/21 – RU Halliburton cementers. Pump 20 bbl gel spacer 3 bpm @ 110 psi. Pump 38 bbls cmt #14.8 4 bpm @ 140 psi. Pump 2 bbl spacer 3 bpm @ 23 psi. Displace w/ 11 bbls 4 bpm @ 72 psi. Shut down pumps. POOH w/ DP. MU/PU 13 5/8" pkr and RIH to 300' set pkr. Pump displacement @ 1 bpm pressure up to 2300 psi. Held pressure for 2 hours. Bleed off and release pkr. POOH w/ pkr.

11/26/21 – WOC. RIH w/ DP and 12 ¹/₄" bit. Tag TOC @ 1279'. Drill out cmt. POOH w/ bit. RU/WL for CBL to 1548'. Wait on orders

11/27/21 – RU/WL for another CBL from 1548' to surface. RIH log, POOH. Wait on orders. Perforate 1100-1101' squeeze holes. PU/MU pkr. RIH w/ pkr to 599'and set. Perform injection test. 4 bpm @ 116 psi. 5 bpm @ 215 psi. Release packer and POOH. RIH w/ 13 5/8 retainer and set @ 966'. POOH. RIH w/ stinger.

11/28/21 – RU Halliburton cementers. Pump 20 bbls gel spacer. Pump 100 bbls #14.8 cmt 5 bpm @ 650 psi. Displace w/ 11 bbls brine. Shut down pumps. POOH and circulate. WOC.

11/29/21 - WOC. RIH w/ bit and DP. Begin drilling out retainer.

11/30/21 – Drilling out retainer and cement.

12/1/21 – Drilling out retainer and cement.

12/2/21 – POOH w/ bit and DP. RU/WL and RIH CBL from 1550' to surface. Wait on orders.

12/3/21 – Wait on orders.

12/4/21 – RIH w/ pkr and test RBP. Good test. POOH. Lost pkr in hole. Fish out pkr. RIH w/ pkr/plug test multiple intervals between squeeze holes. Downtime rig repairs. Continue testing casing w/ plug/pkr. POOH. RIH w/ DP to 1550' fill pipe and circulate while finish building LCM/HI-VIS pill.

12/5/21 – RU Halliburton cementers. Pump 18 bbls gel spacer 4 bpm @ 160 psi. Pump 33 bbls #12.7 cmt 4 bpm @ 150 psi. Pump 14 bbls displacement 5 bpm @ 115 psi. SD pumps. POOH to surface. WOC.

12/6/21 – RIH w/ bit to tag TOC @ 1383'. POOH to surface. RIH w/ retainer to 1010' and set. POOH. RIH w/ stinger and sting into retainer. Pump 20 bbls gel spacer 3 bpm @ 350 psi. Pump 80 bbls #12.5 cmt 3 bpm @ 275-500 psi. Wait 20 mins and pump another 20 bbls #12.5 cmt 3 bpm @ 350 psi. Displace w/ 12 bbls @ 430 psi. Red dye is seen circulating at surface as well as good cement returns to surface during job. Sting out of retainer. Circulate and POOH to surface. WOC.


12/7/21 – WOC. PU/MU bit. Drill out retainer and cmt to 1383'. POOH to surface.

12/8/21 - RU/WL and RIH CBL from 1300' to surface. Good cement bond from 1300' to 516' per HES. Wait on orders.


12/9/21 – Drill out cmt plug from 1383' to 1560'.

12/10/21 – Continue DO plug from 1383' to 1560'. CHC and POOH to surface. RU/WL and RIH CBL from 1550' to surface. Good cement bond from 1540' to 1350' and from 1250' to 250' per HES technical team. Prep to retrieve 13 5/8 RBP at 1600'.

Received by OCD: 12/10/2021 9:16:35 PM

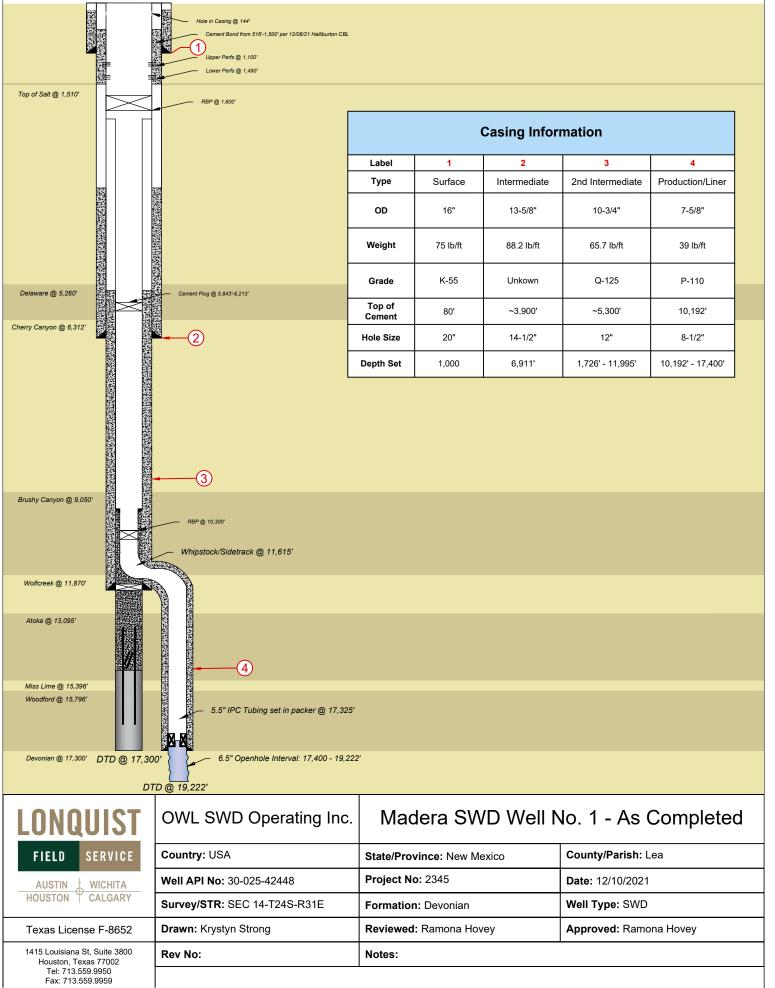

Received by OCD: 12/10/2021 9:16:35 PM

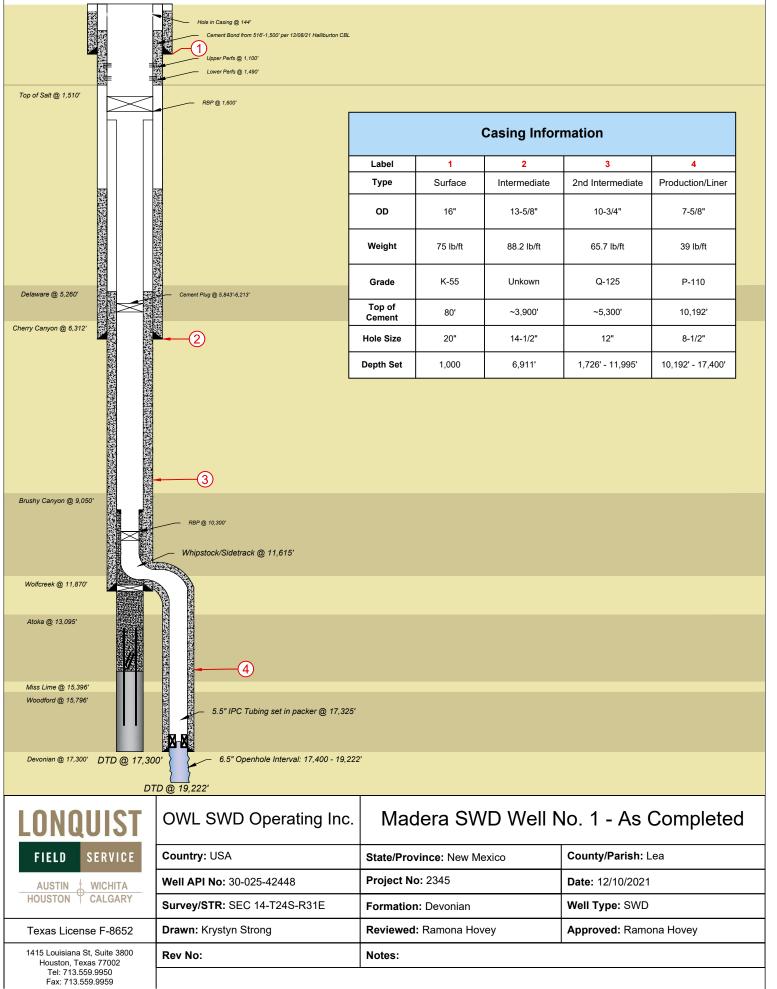

District I 1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

District IV 1220 S. St Francis Dr., Santa Fe, NM 87505 Phone: (505) 476-3470 Fax: (505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. Santa Fe, NM 87505

CONDITIONS

Operator:	OGRID:
OWL SWD OPERATING, LLC	308339
20 Greenway Plaza	Action Number:
Houston, TX 77046	66363
	Action Type:
	[C-103] Sub. Workover (C-103R)
	•

CONDITIONS

Created By		Condition Date
kfortner	None	9/25/2023

Page 10 of 10

Action 66363