District I

1625 N. French Dr., Hobbs, NM 88240 Phone: (575) 393-6161 Fax: (575) 393-0720

District II

811 S. First St., Artesia, NM 88210 Phone: (575) 748-1283 Fax: (575) 748-9720 **District III**

1000 Rio Brazos Road, Aztec, NM 87410 Phone: (505) 334-6178 Fax: (505) 334-6170

District IV

1220 S. St. Francis Dr., Santa Fe, NM 87505 Phone: (505) 476-3460 Fax: (505) 476-3462

State of New Mexico

Form C-101 Revised July 18, 2013

Energy Minerals and Natural Resources

Oil Conservation Division

☐AMENDED REPORT

Expiration Date: **04/16/2026**

1220 South St. Francis Dr.

Santa Fe, NM 87505

			Derator Name BC&D Operator Name 2702 N. Grir	ating Inc.		,		Σ. ΄	OGRID Numl 25670 3. API Number 5-52781	oer	
^{4.} Property 335723	Code				roperty Name Ina 26-25-3				°. W	ell No.	
333123		<u> </u>			face Location			•		•	
UL - Lot	Section 26	Township 25S	Range 37E	Lot Idn	Feet from 165	N/S Lin	ne	Feet From 195	E/W Line	County Lea	
				8 Proposed	Bottom Hol	e Locatio	n			-	
UL - Lot	Section	Township	Range	Lot Idn	Feet from	N/S Lin	ne	Feet From	E/W Line	County	
				9. Poo l	I Information	1					
				SWD, San						Pool Code 96121	
					Well Inform	ation					
11. Work 1			^{12.} Well Type		3. Cable/Rotary R			P P		Ground Level Elevation 3039'	
^{16.} Multi N C)		17. Proposed Depth 4838'	S	San Andres to be determined Upon C101 a					^{20.} Spud Date C101 approval	
Depth to Ground 40' (CP		POD1)	Dista	nce from nearest free 1.1 Miles NE		POD1)	Distance to nearest surface water No surface water within two m				
⊠We will be υ	sing a clo	sed-loop		f lined pits Proposed Casin	ng and Ceme	ent Progr	am				
Туре	Hole S	Size	Casing Size	Casing Weigl		Setting De		Sacks of Cen	nent	Estimated TOC	
Surface	13.5	50"	10.75"	45.5		870'		700		0'	
Production	8.7	5"	7"	26		4838	'	650		0'	
1											
			Casir	ng/Cement Prog	gram: Additi	onal Com	nments				
			22.	Proposed Blow	out Preventi	on Progr	-am				
	Туре			Working Pressure			est Pressure		М	anufacturer	
Annular & Rams 3000 psi				30	000 psi		to be	determined			
^{23.} I hereby certi	fy that the	informatio	n given above is t	rue and complete to	the		OW ~-				
best of my know I further certify	ledge and y that I ha	belief. ve compli e	ed with 19.15.14.	9 (A) NMAC a	nd/or		OIL CO	NSERVATIO	ON DIVIS	ION	
19.15.14.9 (B) No Signature:	MAC 🛛	, if applica	ıble.			oved By:					

Title:

Approved Date:

Conditions of Approval Attached

04/16/2024

E-mail Address: rhill@wellconsultant.com

Phone: (405) 837-8147

Printed name: Richard Hill

Title: SVP Engineering

Date: 1/28/2024

1625 N. French Dr., Hobbs, NM 88240 Phone: (575) 393-6161 Fax: (575) 393-0720

DISTRICT II

811 S. First St., Artesia, NM 88210 Phone: (575) 748-1283 Fax: (575) 748-9720 DISTRICT III

1000 Rio Brazos Road, Aztec, NM 87410 Phone: (505) 334-6178 Fax: (505) 334-6170


DISTRICT IV

State of New Mexico Energy, Minerals & Natural Resources Department OIL CONSERVATION DIVISION 1220 South St. Francis Dr. Santa Fe, New Mexico 87505

Form C-102 Revised August 1, 2011 Submit one copy to appropriate District Office

□AMENDED REPORT

30-025-	PI Number 52781			Pool Code 96121		Pool Name SWD, San Andres			
Property C 335723	ode			JA	Property Nam VELINA 26			We	ll Number 1
OGRID N 25670				BC &	Operator Nam D OPERAT	perator Name Elevation PERATING, INC 3039'			
					Surface Locat	ion			
UL or lot No.	Section	Township	Range	Lot Idn	Feet from the	North/South line	Feet from the	East/West line	County
D	26	25-S	37-Е		165	NORTH	195	WEST	LEA
				Bottom Hol	e Location If Diffe	erent From Surface			
UL or lot No.	Section	Township	Range	Lot Idn	Feet from the	North/South line	Feet from the	East/West line	County
Dedicated Acres	Joint or	: Infill C	 onsolidation C	Code Ord	er No.				

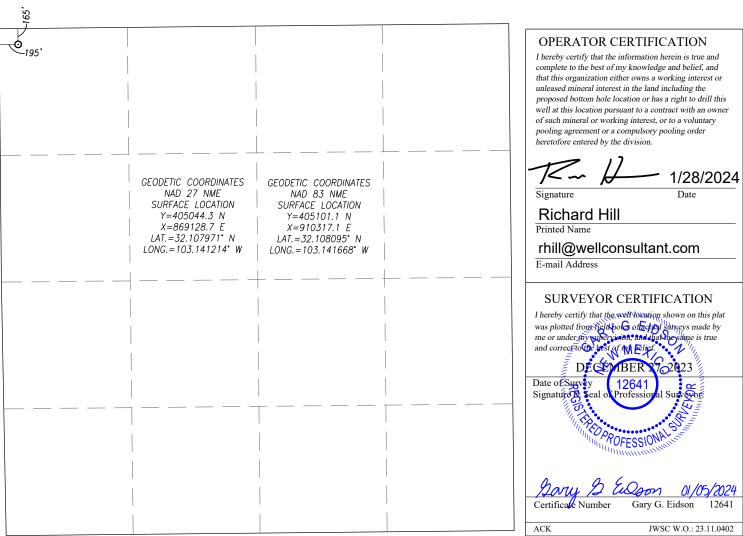

<u>DISTRICT I</u> 1625 N. French Dr., Hobbs, NM 88240 Phone: (575) 393-6161 Fax: (575) 393-0720 DISTRICT II
811 S. First St., Artesia, NM 88210
Phone: (575) 748-1283 Fax: (575) 748-9720
DISTRICT III
1000 Rio Brazos Road, Aztec, NM 87410

State of New Mexico Energy, Minerals & Natural Resources Department OIL CONSERVATION DIVISION 1220 South St. Francis Dr.


Form C-102 Revised August 1, 2011 Submit one copy to appropriate District Office

000 Rio Brazos Road, A Phone: (505) 334-6178 F DISTRICT IV	ax: (505) 334-6	170			Fe, New Me			□AM	ENDED REPOR
220 S. St. Francis Dr., S Phone: (505) 476-3460 F	anta Fe, NM 87 ax: (505) 476-3	⁷⁵⁰⁵ WELI	L LOCA	TION A	ND ACREA	AGE DEDICA	ATION PLA	T	
AP	I Number			Pool Code 96121		(Pool Nam SWD, San A		
Property Co	ode			IA	Property Nam VELINA 20	ne	,		ll Number
OGRID N	0.			373	Operator Nam			E	levation
25670	1			BC &	D OPERAT	ΓING, INC		3	3039'
					Surface Locat	tion		<u> </u>	
UL or lot No.	Section	Township	Range	Lot Idn	Feet from the	North/South line	Feet from the	East/West line	County
D	26	25-S	37-E		165	NORTH	195	WEST	LEA
				Bottom Hol	e Location If Diff	erent From Surface			
UL or lot No.	Section	Township	Range	Lot Idn	Feet from the	North/South line	Feet from the	East/West line	County
Dedicated Acres	Joint or	Infill Co	onsolidation Co	ode Ord	er No.				
NO ALLOWABLE WI		NED TO THIS COI		TIL ALL INTE	RESTS HAVE BEEN (CONSOLIDATED OR A 1	NON-STANDARD UNI	T HAS BEEN APPROVE	D BY THE DIVISIO
25-25071 5174 25-25141w 30-025- (E) 30-025-293 11675 sws30-025-1169 (M)	92 NESW 30-0 58 (K) 30-0 91 SESW (N) 30-025-2952	5-25842 _{WNE} (G) 30-025-23300 2 225-27245 _{SE} (J) 30-0 225-27449 30-0 SWSE (O)	(A) 168830-025-1168 SENE (H) 30-025-1169 NESE 25-11699 25-11696 SESE 30-025-1169	30-025-1 NWSW (L)	11705 30 02 32264 31 - 23 30 02 32 0 025 11 NES 30 02 5 11 30 02 5 22 96 130 02	25-21354 E 30-025-11715 (G) 30-025-11716 0-025-3196730-025-31965 25-25474 1703 NWSE 30-025-11706 (J) 30-025-31961 25-29527 30-025-2937 25-2290630-025-11707 SE (O) 30-025-211707 (O) 30-025-211707 (O) 30-025-211707 (O) 30-025-211707	30.025-11712 ³⁰ 30.025-1170830 30.025-1170830 30.025-1170830 30.025-11710 30.025-11712 30.025-11712 30.025-11712 30.025-11713		
SWN30-025-26	724 SENW	SWNE (G)		0-025-27 <u>683</u> _{IW} (E)	SENW (F) 30-025-11801	30-025-2096730-025- SWNE (G) 30-025-320	was p	URVEYOR CERT by certify that the well lock lotted from the linds of a under my property in me under my best of my free	ation shown on this p
NWS30-025-118	805 _{NESW} (K)	NW <u>30-025</u> (J)	11803 NESE (1)	0-025-1180930-I NWSW (L)	025-11791 NES30-025-2	22788 NWSE 30-025-11795	Date Sign	DESEMBER of Survey 12641	2762023
-11758 _{SWS} 30-025-26 (M)	563 _{SESW} (N)	SWSE (O)	SESE (P)	SWSW 30-025-	SESW 11788 30-025-11787	(0)	030-025-11 P) 30-025-11	PROFESSI On GO	
		2000		0	2000 Feet	025-11893	30-025-1 /2a		01/05/2024 G. Eidson 126
		2000		4 Ĭ	2000 7 881	•	Certi	neate indiliber Gary	G. EIGSUII 120


ACK

JWSC W.O.: 23.11.0402

Scale:1"=2000'

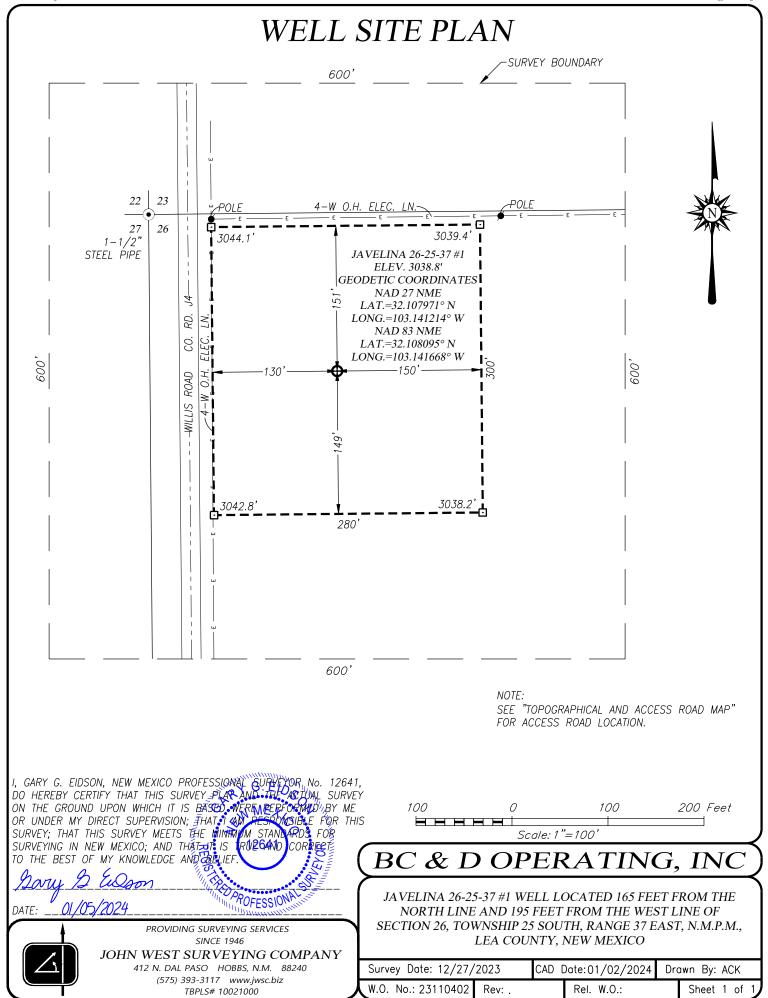

TOPOGRAPHIC AND ACCESS ROAD MAP

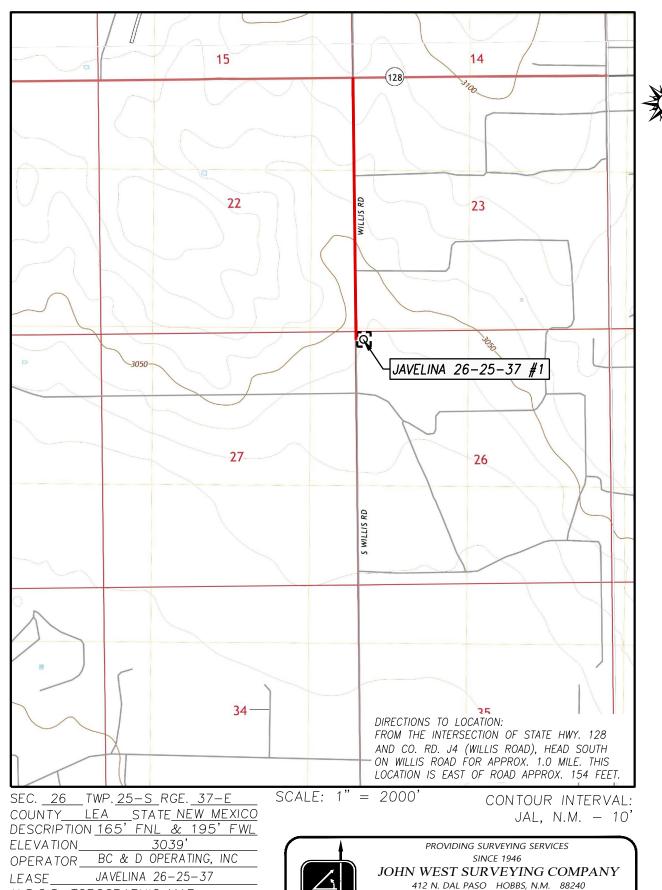

(575) 393-3117 www.jwsc.biz TBPLS# 10021000

U.S.G.S. TOPOGRAPHIC MAP

JAL, N.M. SURVEY N.M.P.M.

TOPOGRAPHIC AND ACCESS ROAD MAP



SEC. 26 TWP. 25-S RGE. 37-E
COUNTY LEA STATE NEW MEXICO
DESCRIPTION 165' FNL & 195' FWL
ELEVATION 3039'
OPERATOR BC & D OPERATING, INC
LEASE JAVELINA 26-25-37
U.S.G.S. TOPOGRAPHIC MAP

____SURVEY_N.M.P.M.

PROVIDING SURVEYING SERVICES

SINCE 1946

JOHN WEST SURVEYING COMPANY

412 N. DAL PASO HOBBS, N.M. 88240 (575) 393-3117 www.jwsc.biz TBPLS# 10021000

JAL, N.M.

BC&D Operating, Inc.

2702 N Grimes ST B Hobbs, New Mexico 88240 (405) 837-8147

Javelina 26-35-37 #1 SWD Central BASIN Platform DRILLING WELL PLAN January 28, 2024

	Well: Javelina 26-35-37 #1 SWD		Area: East Jal AF		AFE#		AFE COST:	
INFO	County: Lea		State: New Mexico	Rig:		RR COST:		
WELL II	API#		Permit#	Pern Dept	nit h(TVD)	4,838'		
Λ	MD:		TVD:	KB :	KB: 12°		GL Elev: KB Elev:	3,039'
	Survey:	Section 26, Township 35S, I	Range 37E					
ON	Co-ordinates:	Latitude:	32.107971° N (NAD 27)		Longitude:		103.141214° W (NAD	27)
ATI	Surface:	Survey Lines:	165' FNL & 195' FWL, Section	on 26	Lease Lines: 165	nes: 165' FNL & 195' FWL, Section 26		
LOCATION	Bottom Hole: Survey Lines:				Lease Lines:			
Ι	Directions:							

THIS WELL IS TO BE DRILLED WITH SAFETY AND PROTECTION OF THE ENVIRONMENT AS THE PRIMARY CONCERNS

Contacts:

Drilling Manager	
Drilling Engineer	
Drilling Superintendent	

Major Vendors:

Directional -	TBD	
Mud -	TBD	
Cement –	TBD	
Wellhead -	TBD	

BC&D Operating, Inc.	Javelina 26-25-37 #1 SWD Drilling Program		
	Lea Co., New Mexico	Version 1.0	Page 2 of 7

BC&D Operating, Inc. POLICY

Regulatory/NMOCD:

- Post a copy of the Drilling Permit and GAU letter in the BC&D Operating Representatives Office.
- Notify NMOCD 24 hours prior spud time and date.
- Notify NMOCD 12 hours prior to running casing and cementing.
- Notify NMOCD of any cement plugging or sidetracking.

BC&D Operating, Inc. Policy Requirements:

1. General

- o Any changes to the approved drilling program must go through the Drilling Engineer and Drilling Supt.
- All incidents and spills to be reported immediately and documented in morning report.
- Hold a pre-spud meeting with key vendors and Drilling Engineer/Supt prior to spud.
- Standing orders shall be posted at the Driller's Control Station.

2. Safety Equipment

- o Rig Fire Extinguishers in place at Rig-up. Engine kill switches/ water engine kill system in place and operational.
- o H2S Detection Equipment installed and Personnel Training by first nipple up.
- o Rotating Head installed on stack during first nipple up.
- o PVT system operational before spud.
- o Mud-Gas separator in service prior drilling out of 9-5/8" casing

3. Drilling

- o Lined up for a Soft Shut In.
- Slow Pump Rates (SPR's) shall be obtained every 500' of hole drilled or mud weight change of 1 #/gal. 20/30/40 on both pumps.
- Trip sheets shall be filled out for every trip in and out of the hole. BC&D Representative shall check the trip sheet to ensure accuracy. Any discrepancies to be reported to the BC&D Representative immediately. Trip sheets should be stored on location until the end of the well.
- o Barite stock levels must be able to accommodate weighting up the active system by 1ppg.
- A tested Full Opening Safety Valve (FOSV) with proper thread in the open position with proper wrench must be on the rig floor during all operations. FOSV to be functioned each tour.
- o A tested inside grey valve must be on the floor and in the open position
- $\circ\quad$ All BHA tools shall be measured and drifted.
- Reamers and bits need to be gauged w/ gauge ring in and out of hole.
- All subs and cross over to be a minimum length of three feet.
- \circ Drill pipe and BHA will be tested to DS1 CAT 4 with shear wave every third well.
- o Corrosion inhibitor should be rigged up and running prior to spud.
- O All shock subs, jars, and motors should be inspected prior to spud.

4. Casing & Cementing

- Fit test all circulating swages and circulating tools for casing operations.
- o Cement will **NOT** be pumped until a approved field blend test is available.
- Two pump trucks required for every string of casing being cemented.
- Wait a minimum of 4 hours on cement before making cuts and a minimum of 8 hours before drilling out.
- o Make sure to make proper accommodations for float equipment and x-overs to TDS before needing equipment. This should be ordered weeks in advance of running casing.
- When running D.V. tool on production casing, circulate minimum of 4 hours after opening tool. No cancelation bomb will be required.

BC&D Operating, Inc.	Javelina 26-25-37 #1 SWD Drilling Program			
	Lea Co., New Mexico	Version 1.0	Page 3 of 7	

5. Blowout Preventers

- o Refer to BOP schematic.
- Ref to manifold schematic.

6. Testing

- o Test BOP's every 21 days and function every trip (ensure on all trips this requirement is met).
- Next test date to be posted in office and carried on report.
- o Test Hydril to 2500 psi.
- o Test BOP on 9-5/8" casing to 3000 psi high and 250 psi low. Test casing to 1500 psi for 30 minutes.
- o Casing/BOP tests should all be charted and forwarded to office.
- All casing strings need to be tested third party and have chart documentation sent to the office.

7. Reports must include the following.

- o NMOCD spud notification, note the time, date, operator name and number.
- Why we tripped, any tight spots, and noted depth.
- Bit grade with pictures.
- o Motor specs must be reported along with issues upon laying down the motor.
- o Clean up cycles need to be documented and include what was coming back (with pictures).
- o Latest survey must be in email and time breakdown in morning report.
- o Report should show previous two BHA's in the event there is anything in question.

8. Other

O When running wire line in open hole a pack off must be in place.

Key topics for this well:

- o This is a San Adres SWD well with a projected measured depth of 4,838'.
- This is a two-casing string design well.
- Deviation control will be utilized.
- Verify all tools unloaded on location upon arrival including but not limited to float equipment, bits, wellhead, and all directional tools.
- o Ensure 7" float equipment/D.V. Tool is on location prior to drilling.
- Cement water should be tested in tanks prior to the job, not the source.

Drilling Hazards:

1. 13-1/2" Surface Hole

- This area has a history of inert gas pockets. If encountered pick up off bottom, shut down rotary, open diverter line valve, shut hydril, leave pumps running and circulate through panic line to pit system.
- Minimize GPM's until a depth of 500' has been reached to reduce risk of washing out conductor. Keep the cellar under surveillance during this interval.
- o Be cognizant of hole cleaning while minimizing GPM's.
- o This area is known for lost circulation and running sand.
- o Deviation.
- o Gumbo.

2. 8-3/4" Production Hole

- This area has a history of inert gas pockets. If encountered pick up off bottom, shut down rotary, open HCR, shut hydril, leave pumps running and circulate through panic line to reserve pit.
- o Be cognizant of hole cleaning, the salt section will be washing out.
- o Salt can build up in your lines and fitting causing blockage.
- o This area is known for lost circulation.
- O Deviation can occur in the interval.
- The San Andres is a known salt water disposal interval from 3665' to 5000'. Water flows due to injection well could be present.
- o H2S is known to be present so all safety requirements and precautions need to be implemented.
- O Loss circulation will occur with mud weights in excess of 9.3 lb/gal.

BC&D Operating, Inc.	Javelina 26-25-37 #1 SWD Drilling Program		
	Lea Co., New Mexico	Version 1.0	Page 4 of 7

1. Pre-Spud

- Hold pre spud meeting with rig and BC&D Operating, Inc. reps.
- Nipple up diverter system and function test.
- Review BC&D Operating, Inc. procedure for handling air pockets before spud.
- Do not spud until rig is 100% capable of drilling which includes having two pumps available. Also please note we will not accept the rig until all equipment has been installed appropriately (shaker slides/diverter/etc). There will be no fabrication to the rig done after acceptance as is should be done prior.
- Rig up H2S monitoring package before spud (cascade on surface-basic after surface is set).

2. 13-1/2" Surface Hole Drilling: 80' to 870'

	Drilling Fluid Sys	stem Spud Mud: I	Low solids/non-disp	ersed				
	Proc	lucts Freshwater C	Freshwater Gel, Soda Ash, Lime, Paper					
	Solids Cor	ntrol Closed Loop						
	Potential Prob	ems Hole Cleanin	Hole Cleaning. Formation losses. Red Bed Formation.					
						Solids (% Vol)		
80'-870'	8.4-9.6	32-34	2-4	NC		10	<6	

- Start depth will be at ~80' below ground level (20" conductor) and 10' from rig floor.
- Pick up vertical drill out BHA as follows:

Item	Qty	Dia (in)	Notes		
PDC Bit	1	13.500"	U616S	TFA: 1.17	GPM: 600-900
Mud Motor	1	8.000"	1.50°	Fixed Bend, 7/8, 4.	0, .16 rev/gal
Shock Sub	1	8.000"			
UBHO	1	8.000"			
MWD	2	8.000"			
Drill Collar	3	8.000"			
Drill Collar	6	6.000"			
HWDP	-	5.000"			
NOTE:	•	•	•		

- Tag cement, note depth in report.
- While circulating the closed loop system, drill out shoe track, note quality of cement in report. Limit top drive torque to less than nominal casing makeup torque.
- Drill at reduced parameters (350-400 gpm) due to conductor washout potential. After 8" collars are below conductor drill ahead with the following parameters.
- Recommended Parameters:

WOB: 20-50kSRPM: 40-90 rpmFlowrate: 600-900 gpm

• Maintain Mud properties per mud program.

BC&D Operating, Inc.	Javelina 26-25-37 #1 SWD Drilling Program			
	Lea Co., New Mexico	Version 1.0	Page 5 of 7	

- While drilling surface hole be sure to clean and drift all threads for surface CSG. Float collar and shoe will need to be thread-locked on connections.
- At TD, circulate hole clean while rotating and reciprocating pipe. Pump a dye sweep and keep track of strokes as a
 "fluid caliper" to estimate washout. Discuss potential hole volume with engineer as adjustments may need to be made
 to cement volumes.
- Check for flow, slug, and POOH.
- Hold a pre-job safety meeting with all personnel regarding casing running procedures and cementing operations
- Surface CSG needs to be set 50' deeper than the water-board. **REMEMBER DEPTH IS FROM GROUND LEVEL. Verify WBL, setting depth, and pipe tally with engineer at least 24 hours before TD.
- Rig up CSG crew and run 10.75" 45.5# J-55 LTC CSG as follows (bottom to top):
 - Round Nose Guide Shoe
 - One joint 10.75" CSG (Centralize 6' above shoe and 5' below collar).
 - PDC drillable single valve float collar.
 - 10.75" CSG to surface (Centralize every 3rd joint back to surface).
- <u>Monitor displacement to trip tank at all times to ensure the well is not flowing.</u> Displacement volumes should be calculated for the lengths involved at the time casing is run.
- Document CSG size, weight, grade, and connection on DDR as well as final hook load, torque ranges, max RPM when rotating (if applicable), and float shoe and collar depth.
- Verify the number of excess casing joints. Coordinate with Midland office on transferring excess casing joints back to the pipe yard. Complete Material Transfer form after casing running operation is finished.
- Tag bottom to confirm depths then reciprocate & circulate at least one CSG volume before pumping cement.
- Rig up cementers, test all lines, and pump job as follows
 - Pump 40bbls fresh water (NO BOTTOM PLUG)
 - Mix and pump cement as per program and displace with water.
 - Do not over-displace by more than half the shoe track volume and bump the plug with no more than 500 psi over circulating pressure.
- Note and record number of barrels of cement or spacer circulated to surface (if any), quality of returns (full, partial, none), and the final lift pressure / rate / TOC in Wellcore. If there are no cement returns to surface contact drilling supt ASAP.
- With CSG on bottom WOC for at least 1 hour while rigging down surface equipment.
- Slack off and ensure CSG is stationary
- Cut off riser and be sure to check wellhead spacing below, cut off CSG and N/D diverter.
- Top out cement if necessary
- Weld on "A" section. Weld outside only and test to 50% of collapse, if test fails, weld inside. Top of wellhead setting depth to be verified drilling supt.
- Nipple up BOP's and test to 250 psi low and 3,000 psi high with the *Hydrill to*2,500 psi. Test mud lines back to the pump to 3,000 psi.

3. 8-3/4" Production Hole Drilling: 870' to 4,838'

] 1	Drilling Fluid Syst	em Brine/Cut Br	Brine/Cut Brine				
	Products		Freshwater Gel, Lime, Paper, Plug, Fiber, MF-55, PHPA/Freshwater Gel, Lime, Caustic				
Solids Control			Soda, Soda Ash, PermaSeal, Paper, Plug, Lignite, Pac-R, Cedar Fiber, Permaseal Circulate Reserve and closed loop at 4,400'.				
	Potential Proble	ms H2S, water f	H2S, water flow, deviation, lost circulation and gas.				
Depth (ft)	Density (lb/gal)	Viscosity (sec/qt)	YP (lb/100ft^2)	API FL (ml/30min)	CI- (mg/L)	pН	Solids (% Vol)
870'-3,500'	10	29-30	N/A	NC	160K	10.5	<2
3,500'-4,838'	10	30-31	N/A	10-12	160K	10.5	<6

BC&D Operating, Inc.	Javelina 26-25-37 #1 SWD Drilling Program			
	Lea Co., New Mexico	Version 1.0	Page 6 of 7	

• Pick up vertical drill out BHA as follows:

Item	Qty	Dia (in)	Notes		
PDC Bit	1	8.750"	U716M	TFA:1.37	GPM: 600-900
Mud Motor	1	6.750"	1.50° Fixed Bend 7/8, 5.0, .28 rev/gal		
UBHO	1	6.000"			
MWD	1	6.000"			
Drill Collar	1	6.000"			
Drill Pipe	-	5.000"			
-	-	-			
-	-	-			
NOTE: 15 joints HV	VDP to follow 6.	5" DC's.	•		

- Tag cement, note depth in report.
- While circulating the closed loop system, drill out shoe track, note quality of cement in report. Limit top drive torque
 to less than nominal casing makeup torque.
- Recommended Parameters:

WOB: 20-50kSRPM: 40-90 rpmFlowrate: 600-900 gpm

- Maintain Mud properties per mud program.
- While drilling production hole be sure to clean and drift all threads for production CSG. Float collar and shoe will
 need to be thread-locked on connections.
- At TD, circulate hole clean while rotating and reciprocating pipe. .
- Check for flow, slug, and TOOH 10 stands. If no excessive drag or tight hole start laying down drill pipe.
- · Hold a pre-job safety meeting with all personnel regarding casing running procedures and cementing operations
- Verify setting depth, and pipe tally with engineer at least 24 hours before TD.
- Rig up CSG crew and run 7" 26# HCL-80 LTC CSG as follows (bottom to top):
 - Round nose guide shoe.
 - One joint 7" CSG (Centralize 6' above shoe and 5' below collar).
 - PDC drillable single valve float collar.
 - 7" CSG to D.V. Tool at 3,665' (Centralize every other joint).
 - D.V. Tool
 - 7" CSG to surface (centralize every 3 joints back to surface).
 - Make up LTC casing to recommended specification.
- Monitor displacement to trip tank at all times to ensure the well is not flowing. Displacement volumes should be
 calculated for the lengths involved at the time casing is run.
- Document CSG size, weight, grade, and connection on DDR as well as final hook load, torque ranges, max RPM when
 rotating (if applicable), and float shoe and collar depth.
- Verify the number of excess casing joints. Coordinate with Midland office on transferring excess casing joints back to the pipe yard. Complete Material Transfer form after casing running operation is finished.
- Tag bottom to confirm depths then reciprocate & circulate at least one CSG volume before pumping cement.
- Rig up cementers, test all lines, and pump job as follows
 - Pump 40bbls fresh water (NO BOTTOM PLUG)
 - Mix and pump 1st and 2nd stage cement as per program and displace with water.
 - Do not over-displace by more than half the shoe track volume and bump the plug with no more than 500 psi over circulating pressure.

BC&D Operating, Inc.	Javelina 26-25-37 #1 SWD Drilling Program			
	Lea Co., New Mexico	Version 1.0	Page 7 of 7	

- Note and record number of barrels of cement or spacer circulated to surface (if any), quality of returns (full, partial, none), and the final lift pressure / rate / TOC in Wellcore.
- Check well for flow, lift stack, set slips with the weight of casing after cement job.
- Install tubing 7-1/16" 5K tubing head and test to 50 % of collapse.

PROPOSED WELL SCHEMATIC

Javelina 26-25-37 #1 32.10810, -103.14160 NAD83

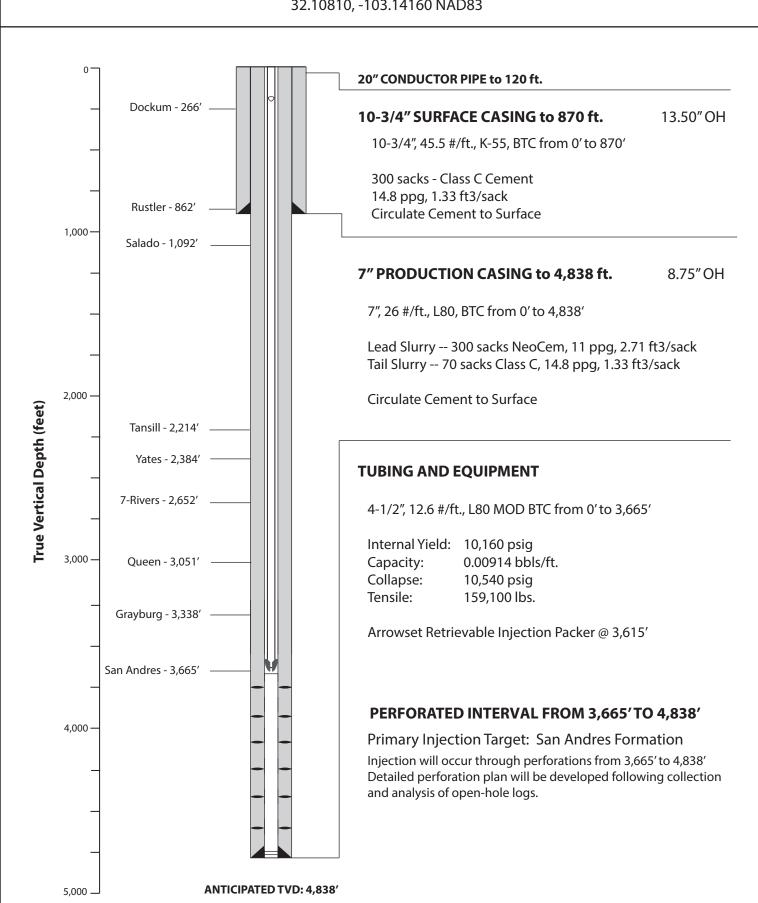


Figure 3 Proposed Javelina 26-25-37 #1 well schematic Released to Imaging: 4/15/2024 3:51:08 PM



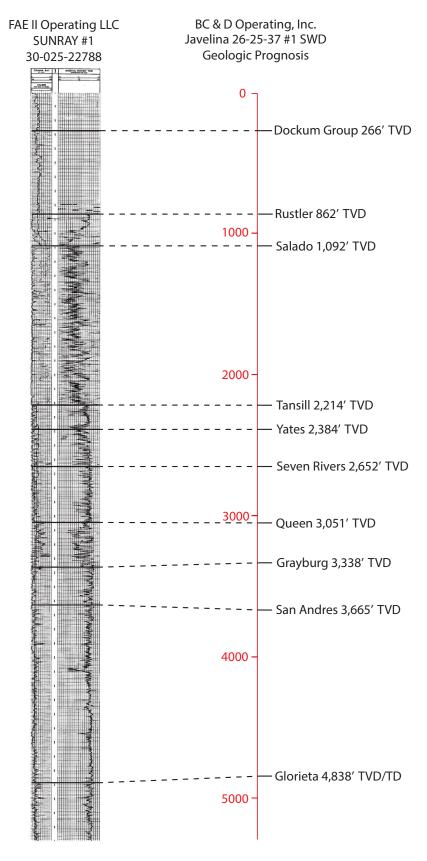


Figure 6. Geologic prognosis formation tops for the proposed Javelina 26-25-37 #1 SWD, based on the nearby Sunray #1 well (API 30-025-22788) type log.

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 308686

CONDITIONS

Operator:	OGRID:
BC & D OPERATING INC.	25670
2702 N. Grimes ST B	Action Number:
Hobbs, NM 88240	308686
	Action Type:
	[C-101] Drilling Non-Federal/Indian (APD)

CONDITIONS

Created By	Condition	Condition Date
pkautz	MUST SUBMIT DEVIATION SURVEY WITH C-105	4/15/2024
pkautz	Cement is required to circulate on both surface and production strings of casing	4/15/2024
pkautz	If cement does not circulate on any string, a CBL is required for that string of casing	4/15/2024
pkautz	MUST COMPLY WITH ALL COA'S IN ORDER SWD 2522	4/15/2024