Section Sect	eceived by Och: 11/21/2025 11:29	:18 AM State of	New Me	exico			Form C-10	03 of 21
District Constant	<u>District I</u> – (575) 393-6161	Energy, Minerals	and Natu	ıral Resources	WELL		Revised July 18, 20)13
Substitute Comparison Com	<u>District II</u> – (575) 748-1283	OII CONSED	VATION	IDIVICION				
Santa Fe, NM 87505					5. Ind			
SUNDRY NOTICES AND REPORTS ON WELLS 7, Lease Name or Unit Agreement Name NOTICES AND REPORTS ON WELLS 7, Lease Name or Unit Agreement Name NOTICES AND REPORTS ON WELLS 7, Lease Name or Unit Agreement Name NOTICES AND REPORTS ON WELLS 7, Lease Name or Unit Agreement Name NOTICES AND REPORTS ON WELLS 7, Lease Name or Unit Agreement Name NOTICES OF NAME	1000 Rio Brazos Rd., Aztec, NM 87410				6 Sto			
SUNDRY NOTICES AND REPORTS ON WELLS TO PERFORM OR PLUG BACK TO A DIFFERENT RESIREVOR. USF: APPLICATION TOR PERMIT (FORM C-101) FOR SUCH TO PERMIT (FORM C-101) FORM C-101) FOR SUCH TO PERMIT (FORM C-101) FORM C-101) FORM C-101 FORM C	1220 S. St. Francis Dr., Santa Fe, NM	Santa 1 e, 1441 07303			0. Sta	ie Oii & Gas Leasc	; INO.	
DIFFERENT RESERVOR, USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROTOKANAS.]	SUNDRY NOT				7. Lea	ase Name or Unit A	Agreement Name	,
1. Type of Well: Oil Well	DIFFERENT RESERVOIR. USE "APPL							
Armstrong Energy Corporation 10. Pool name or Wildcat PO Box 1973, Roswell NM 88202 Humble City: Wolfcamp 4. Well Location 10. Pool name or Wildcat Humble City: Wolfcamp 4. Well Location 10. Pool name or Wildcat Humble City: Wolfcamp 4. Well Location 11. Elevation (Show whether DR, RKB, RT, GR, etc.)	1. Type of Well: Oil Well X	Gas Well Other					01	
3. Address of Operator	2. Name of Operator Armstron	g Energy Corporation	n		9. OC			
Well Location		S Linery Corporation			10. Po		at	
Unit Letter P : 600 feet from the South line and 1120 feet from the East line Section 5 Township 178 Range 37E NMPM Lea County 11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3790' GR 12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUS AND ABANDON COMMENCE DEPLLING OPPS. PULL OR ALTER CASING MULTIPLE COMPL CASING COMMENCE DEPLLING OPPS. PULL OR ALTER CASING MULTIPLE COMPL CASING/CEMENT. IND. CASING/CEMENT. IND. CASING/CEMENT. IND. OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertineate, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion. 1. Drill out existing CIBP at 6500' & CIBP at 9000'. Tag @ 10720' or higher - T Strawn and Strawn Perforations. 2. Spot 15 sx cl H cmt 10614' - 105014' - WOC & Tag 10514' or higher - T Wolfcamp & 3rd Sand and Drinkard. 5. Spot 35 sx ClasP @ 9450' - Test CIBP 500psi/30min - DumpBail 4sx cement - WOC & Tag @ 9415' or higher 4. Run RCBL from 9400' to surface. 5. Spot 15 sx ClasP and Casing Solopsi/30min - Bubble Test - 8. Spot 15 sx ClasP @ 0230' - Test casing 500psi/30min - Bubble Test - 9. Spot 40 sx Class C cement at 4830'. Covers San Andres and Grayburg. 10. Perforate and pump 40 sx cement plug @ 4,347' 11. Freepoint, cut and attempt to recover 5.5' esg @ 3,100' (or whatever length the freepoint dictates) 12. Run RCBL to surface on 8 5/8' eusing - Cement 150' below to 50' above casing cut 13. Spot 30sx crata arcross Rusater top @ 1799. ** Cement 150' below to 50' above casing cut 14. Spot 30s arcross Rusater top @ 1799. ** Cement 150' below to 50' above casing cut 15. Remove wellbead, install DH marker, remove anchors and mole bout ***SEE ATTACHED COA's*** MUST BE PLUGGED BY 11/1/26 Thereby certify that the information above is true and complete to the best of my knowledge and belief. SIGNATURE **	PO Box 1	1973, Roswell NM 88	3202		Hum	ble City; Wolfcam	ıp	
Section 5 Township 17S Range 37F NMPM Lea County								
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3790' GR 12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PAND A COMMENCE DRILLING OPNS. PAND A COMMENCE DRILLING OPNS. PAND A CASING/CEMENT IOR PAND A								e
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK	Section 5					M Lea Coun	ty	
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:		· ·	netner DK	, KKB, K1, GK,	, etc.)			
NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON REMPORARILY ABANDON CHANGE PLUG AND ABANDON CHANGE PLUG AND ABANDON CHANGE PLANS PAND A COMMENCE DRILLING OPNS. PAND A DULL OR ALTER CASING MULTIPLE COMPL CASING/CEMENT 108 Notify OCD 24 hrs. prior to any work done, gilbert.cordero@emnrd.nm.gov OTHER: So a CO may be assigned. OTHER: SO ACC		.,,,						_
PERFORM REMEDIAL WORK PLUG AND ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PAND A DULL OR ALTER CASING MULTIPLE COMPL CASING/CEMENT IOR Notify OCD 24 hrs. prior to any work done, glibert.cordero@emord.nm.gov so a CO may be assigned. 13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion. 1. Drill out existing CIBP at 6500° & CIBP at 9000°. Tag @ 10720° or higher - T Penn 2. Spot 15 sx of H cmt 10614'- 105014' - WOC & Tag 10514' or higher - T Penn 3. Set CIBP @ 9450° - Test CIBP 500psi/30min - DumpBail 4sx cement - WOC & Tag @ 9415' or higher 4. Run RCBL from 9400' to surface. 5. Spot 35 sx cl H cmt 7971' - 7871' - WOC & Tag 7871' or higher - T Wolfcamp & 3rd Sand and Drinkard. 6. Spot 15 sx cl H cmt 7971' - 7871' - WOC & Tag 7871' or higher - DV Tool 7. Set CIBP @ 6230' - Test casing 500psi/30min - Bubble Test - 8. Spot 15 sx Class H cement at 6439'. WOC and tag 6145' or higher - T Glorieta 9. Spot 40 sx Class Cement at 4830'. Covers San Andres and Grayburg. 10. Perforate and pump 40 sx cement plug @ 4,347' 11. Freepoint, cut and attempt to recover 5.5" csg @ 3,100' (or whatever length the freepoint dictates) 12. Run RCBL to surface on 8 5/8" casing - Cement 50' below to 50' above casing cut 13. Spot 30sx cmt across Rustler top @1989' - cement inside/out 14. Spot and pump cement to surface @468' - cement inside/out 14. Spot and pump cement to surface @468' - cement inside/out 15. Remove wellbead, install DH market, remove anchors and move out ****SEE ATTACHED COA's*** MUST BE PLUGGED BY 11/1/26 Thereby certify that the information above is true and complete to the best of my knowledge and belief. SIGNATURE	12. Check	Appropriate Box to It	ndicate N	Vature of Noti	ice, Report	or Other Data		
PERFORM REMEDIAL WORK PLUG AND ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PAND A DULL OR ALTER CASING MULTIPLE COMPL CASING/CEMENT IOR Notify OCD 24 hrs. prior to any work done, glibert.cordero@emord.nm.gov so a CO may be assigned. 13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion. 1. Drill out existing CIBP at 6500° & CIBP at 9000°. Tag @ 10720° or higher - T Penn 2. Spot 15 sx of H cmt 10614'- 105014' - WOC & Tag 10514' or higher - T Penn 3. Set CIBP @ 9450° - Test CIBP 500psi/30min - DumpBail 4sx cement - WOC & Tag @ 9415' or higher 4. Run RCBL from 9400' to surface. 5. Spot 35 sx cl H cmt 7971' - 7871' - WOC & Tag 7871' or higher - T Wolfcamp & 3rd Sand and Drinkard. 6. Spot 15 sx cl H cmt 7971' - 7871' - WOC & Tag 7871' or higher - DV Tool 7. Set CIBP @ 6230' - Test casing 500psi/30min - Bubble Test - 8. Spot 15 sx Class H cement at 6439'. WOC and tag 6145' or higher - T Glorieta 9. Spot 40 sx Class Cement at 4830'. Covers San Andres and Grayburg. 10. Perforate and pump 40 sx cement plug @ 4,347' 11. Freepoint, cut and attempt to recover 5.5" csg @ 3,100' (or whatever length the freepoint dictates) 12. Run RCBL to surface on 8 5/8" casing - Cement 50' below to 50' above casing cut 13. Spot 30sx cmt across Rustler top @1989' - cement inside/out 14. Spot and pump cement to surface @468' - cement inside/out 14. Spot and pump cement to surface @468' - cement inside/out 15. Remove wellbead, install DH market, remove anchors and move out ****SEE ATTACHED COA's*** MUST BE PLUGGED BY 11/1/26 Thereby certify that the information above is true and complete to the best of my knowledge and belief. SIGNATURE	NOTICE OF IN	NTENTION TO:		9	I IRSEOU	ENT REPORT	Γ ΩF·	
TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS PAND A DULL OR ALTER CASING MULTIPLE COMPL CASING COMMINGLE CLOSED-LOOP SYSTEM MULTIPLE COMPL COMPLICATION COMPLETED COMPLICATION COMPLETED			N X					٦
OTHER: OTHER: OTHER: OTHER: OTHER: OTHER: So a CO may be assigned.				COMMENCE	DRILLING O	PNS.□ PANE	DA [
OTHER: OTHER: OTHER: OTHER: OTHER: OTHER: So a CO may be assigned.				CASING/CEA	MENT IOR	24 hrs prior to any	work	
OTHER: So a CO may be assigned. 13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion. 1. Drill out existing CIBP at 6500' & CIBP at 9000'. Tag @ 10720' or higher - T Strawn and Strawn Perforations 2. Spot 15 sx cl H cmt 10614' - 105014' - WOC & Tag 10514' or higher - T Penn 3. Set CIBP @ 9450' - Test CIBP 500psi/30min - DumpBail 4sx cement - WOC & Tag @ 9415' or higher 4. Run RCBL from 9400' to surface. 5. Spot 35 sx Class H cement at 8710' - 8420' WOC & Tag 8420' or higher - T Wolfcamp & 3rd Sand and Drinkard. 6. Spot 15 sx cl H cmt 7971' - 7871' - WOC & Tag 7871' or higher - DV Tool 7. Set CIBP @ 6230' - Test casing 500psi/30min - Bubble Test - 8. Spot 15 sx Class H cement at 6439'. WOC and tag 6145' or higher - T Glorieta 9. Spot 40 sx Class C cement at 4830'. Covers San Andres and Grayburg. 10. Perforate and pump 40 sx cement plug @ 4,347' 11. Freepoint, cut and attempt to recover 5.5" csg @ 3,100' (or whatever length the freepoint dictates) 12. Run RCBL to surface on 8.5/8" casing - Cement 50' below to 50' above casing cut 13. Spot 30sx cmt across Rustler top @t) 989' - cement inside/out 14. Spot and pump ement to surface @468' - cement inside/out 14. Spot and pump ement to surface @468' - cement inside/out 15. Remove wellhead, install DH marker, remove anchors and move out ***SEE ATTACHED COA's**** MUST BE PLUGGED BY 11/1/26 Thereby certify that the information above is true and complete to the best of my knowledge and belief. SIGNATURE								
13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion. 1. Drill out existing CIBP at 6500' & CIBP at 9000'. Tag @ 10720' or higher - T Strawn and Strawn Perforations 2. Spot 15 sx cl H cmt 10614' - 105014' - WOC & Tag 10514' or higher - T Penn 3. Set CIBP @ 9450' - Test CIBP 500psi/30min - DumpBail 4sx cement - WOC & Tag @ 9415' or higher 4. Run RCBL from 9400' to surface. 5. Spot 35 sx class H cement at 8710' - 8420' WOC & Tag 8420' or higher - T Wolfcamp & 3rd Sand and Drinkard. 6. Spot 15 sx cl H cmt 7971' - 7871' - WOC & Tag 7871' or higher - DV Tool 7. Set CIBP @ 6230' - Test casing 500psi/30min - Bubble Test - 8. Spot 15 sx Class H cement at 6439'. WOC and tag 6145' or higher - T Glorieta 9. Spot 40 sx Class C cement at 4830'. Covers San Andres and Grayburg. 10. Perforate and pump 40 sx cement plug @ 4,347' 11. Freepoint, cut and attempt to recover 5.5" csg @ 3,100' (or whatever length the freepoint dictates) 12. Run RCBL to surface on 8 5/8" casing - Cement 50' below to 50' above casing cut 13. Spot 30sx cmt across Rustler top @11989' - cement inside/out 14. Spot and pump cement to surface @468' - cement inside/out 15. Remove wellhead, install DH market, remove anchors and mote out ***SEE ATTACHED COA's**** MUST BE PLUGGED BY 11/1/26 Thereby certify that the information above is true and complete to the best of my knowledge and belief. SIGNATURE Plant Tew E-mail address: jtew@aecnm.com PHONE: 575-625-2222 For State Use Only APPROVED BY: ### TITLE Stath Manager DATE 12/12/25		I	П		_		Г	٦
proposed completion or recompletion. 1. Drill out existing CIBP at 6500' & CIBP at 9000'. Tag @ 10720' or higher - T Strawn and Strawn Perforations 2. Spot 15 sx cl H cmt 10614' - 105014' - WOC & Tag 10514' or higher - T Penn 3. Set CIBP @ 9450' - Test CIBP 500psi/30min - DumpBail 4sx cement - WOC & Tag @ 9415' or higher 4. Run RCBL from 9400' to surface. 5. Spot 35 sx Class H cement at 8710' - 8420' WOC & Tag 8420' or higher - T Wolfcamp & 3rd Sand and Drinkard. 6. Spot 15 sx Cl H cmt 7971' - 7871' - WOC & Tag 7871' or higher - DV Tool 7. Set CIBP @ 6230' - Test casing 500psi/30min - Bubble Test - 8. Spot 15 sx Class H cement at 6439'. WOC and tag 6145' or higher - T Glorieta 9. Spot 40 sx Class C cement at 4830'. Covers San Andres and Grayburg. 10. Perforate and pump 40 sx cement plug @ 4,347' 11. Freepoint, cut and attempt to recover 5.5'' csg @ 3,100' (or whatever length the freepoint dictates) 12. Run RCBL to surface on 8 5/8'' casing - Cement 50' below to 50' above casing cut 13. Spot 30sx cmt across Rustler top @1989' - cement inside/out 14. Spot and pump cement to surface @468' - cement inside/out 15. Remove wellhead, install DH marked, remove anchors and move out ****SEE ATTACHED COA's**** MUST BE PLUGGED BY 11/1/26 Thereby certify that the information above is true and complete to the best of my knowledge and belief. SIGNATURE	13. Describe proposed or comp							date
1. Drill out existing CIBP at 6500' & CIBP at 9000'. Tag @ 10720' or higher - T Strawn and Strawn Perforations 2. Spot 15 sx cl H cmt 10614' - 105014' - WOC & Tag 10514' or higher - T Penn 3. Set CIBP @ 9450' - Test CIBP 500psi/30min - DumpBail 4sx cement - WOC & Tag @ 9415' or higher 4. Run RCBL from 9400' to surface. 5. Spot 35 sx Class H cement at 8710' - 8420' WOC & Tag 8420' or higher - T Wolfcamp & 3rd Sand and Drinkard. 6. Spot 15 sx cl H cmt 7971' - 7871' - WOC & Tag 7871' or higher - DV Tool 7. Set CIBP @ 6230' - Test casing 500psi/30min - Bubble Test - 8. Spot 15 sx Class H cement at 6439'. WOC and tag 6145' or higher - T Glorieta 9. Spot 40 sx Class C cement at 4830'. Covers San Andres and Grayburg. 10. Perforate and pump 40 sx cement plug @ 4,347' 11. Freepoint, cut and attempt to recover 5.5" csg @ 3,100' (or whatever length the freepoint dictates) 12. Run RCBL to surface on 8 5/8" casing - Cement 50' below to 50' above casing cut 13. Spot 30sx cmt across Rustler top @1,989' - cement inside/out 14. Spot and pump cement to surface @468' - cement inside/out 15. Remove wellhead, install DH marker, remove anchors and move out ***SEE ATTACHED COA's*** MUST BE PLUGGED BY 11/1/26 Thereby certify that the information above is true and complete to the best of my knowledge and belief. SIGNATURE Jeffery Tew TITLE Operations Engineer DATE 11/21/2025 Type or print name Jeffery Tew E-mail address: jtew@aecnm.com PHONE: 575-625-2222 For State Use Only APPROVED BY: APPROVED BY: TITLE Staff Managar DATE 12/12/25			7.14 NMA	C. For Multiple	e Completion	s: Attach wellbore	e diagram of	
2. Spot 15 sx cl H cmt 10614' - 105014' - WOC & Tag 10514' or higher - T Penn 3. Set CIBP @ 9450' - Test CIBP 500psi/30min - DumpBail 4sx cement - WOC & Tag @ 9415' or higher 4. Run RCBL from 9400' to surface. 5. Spot 35 sx Class H cement at 8710' - 8420' WOC & Tag 8420' or higher - T Wolfcamp & 3rd Sand and Drinkard. 6. Spot 15 sx cl H cmt 7971' - 7871' - WOC & Tag 7871' or higher - DV Tool 7. Set CIBP @ 6230' - Test casing 500psi/30min - Bubble Test - 8. Spot 15 sx Class H cement at 6439''. WOC and tag 6145' or higher - T Glorieta 9. Spot 40 sx Class C cement at 4830''. Covers San Andres and Grayburg. 10. Perforate and pump 40 sx cement plug @ 4,347' 11. Freepoint, cut and attempt to recover 5.5" csg @ 3,100' (or whatever length the freepoint dictates) 12. Run RCBL to surface on 8 5/8" casing - Cement 50' below to 50' above casing cut 13. [Spot 30sx cmt across Rustler top @1,989' - cement inside/out 14. Spot and pump cement to surface @468' - cement inside/out 15. [Remove wellhead, install DH market, remove anchors and move out 15. [Remove wellhead, install DH market, remove anchors and move out 15. [Remove wellhead, install DH market, remove anchors and move out 15. [Remove wellhead, install DH market, remove anchors and move out 15. [Remove wellhead, install DH market, remove anchors and move out 17. [Phone of the property of the	• • •	•	00'. Tag (a) 10720' or high	ner - T Strawi	n and Strawn Perfo	orations	
4. Run RCBL from 9400' to surface. 5. Spot 35 sx Class H cement at 8710' - 8420' WOC & Tag 8420' or higher - T Wolfcamp & 3rd Sand and Drinkard. 6. Spot 15 sx cl H cmt 7971' - 7871' - WOC & Tag 7871' or higher - DV Tool 7. Set CIBP @ 6230' - Test casing 500psi/30min - Bubble Test - 8. Spot 15 sx Class H cement at 6439'. WOC and tag 6145' or higher - T Glorieta 9. Spot 40 sx Class C cement at 4830'. Covers San Andres and Grayburg. 10. Perforate and pump 40 sx cement plug @ 4,347' 11. Freepoint, cut and attempt to recover 5.5" csg @ 3,100' (or whatever length the freepoint dictates) 12. Run RCBL to surface on 8 5/8" casing - Cement 50' below to 50' above casing cut 13. Spot 30sx cmt across Rustler top @11989' - cement inside/out 14. Spot and pump cement to surface @468' - cement inside/out 15. Remove wellhead, install DH marker, remove anchors and move out ***SEE ATTACHED COA's*** MUST BE PLUGGED BY 11/1/26 Thereby certify that the information above is true and complete to the best of my knowledge and belief. SIGNATURE	2. Spot 15 sx cl H cmt 1	10614' - 105014' - WOC &	& Tag 1051	14' or higher - T	Penn			
5. Spot 35 sx Class H cement at 8710' - 8420' WOC & Tag 8420' or higher - T Wolfcamp & 3rd Sand and Drinkard. 6. Spot 15 sx cl H cmt 7971' - 7871' - WOC & Tag 7871' or higher - DV Tool 7. Set CIBP @ 6230' - Test casing 500psi/30min - Bubble Test - 8. Spot 15 sx Class H cement at 6439'. WOC and tag 6145' or higher - T Glorieta 9. Spot 40 sx Class C cement at 4830'. Covers San Andres and Grayburg. 10. Perforate and pump 40 sx cement plug @ 4,347' 11. Freepoint, cut and attempt to recover 5.5" csg @ 3,100' (or whatever length the freepoint dictates) 12. Run RCBL to surface on 8 5/8" casing - Cement 50' below to 50' above casing cut 13. Spot 30sx cmt across Rustler top @1989' - cement inside/out 14. Spot and pump cement to surface @468' - cement inside/out 15. Remove wellhead, install DH marker, remove anchors and move out ***SEE ATTACHED COA's*** MUST BE PLUGGED BY 11/1/26 Thereby certify that the information above is true and complete to the best of my knowledge and belief. SIGNATURE Jeffery Tew E-mail address: jtew@aecnm.com PHONE: 575-625-2222 Type or print name Jeffery Tew E-mail address: jtew@aecnm.com PHONE: 575-625-2222 For State Use Only APPROVED BY: TITLE Staph Manager DATE 12/12/25			DumpBai	1 4sx cement - V	WOC & Tag	@ 9415' or higher		
6. Spot 15 sx cl H cmt 7971' - 7871' - WOC & Tag 7871' or higher - DV Tool 7. Set CIBP @ 6230' - Test casing 500psi/30min - Bubble Test - 8. Spot 15 sx Class H cement at 6439'. WOC and tag 6145' or higher - T Glorieta 9. Spot 40 sx Class C cement at 4830'. Covers San Andres and Grayburg. 10. Perforate and pump 40 sx cement plug @ 4,347' 11. Freepoint, cut and attempt to recover 5.5" osg @ 3,100' (or whatever length the freepoint dictates) 12. Run RCBL to surface on 8 5/8" casing - Cement 50' below to 50' above casing cut 13. Spot 30sx cmt across Rustler top @1,989' - cement inside/out 14. Spot and pump cement to surface @468' - cement inside/out 15. Remove wellhead, install DH marker, remove anchors and move out ****SEE ATTACHED COA's**** MUST BE PLUGGED BY 11/1/26 Thereby certify that the information above is true and complete to the best of my knowledge and belief. SIGNATURE SIGNATURE Jeffery Tew E-mail address: jtew@aecnm.com PHONE: 575-625-2222 For State Use Only APPROVED BY: TITLE Stadd Managan DATE 12/12/25			WOC & Ta	ng 8420' or high	ner - T Wolfd	camp & 3rd Sand a	nd Drinkard	
8. Spot 15 sx Class H cement at 6439'. WOC and tag 6145' or higher - T Glorieta 9. Spot 40 sx Class C cement at 4830'. Covers San Andres and Grayburg. 10. Perforate and pump 40 sx cement plug @ 4,347' 11. Freepoint, cut and attempt to recover 5.5" csg @ 3,100' (or whatever length the freepoint dictates) 12. Run RCBL to surface on 8 5/8" casing - Cement 50' below to 50' above casing cut 13. Spot 30sx cmr across Rustler top @1989' - cement inside/out 14. Spot and pump cement to surface @ 468' - cement inside/out 15. Remove wellhead, install DH marker, remove anchors and move out ***SEE ATTACHED COA's*** MUST BE PLUGGED BY 11/1/26 Thereby certify that the information above is true and complete to the best of my knowledge and belief. SIGNATURE						oump & Sta Suna a	na Brinnara.	
9. Spot 40 sx Class C cement at 4830'. Covers San Andres and Grayburg. 10. Perforate and pump 40 sx cement plug @ 4,347' 11. Freepoint, cut and attempt to recover 5.5" csg @ 3,100' (or whatever length the freepoint dictates) 12. Run RCBL to surface on 8 5/8" casing - Cement 50' below to 50' above casing cut 13. Spot 30sx cmt across Rustler top @1,989' - cement inside/out 14. Spot and pump cement to surface @468' - cement inside/out 15. Remove wellhead, install DH marker, remove anchors and move out ***SEE ATTACHED COA's*** MUST BE PLUGGED BY 11/1/26 Thereby certify that the information above is true and complete to the best of my knowledge and belief. SIGNATURE Jeffery Tew TITLE Operations Engineer DATE 11/21/2025 Type or print name Jeffery Tew E-mail address: jtew@aecnm.com PHONE: 575-625-2222 For State Use Only APPROVED BY: TITLE Staff Managar DATE 12/12/25								
10. Perforate and pump 40 sx cement plug @ 4,347' 11. Freepoint, cut and attempt to recover 5.5" csg @ 3,100' (or whatever length the freepoint dictates) 12. Run RCBL to surface on 8 5/8" casing - Cement 50' below to 50' above casing cut 13. Spot 30sx cmt across Rustler top @1,989' - cement inside/out 14. Spot and pump cement to surface @468' - cement inside/out 15. Remove wellhead, install DH marker, remove anchors and move out ***SEE ATTACHED COA's*** MUST BE PLUGGED BY 11/1/26 I hereby certify that the information above is true and complete to the best of my knowledge and belief. SIGNATURE					lorieta			
11. Freepoint, cut and attempt to recover 5.5" csg @ 3,100' (or whatever length the freepoint dictates) 12. Run RCBL to surface on 8 5/8" casing - Cement 50' below to 50' above casing cut 13. Spot 30sx cmt across Rustler top @1,989' - cement inside/out 14. Spot and pump cement to surface @ 468' - cement inside/out 15. Remove wellhead, install DH marker, remove anchors and move out ***SEE ATTACHED COA's*** MUST BE PLUGGED BY 11/1/26 I hereby certify that the information above is true and complete to the best of my knowledge and belief. SIGNATURE				and Grayburg.				
13. Spot 30sx cmt across Rustler top @1,989' - cement inside/out 14. Spot and pump cement to surface @ 68' - cement inside /out - WOC & Bubble test 15. Remove wellhead, install DH marker, remove anchors and move out ***SEE ATTACHED COA's*** MUST BE PLUGGED BY 11/1/26 I hereby certify that the information above is true and complete to the best of my knowledge and belief. SIGNATURE				or whatever len	gth the freep	oint dictates)		
14. Spot and pump cement to surface @468' - cement inside /out - WOC & Bubble test 15. Remove wellhead, install DH marker, remove anchors and move out ***SEE ATTACHED COA's*** MUST BE PLUGGED BY 11/1/26 I hereby certify that the information above is true and complete to the best of my knowledge and belief. SIGNATURE					casing cut			
SEE ATTACHED COA's MUST BE PLUGGED BY 11/1/26 I hereby certify that the information above is true and complete to the best of my knowledge and belief. SIGNATURE					D1.1.1. 44			
SEE ATTACHED COA's MUST BE PLUGGED BY 11/1/26 I hereby certify that the information above is true and complete to the best of my knowledge and belief. SIGNATURE Jeffery Tew TITLE Operations Engineer DATE 11/21/2025 Type or print name Jeffery Tew E-mail address: jtew@aecnm.com PHONE: 575-625-2222 For State Use Only APPROVED BY: TITLE Staff Manager DATE 12/12/25					Bubble lest			
I hereby certify that the information above is true and complete to the best of my knowledge and belief. SIGNATURE Jeffery Tew TITLE Operations Engineer DATE 11/21/2025 Type or print name Jeffery Tew E-mail address: jtew@aecnm.com PHONE: 575-625-2222 For State Use Only APPROVED BY: TITLE Staff Manager DATE 12/12/25					GGED BY 1	1/1/26		
Type or print name Jeffery Tew E-mail address: jtew@aecnm.com PHONE: 575-625-2222 For State Use Only APPROVED BY:								
Type or print name Jeffery Tew E-mail address: jtew@aecnm.com PHONE: 575-625-2222 For State Use Only APPROVED BY:	• •	•		-	=			
APPROVED BY:	SIGNATURE Deffery 7	Tew TIT	LE	Operations E	ngineer	DATE	11/21/2025	
		E-m	nail addres	s: _jtew@ae	cnm.com	PHONE:	575-625-2222	2_
Conditions of Approval (if any):	APPROVED BY:Conditions of Approval (if any):	TIT	LE	Staff W	lanager	DATE	12/12/25	

State of New Mexico Energy, Minerals and Natural Resources Department Oil Conservation Division Standard Plugging Conditions



This document provides OCD's general plugging conditions of approval. It should be noted that the list below may not cover special plugging programs in unique and unusual cases, and OCD expressly reserves the right to impose additional requirements to the extent dictated by project conditions. The OCD also reserves the right to approve deviations from the below conditions if field conditions warrant a change. A C-103F NOI to P&A must be approved prior to plugging operations. Failure to comply with the conditions attached to a plugging approval may result in a violation of 19.15.5.11 NMAC, which may result in enforcement actions, including but not limited to penalties and a requirement that the well be re-plugged as necessary.

- 1. Notify OCD office at least 24 hours before beginning work and seek prior approval to implementing any changes to the C-103 NOI to PA.
 - North Contact,
 - South Contact, Gilbert Cordero, 575-626-0830, gilbert.cordero@emnrd.nm.gov
- A Cement Bond Log is required to ensure strata isolation of producing formations, protection of
 water and correlative rights. A CBL must be run or be on file that can be used to properly
 evaluate the cement behind the casing.

Note: Logs must be submitted to OCD via OCD permitting. A copy of the log may be emailed to OCD inspector for faster review times, but emailing does not relieve the operators obligation to submit through OCD permitting.

- 3. Once Plugging operations have commenced, the rig must not rig down until the well is fully plugged without OCD approval. If gap in plugging operations exceeds 30 days, the Operator must file a subsequent sundry of work performed and revised NOI for approval on work remaining. At no time shall the rig be removed from location if it will result in waste or contamination of fresh water.
- 4. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.
- 5. Fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
 - North, water or mud laden fluids
 - South, mud laden fluids
- 6. Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to an OCD permitted disposal facility.
- 7. Class of cement shall be used in accordance with the below table for depth allowed.

Class	TVD Lower Limit (feet)		
Class A/B	6,000		
Class I/II	6,000		
Class C or III	6,000		
Class G and H	8,000		
Class D	10,000		

Class E	14,000
Class F	16,000

- 8. After cutting the well head any "top off cement jobs" must remain static for 30 minutes. Any gas bubbles or flow during this 30 minutes shall be reported to the OCD for approval of next steps.
- 9. Trucking companies being used to haul oilfield waste fluids (Commercial or Private) to a disposal facility shall have an approved OCD C-133 permit.
 - A copy of this permit shall be available in each truck used to haul waste products.
 - It is the responsibility of the Operator and Contractor to verify that this permit is in place prior to performing work.
 - Drivers shall be able to produce a copy upon request of an OCD Compliance Officer.
- 10. Filing a [C-103] Sub. Plugging (C-103P) will serve as notification that the well has been plugged.
- 11. A [C-103] Sub. Release After P&A (C-103Q) shall be filed no later than a year after plugging and a site inspection by OCD Compliance officer to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to meet OCD standards before bonding can be released.
- 12. Produced water or brine-based fluids may not be used during any part of plugging operations without prior OCD approval.

13. Cementing;

- All cement plugs will be neat cement and a minimum of 100' in length. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- If cement does not exist between or behind the casing strings at recommended formation depths, the casing perforations will be shot at 50' below the formation top and the cement retainer shall be set no more than 50' from the perforations.
- WOC (Wait on Cement) time will be:
 - 4 hours for accelerated (calcium chloride) cement.
 - o 6 hours on regular cement.
- Operator must tag all cement plugs unless it meets the below condition.
 - The operator has a passing pressure test for the casing annulus and the plug is only an inside plug.
- If perforations are made operator must tag all plugs using the work string to tag unless given approval to tag with wireline by the correct contact from COA #1 of this document.
 - This includes plugs pumped underneath a cement retainer to ensure retainer seats properly after cement is pumped.
- Cement can only be bull-headed with specific prior approval.
- Squeeze pressures are not to exceed the exposed formations frac gradient or the burst pressure of the casing.
- 14. A cement plug is required to be set from 50' below to 50' above (straddling) formation tops, casing shoes, casing stubs, any attempted casing cut offs, anywhere the casing is perforated, DV tools.
 - Perforation/Formation top plug. (When there is less than 100ft between the top perforation to the formation top.) These plugs are required to be started no greater than

50ft from the top perforation. However, the plug should be set below the formation top or as close to the formation top as possible for the maximum isolation between the formations. The plug is required to be a 100ft cement plug plus excess.

- Perforation Plug when a formation top is not included. These plugs are required to be started within 50ft of the top perforation. The plug is required to be a 100ft cement plug plus excess.
- Cement caps on top of bridge plugs or cement retainers for perforation plugs, that are
 not straddling a formation top, may be set using a bailer with a minimum of 35' of
 cement in lieu of the 100' plug. The bridge plug or retainer must be set within 50ft of the
 perforations.
- Perforations are required below the surface casing shoe if cement does not exist behind
 the casing, a 30-minute minimum wait time will be required immediately after
 perforating to determine if gas and/or water flows are present. If flow is present, the
 well will be shut-in for a minimum of one hour and the pressure recorded. If gas is
 detected contact the OCD office for directions.
- 15. No more than 3000 feet is allowed between cement plugs in cased hole and no more than 2000 feet is allowed in open hole.
- 16. Formation Tops to be isolated with cement plugs, but not limited to are:
 - Northwest See Figure A
 - South (Artesia) See Figure B
 - Potash See Figure C
 - o In the R-111-P (Or as subsequently revised) Area a solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, woe 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.
 - South (Hobbs) See Figure D1 and D2
 - Areas not provided above will need to be reviewed with the OCD on a case by case basis.

17. Markers

• Dry hole marker requirements 19.15.25.10.

The operator shall mark the exact location of plugged and abandoned wells with a steel marker not less than four inches in diameter set in cement and extending at least four feet above mean ground level. The marker must include the below information:

- 1. Operator name
- 2. Lease name and well number
- 3. API number
- 4. Unit letter
- 5. Section, Township and Range
- AGRICULTURE (Below grade markers)

In Agricultural areas a request can be made for a below ground marker. For a below ground marker the operator must file their request on a C-103 notice of intent, and it must include the following;

- A) Aerial photo showing the agricultural area
- B) Request from the landowner for the below ground marker.

C) Subsequent plugging report for a well using a below ground marker must have an updated C-102 signed by a certified surveyor for SHL.

Note: A below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to OCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to OCD. OCD requires a current survey to verify the location of the below ground marker, however OCD will accept a GPS coordinate that were taken with a GPS that has an accuracy of within 15 feet.

18. If work has not commenced within 1 year of the approval of this procedure, the approval is automatically expired. After 1 year a new [C-103] NOI Plugging (C-103F) must be submitted and approved prior to work.

Figure A

North Formations to be isolated with cement plugs are:

- San Jose
- Nacimiento
- Ojo Alamo
- Kirtland
- Fruitland
- Picture Cliffs
- Chacra (if below the Chacra Line)
- Mesa Verde Group
- Mancos
- Gallup
- Basin Dakota (plugged at the top of the Graneros)
- Deeper formations will be reviewed on a case-by-case basis

Figure B

South (Artesia) Formations to be isolated with cement plugs are:

- Fusselman
- Montoya
- Devonian
- Morrow
- Strawn
- Atoka
- Permo-Penn
- Wolfcamp
- Bone Springs
- Delaware, in certain areas where the Delaware is subdivided into;
 - 1. Bell Canyon
 - 2. Cherry Canyon
 - 3. Brushy Canyon
- Any salt sections
- Abo
- Yeso
- Glorieta
- San Andres
- Greyburg
- Queen
- Yates

Figure D1 and D2

South (Hobbs) Formations to be isolated with cement plugs are:

The plugging requirements in the Hobbs Area are based on the well location within specific areas of the Area (See Figure D1). The Formations in the Hobbs Area to be isolated with cement plugs are (see Figure D2)

Figure D1 Map

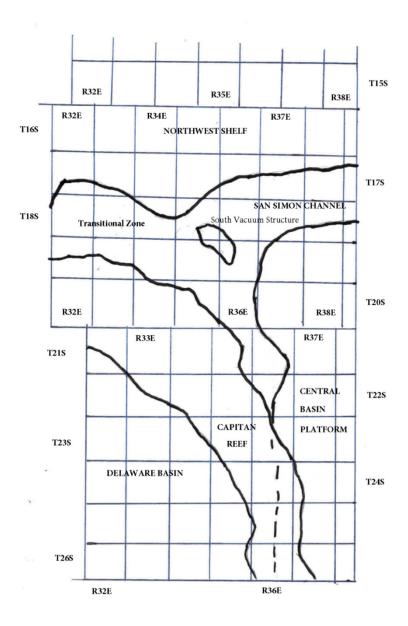


Figure D2 Formation Table

100' Plug to isolate upper and lower fresh water zones (typically 250' to 350')						
Northwest Shelf	Captan Reef Area	Transition Zone	San Simon Channel	South Vacuum Structure	Delaware Basin	Central Basin Platform
Granit Wash (Detrital basement material and fractured pre-Cambrian basement rock)	Siluro-Devonian	Morrow	Siluro-Devonian	Ellenburger	Siluro-Devonian	Granit Wash (Detrital basement material, fractured pre-Cambrian basement rock and fracture Mafic Volcanic intrusives).
Montoya	Mississippian	Atoka	Morrow	Mckee	Morrow	Ellenburger
Fusselman	Morrow	Strawn	Wolfcamp	Siluro-Devonian	Atoka	Connell
Woodford	Atoka	Cisco	Abo Reef	Woodford	Strawn	Waddell
Siluro-Devonian	Strawn	Pennsylvanian	Bone Spring	Mississippian	Pennsylvanian	Mckee
Chester	Pennsylvanian	Wolfcamp	Delaware	Barnett Shale	Lower Wolfcamp	Simpson Group
Austin	Wolfcamp	Bone Spring	San Andres	Morrow	Upper Wolfcamp	Montoya
Mississippian	Abo Reef, if present	Delaware	Queen	Atoka	Wolfcamp	Fusselman
Morrow	Abo, if present	San Andres	Yates	Strawn	Third Bone Spring Sand (Top of Wolfbone)	Silurian
Atoka	Queen, if present	Grayburg-San Andres	Base of Salt	Canyon	First Bone Spring Sand (Top of Lower Bone Spring)	Devonian
Lower Pennsylvanian	Bone Spring	Queen	Rustler	Pennsylvanian	Bone Spring	Strawn
Cisco-Canyon	Delaware	Seven Rivers		Blinebry	Brushy Canyon	Pennsylvanian
Pennsylvanian	Base Capitan Reef	Yates		Bone Spring	Delaware (Base of Salt)	Wolfcamp
Bough	Seven Rivers	Base of Salt		San Andres	Rustler	Abo
Wolfcamp	Yates	Rustler		Queen		Abo Reef
Abo	Top Capitan Reef			Base of Salt		Drinkard
Abo Reef, if present	Base of Salt			Rustler		Tubb
Yeso (Township 15 South to Township 17 South)	Rustler					Blinebry
Drinkard or Lower Yeso (Township 15 South to Township 17 South)						Paddock
Tubb (Township 15 South to Township 17 South)						Glorieta
Blinebry (Township 15 South to Township 17 South)						San Andres
Paddock (Township 15 South to Township 17 South)						Grayburg
Glorieta						Grayburg-San Andres
San Andres						Queen
Queen (Township 15 South to Township 17 South)						Seven Rivers
Seven Rivers (Township 15 South to Township 17 South)						Yates
Yates (Township 15 South to Township 17 South)						Base of Salt
Base of Salt						Rustler
Rustler						

EXHIBIT "A" CASE 9316 ORDER **R-111-P**

CONSOLIDATED LAND **DESCRIPTION** OF THE KNOWN POTASH **LEASING AREA**, AS OF FEBRUARY **3**, **1988**

EDDY COUNTY, NEW MEXICO

TOWNSHIP 18 SOUTH, RANGE 30 EAST, NMPM

Section 10: SE/4 SE/4

Section 11: S/2 SW/4

Section 13: W/2 SW/4 and SE/4 SW/4
Section 14: W/2 NE/4, NW/4 and S/2

Section 15: E/2 NE/4, SE/4 SW/4 and SE/4 Section 22: N/2, N/2 SW/4, SE/4 SW/4 and SE/4

Section 23: Al

Section 24: N/2 NW/4, SW/4 NW/4 and NW/4 SW/4

Section 26: NE/4, N/2 NW/4 and SE/4 NW/4

Section 27: N/2 NE/4 and NE/4 NW/4

TOWNSHIP 19 SOUTH, RANGE 29 EAST, NMPM

Section 11: SE/4 SE/4

Section 12: SE/4 NE/4 and S/2

Section 13: Al

Section 14: NE/4, SE/4 NW/4 and S/2

Section 15: SE/4 SE/4

Section 22: NE/4, E/2 W/2 and SE/4

Section 23: All Section 24: All

Section 25: NW/4 NW/4

Section 26: N/2 NE/4 AND NW/4 Section 27: NE/4 AND E/2 NW/4

TOWNSHIP 19 SOUTH, RANGE 30 EAST, NMPM

Section 2:SW/4

Section 3: W/2 SW/4, SE/4 SW/4, S/2 SE/4 and

NE/4 SE/4

Section 4: Lots 3 and 4. SW/4 NE/4, S/2 NW/4

and S/2

Section 5: Lots 1, 2, and 3, S/2 NE/4,

S/2 NW/4 and S/2

Section 6: S/2 SE/4 and NE/4 SE/4

Sections 7 to 10 inclusive

Section 11: S/2 NE/4, NW/4 NW/4 and S/2

Section 12: NE/4, S/2 NW/4 and S/2

Section 13: NE/4, W/2, N/2 SE/4 and SW/4 SE/4

Sections 14 to 18 inclusive

Section 19: Lots 1, 2, and 3, NE/4, E/2 NW/4,

NE/4 SW/4, E/2 SE/4 and

NW/4 SE/4

Sections 20 to 23 inclusive

-2-EXHIBIT "A" con'd

Section 25: NW/4 NW/4

Section 26: NE/4 NE/4, W/2 NE/4, W/2, W/2 SE/4

and SE/4 SE/4

Section 27: Al1 Section 28: Al1

Section 29: E/2, E/2 NW/4 and NW/4 NW/4

Sect ion 32: E/2 and SE/4 SW/4

Section 33 to 35 inclusive

Section 36: NW/4 NW/4, S/2 NW/4 and S/2

TOWNSHIP 19 SOUTH, RANGE 31 EAST, NMPM

Section 7: Lots 1, 2, and 3 and E/2 NW/4

Section 18: Lots 1, 2, and 3 and SW/4 NE/4,

E/2 NW/4 and NE/4 SW/4

Section 31: Lot 4 Section 34: SE/4 SE/4

Section 35: S/2 SW/4 and SW/4 SE/4

Section 36: S/2 SE/4

LEA COUNTY, NEW MEXICO

TOWNSHIP 19 SOUTH, RANGE 32 EAST, NMPM

Section 31: Lot 4

Section 33: Lots 1 to 4 inclusive and N/2 S/2 Section 34: Lots 1 to 4 inclusive and N/2 S/2 Section 35: Lots 1 to 4 inclusive and N/2 S/2 Lots 1 to 4 inclusive, SE/4 NE/4, NW/4 SW/4 and NE/4 SE/4

TOWNSHIP 19 SOUTH, RANGE 33 EAST, NMPM

Section 22: SE/4 NE/4, E/2 SW/4 and SE/4 Section 23: S/2 NW/4, SW/4. W/2 SE/4 and

SE/4 SE/4

Section 25: SW/4 NW/4, W/2 SW/4 and SE/4 SW/4

Section 26: All Section 27: All

Section 28: S/2 SE/4 and NE/4 SE/4

Section 30: Lots 2 to 4 inclusive, S/2 NE/4,

SE/4 NW/4. E/2 SW/4 and SE/4

Section 31: All

Section 32: NE/4, S/2 NW/4 and S/2

Sections 33 to 35 inclusive

Section 36: W/2 NE/4, SE/4 NE/4, NW/4 and S/2

TOWNSHIP 19 SOUTH, RANGE 34 EAST, NMPM

Section 31 Lots 3 and 4

-3-EXHIBIT "A" con'd

EDDY COUNTY, NEW MEXICO

TOWNSHIP 20 SOUTH, RANGE 29 EAST, NMPM

Section 1: SE/4 NE/4 and E/2 SE/4

Section 13: S

SW/4 NW/4, W/2 SW/4 AND SE/4 SW/4 NW/4 NE/4, S/2 NE/4, NW/4 and S/2

Section 14: Section 15:

E/2 E/2, SE/4 SW/4 and W/2 SE/4

Section 22:

E/2 and E/2 NW/4

Section 23:

Section 24:

SW/4 NE/4, W/2, W/2 SE/4

and SE/4 SE/4

Section 25:

N/2, SW/4, W/2 SE/4 and NE/4 SE/4

Section 26:

All

ΑII

Section 27: Section 34: E/2 NE/4

Section 34: Section 35:

N/2

Section 36:

W/2 NE/4 AND NW/4

TOWNSHIP 20 SOUTH, RANGE 30 EAST, NMPM

Sections 1 to 4 inclusive

Section 5: Lots 1 to 3 inclusive, S/2 N/2

and S/2

Section 6 Lots 5, 6, and 7, S/2 NE/4, E/2 SW/4

and SE/4

Section 7 Lots 1 and 2. E/2 and E/2 NW/4

Sections 8 to 17 inclusive

Section 18

E/2

Section 19

E/2 and SE/4 SW/4

Sections 20 to 29 inclusive

Section 30:

Lots 1 to 3 inclusive, E/2 and

E/2 W/2

Section 31

E/4 and E/2 SE/4

Sections 32 to 35 inclusive

TOWNSHIP 20 SOUTH, RANGE 31 EAST, NMPM

Section 1 Lots 1 to 3 inclusive, S/2 N/2

and S/2

Section 2: All

Section 3:

Lots 1 and 2, S/2 NE/4 and SE/4

Section 6: Lots 4 to 7 inclusive, SE/4 NW/4,

E/2 SW/4, W/2 SE/4 and

SE/4 SE/4

Section 7: All

Section 8:

S/2 N/2 and S/2

Section 9: S/2 NW/4, SW/4, W/2 SE/4 and SE/4 SE/4

Section 10:

E/2 and SW/4

Section 11 to 36 inclusive

Released to Imaging: 12/12/2025 9:26:24 AM

-4-EXHIBIT "A" con'd

Released to Imaging: 12/12/2025 9:26:24 AM

LEA COUNTY, NEW MEXICO

TOWNSHIP 20 SOUTH, RANGE 32 EAST, NMPM

Sections 1 to 4 inclusive Section 5: S/2 SE/4

Section 6: Lots 4 to 7 inclusive, SE/4 NW/4,

E/2 SW/4 and SW/4 SE/4

Sections 7 to 36 inclusive

TOWNSHIP 20 **SOUTH**, RANGE 33 EAST, NMPM Sections 1 to 36 inclusive

TOWNSHIP 20 SOUTH, RANGE 34 EAST, NMPM

Section 6: Lots 3 to 7 inclusive, SE/4 NEW/4,

E/2SW/4, W/2 SE/4 AND

SE/4 SE/4

Section 7: All

Section 8: SW/4, S/2 NW/4, W/2 SE/4 and

SE/4 SE/4

Section 16:

W/2 NW/4, SE/4 NW/4, SW/4 and

S/2 SE/4

Sections 17 to 21 inclusive

Section 22:

N/2 NW/4, SW/4 NW/4, W/2 SE/4,

and SE/4 SE/4

Section 26:

SW/4, W/2 SE/4 and SE/4 SE/4

Sections 27 to 35 inclusive

Section 36:

SW/4 NW/4 and W/2 SW/4

EDDY COUNTY, NEW MEXICO

TOWNSHIP 21 SOUTH, RANGE 29 EAST, NMPM

Sections 1 to 3 inclusive

Section 4: Lots 1 through 16, NE/4 SW/4 and

SE/4

Section 5: Lot 1

Section 10:

N/2 NE/4, SE/4 NE/4 and SE/4 SE/4

Sections 11 to 14 inclusive

Section 15:

E/2 NE/4 and NE/4 SE/4

Section 23:

N/2 NE/4

Section 24:

E/2, N/2NW/4 and SE/4NW/4

Section 25:

NE/4 NE/4 and S/2 SE/4

Section 35:

Lots 2 to 4 inclusive, S/2 NE/4.

NE/4 SW/4 and N/2 SE/4

Section 36:

Lots 1 to 4 inclusive, NE/4,

E/2 NW/4 AND N/2 S/2

TOWNSHIP 21 SOUTH, RANGE 30 EAST, NMPM

Sections 1 to 36 inclusive

-5-**EXHIBIT** "A" CON'D

TOWNSHIP 21 SOUTH, RANGE 31 EAST, NMPM

Sections 1 to 36 inclusive

LEA COUNTY, NEW MEXICO

TOWNSHIP 21 SOUTH, RANGE 32 EAST, NMPM

Sections 1 to 27 inclusive

Section 28:

N/2 and N/2 S/2

Sections 29 to 31 inclusive

Section 32:

NW/4 NE/4, NW/4 and NW/4 SW/4

Section 34:

N/2 NE/4

Section 35:

N/2 N/2

Section 36:

E/2, N/2 NW/4, SE/4 NW/4 and

NE/4 SW/4

TOWNSHIP **21 SOUTH, RANGE** 33 EAST, NMPM

Section 1:

Lots 2 to 7 inclusive, Lots 10

to 14 inclusive, N/2 SW/4 and

SW/4 SW/4

Sections 2 to 11 inclusive

Section 12:

NW/4 NW/4 and SW/4 SW/4

Section 13:

N/2 NW/4, S/2 N/2 and S/2

Sections 14 to 24 inclusive

Section 25:

N/2. SW/4 and W/2 SE/4

Sections 26 to 30 inclusive

Section 31:

Lots 1 to 4 inclusive, NE/4,

E/2 W/2, N/2 SE/4 and

SW/4 SE/4

Section 32:

N/2 and NW/4 SW/4

Section 33:

Section 34:

NE/4, N/2 NW/4 and E/2 SE/4

Section 35:

Section 36:

W/2 NE/4, NW/4 and S/2

TOWNSHIP 21 SOUTH, RANGE 34 EAST, NMPM

Section 17: W/2 Section 18: All

Section 19:

Lots 1 to 4 inclusive, NE/4,

E/2 W/2, N/2 SE/4 and

SW/4 SE/4

Section 20:

NW/4 NW/4

Section 30:

Lots 1 and 2 and NE/4 NW/4

Section 31:

Lots 3 and 4

EDDY COUNTY, NEW MEXICO

TOWNSHIP 22 **SOUTH, RANGE** 28 EAST, NMPM

Section 36: E/2 E/2

-6-EXHIBIT "A" con'd

TOWNSHIP 22 SOUTH, RANGE 29 EAST, NMPM

Sections 1 and 2 inclusive

Section 3 SE/4 SW/4 and SE/4 Section 9 S/2 NE/4 and S/2

Section 9 S/2 NE/4
Sections 10 to 16 inclusive
Section 17 S/2 SE/4

Section 19 SE/4 NE/4 and E/2 SE/4

Sections 20 to 28 inclusive

Section 29 N/2 N/2, S/2 NE/4 and SE/4

Section 30 NE/4 NE/4

Section 31 Lots 1 to 4 inclusive, S/2 NE/4,

E/2 W/2 and SE/4

Sections 32 to 36 inclusive

TOWNSHIP 22 SOUTH, RANGE 30 EAST, NMPM

Sections 1 to 36 inclusive

TOWNSHIP 22 SOUTH, RANGE 31 EAST, NMPM

Sections 1 to 11 inclusive

Section 12: NW/4 NE/4, NW/4 and NW/4 SW/4

Section 13: S/2 NW/4 and SW/4

Sections 14 through 23 inclusive

Section 24: W/2 Section 25: NW/4

Section 26: NE/4 AND N/2 NW/4

Sections 27 to 34 inclusive

LEA COUNTY, NEW MEXICO

TOWNSHIP 22 SOUTH, RANGE 32 EAST, NMPM

Section 1: Lot 1

Section 6: Lots 2 to 7 inclusive and SE/4 NW/4

TOWNSHIP 22 SOUTH, RANGE 33 EAST NMPM

Section 1: Lots 1 to 4 inclusive, S/2 N/2 and

N/2 S/2

Section 2:All

Section 3:Lot 1, SE/4 NE/4 and SE/4

Section 6: Lot 4

Section 10:

NE/4

Section 11:

NW/4 NE/4 AND NW/4

TOWNSHIP 22 SOUTH, RANGE 34 EAST NMPM

Section 6: Lots 4 to 6 inclusive

Received by OCD: 11/21/2025 11:29:18 AM

-7-EXHIBIT "A" **con'd**

EDDY COUNTY, NEW MEXICO

TOWNSHIP 23 SOUTH, RANGE 28 EAST, NMPM

Section 1: Lot 1

TOWNSHIP 23 SOUTH, RANGE 29 EAST, NMPM

Sections 1 to 5 inclusive

Section 6:

Lots 1 to 6 inclusive, S/2 NE/4,

SE/4 NW/4. E/2 SW/4 and SE/4

Section 7: NE/4 and NE/4 NW/4

Section 8: N/2, N/2 SW/4, SE/4 SW/4 and SE/4

Sections 9 to 16 inclusive

Section 17:

NE/4 and E/2 SE/4

Sections 21 to 23 inclusive

Section 24:

N/2, SW/4 and N/2 SE/4

Section 25:

W/2 NW/4 and NW/4 SW/4

Section 26:

All

Section 27: Section 28: All N/2, N/2 SW/4, SE/4 SW/4 and SE/4

Section 33:

N/2 NE/4 and NE/4 NW/4

Section 34:

NE/4, E/2 NW/4, NW/4 NW/4,

NE/4 SW/4 and SE/4

Section 35:

Section 36:

W/2 NE/4, NW/4 and N/2 SW/4

TOWNSHIP 23 SOUTH, RANGE 30 EAST, NMPM

Sections 1 to 18 inclusive

Section 19

N/2, N/2 SW/4, SE/4 SW/4 and SE/4

Section 20

All

ΑII

Section 21

All

N/2, S/2 SW/4, N/2 S/2 and SE/4 SE/4 Section 22

Sections 23 to 25 inclusive

Section 26

E/2, SE/4 NW/4 and SW/4

Section 27

N/2 NW/4, SW/4 NW/4, SE/4 SW/4,

S/2 SE/4 and NE/4 SE/4

Section 28

N/2 and SW/4 Sect ion 29 N/2 and SE/4

Section 30

N/2 NE/4

Section 32

N/2 NE/4

Section 33

SE/4 NE/4, N/2 NW/4, NE/4 SE/4

and S/2 SE/4

Sections 34 to 36 inclusive

TOWNSHIP 23 SOUTH, RANGE 31 EAST, NMPM

Section 2:

Lot 4, SW/4 NW/4 and W/2 SE/4

Sections 3 to 7 inclusive

Section 8:

NE/4 NE/4, W/2 NE/4 and W/2

Section 9:

N/2 N/2

Section 10:

NW/4 NW/4 and SE/4 SE/4

Section 11:

S/2 NE/4, S/2 SW/4 and SE/4

Received by OCD: 11/21/2025 11:29:18 AM

-8-EXHIBIT "A" CON'D

Section 12: SW/4 NW/4 and SW/4

Section 13: SW/4 NE/4, W/2 and W/2 SE/4

Section 14:

Section 15: E/2, SE/4 NW/4 and SW/4

Section 16: SW/4 and S/2 SE/4

Section 17: NW/4 and S/2

Sections 18 to 23 inclusive

Section 24: W/2 NE/4 and W/2

Section 25: W/2 NE/4, NW/4, N/2 SW/4 and

NW/4 SE/4

Section 26 to 34 inclusive

Section 35: N/2 NW/4 and SW/4 NW/4

TOWNSHIP 24 SOUTH, RANGE 29 EAST, NMPM

Section 2: Lots 2 to 4 inclusive

Section 3:Lot 1

TOWNSHIP 24 SOUTH, RANGE 30 EAST, NMPM

Section 1: Lots 1 to 4 inclusive, S/2 N/2, SW/4 and NW/4 SE/4

Section 2: All Section 3: All

Section 4: Lots 1 and 2, S/2 NE/4, SE/4 NW/4,

SW/4 SW/4. E/2 SW/4 and SE/4

Section 9: N/2, N/2 SW/4, SE/4 SW/4 and SE/4

Section 10: All Section 11: ΑII

Section 12: W/2 NW/4 and NW/4 SW/4

Section 14: W/2 NE/4 and NW/4 Section 15: NE/4 and N/2 NW/4

TOWNSHIP 24 SOUTH, RANGE 31 EAST, NMPM

Section 3: Lots 2 to 4 inclusive, SW/4 NE/4,

S/2 NW/4, SW/4 and W/2 SE/4

Section 4:

All Section 5: Lots 1 to 4 inclusive, S/2 N/2,

N/2 S/2 and SE/4 SE/4

Section 6: Lots 1 to 6 inclusive, S/2 NE/4,

SE/4 NW/4, NE/4 SW/4 and

N/2 SE/4

Section 9: E/2 and NW/4 Section 10: W/2 NE/4 and W/2

Section 35: Lots 1 to 4 inclusive, S/2 N/2 and

N/2 S/2


Section 36: Lots 1 and 2, SW/4 NW/4 and N/2 SW/4

TOWNSHIP 25 SOUTH, RANGE 31 EAST, NMPM


Section 1: Lots 3 and 4 and S/2 NW/4

Section 2: Lots 1 to 4 inclusive and S/2 N/2



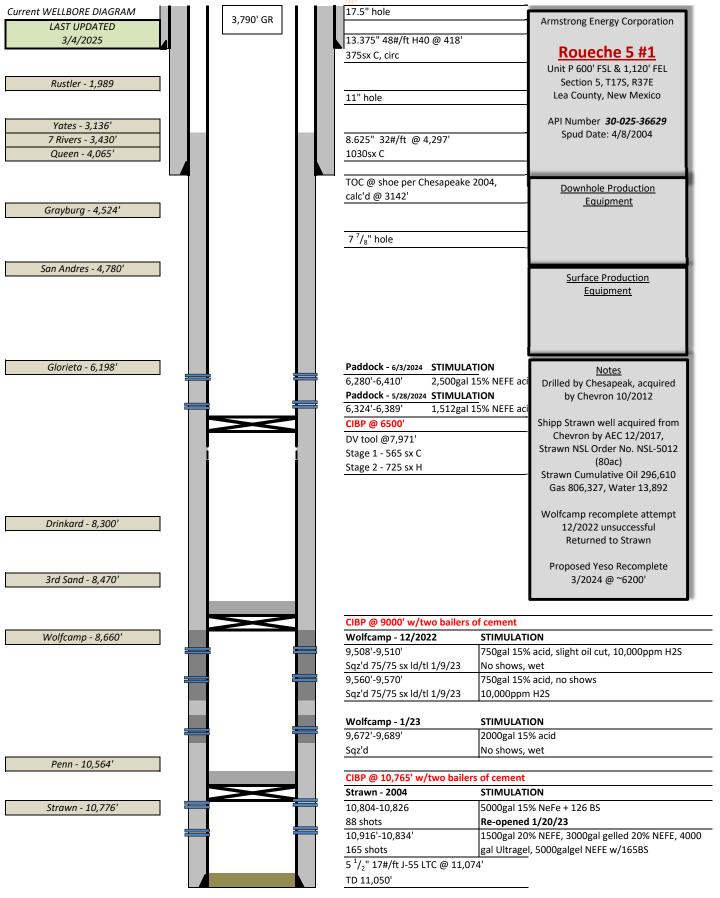



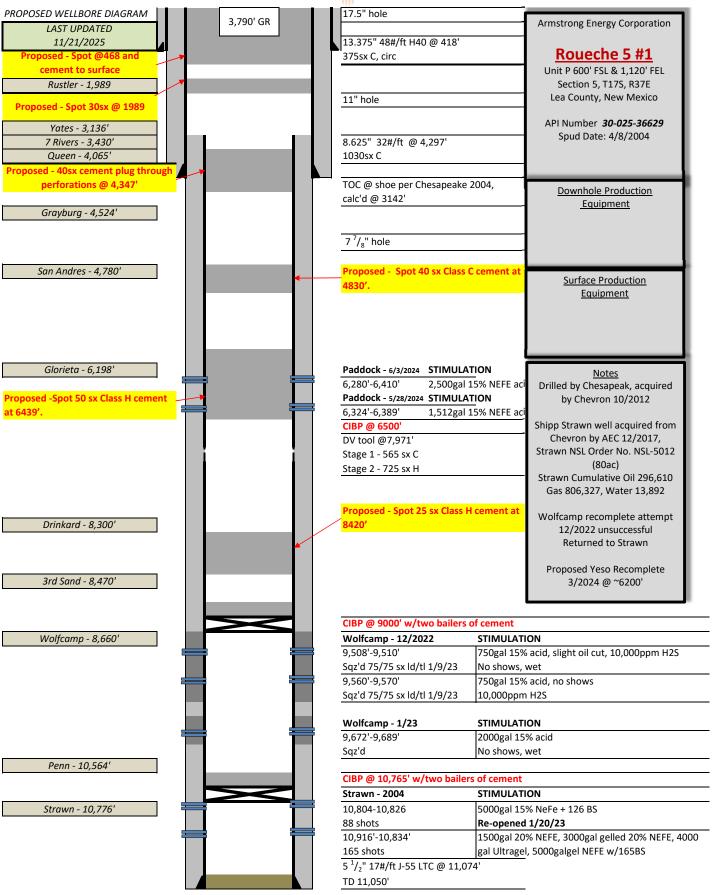

Sante Fe Main Office Phone: (505) 476-3441

General Information Phone: (505) 629-6116

Online Phone Directory https://www.emnrd.nm.gov/ocd/contact-us

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. Santa Fe, NM 87505

CONDITIONS

Action 528797

CONDITIONS

Operator:	OGRID:
ARMSTRONG ENERGY CORP	1092
P.O. Box 1973	Action Number:
Roswell, NM 88202	528797
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By	Condition	Condition Date
gcordero	A Cement Bond Log (CBL) is required to be submitted to electronic permitting for 5.5" casing	12/12/2025
gcordero	A Cement Bond Log (CBL) is required to be submitted to electronic permitting for 8 5/8" casing	12/12/2025
gcordero	Submit Cement Bond Logs (CBL) prior to submittal of C-103P.	12/12/2025
gcordero	Adhere to current Plug & Abandon (P&A) Conditions Of Approvals (COA).	12/12/2025