

**Carbon Energy
Shell State # 1
API # 30-025-26637
UL C, Section 6, T19S, R37E
Plugging Procedure**

**8 5/8" casing set at 368ft, Cmt circulated
5 1/2" casing set 4030ft , Cmt Circulated
Perfs 3890-3964ft**

- 1. Move in plugging rig**
- 2. Pull all production equipment**
- 3. Run and set CIBP at 3825ft**
- 4. Run tbg and tag CIBP**
- 5. Displace well with gelled brine water**
- 6. Spot 25 sx cement plug**
- 7. Pull tubing to 1700ft**
- 8. Spot 25 sx cement plug**
- 9. Pull tubing to 418ft**
- 10. Circulate cement to surface 40sx**
- 11. Pull tubing**
- 12. Cut off well head and install PA marker**
- 13. Rig down move out SU**
- 14. Remove SU anchors**
- 15. Clean and level location**
- 16. Remove any surface production equipment**
- 17. Clean and level location**

BEP 01/15/2004

**Before the OCD
Case 13337
OCD Ex. 16**