

Mayfair Minerals
Rhonda PG State # 1
30-041-20615

13 3/8" casing set at 39 ft, cement circulated
8 5/8" casing set at 2043ft, cement circulated
4 1/2" casing set at 4525ft, cement with 445sx cement
TOC 3100ft by bond log
Perfs 4218-4477ft

1. Move in rig up plugging unit
2. Pull rods and tubing
3. Run and set CIBP at 4175ft
4. Run tubing and tag CIBP
5. Displace well with gelled brine water
6. Spot 25 sx cement plug
7. Pull tubing
8. Weld on pull nipple and stretch 4 1/2" casing
9. Cut and pull casing from 3000ft
10. Run tubing to 3050ft
11. Spot 35 sx cement plug
12. Pull tubing and WOC
13. Run tubing and tag cement plug
14. Pull tubing to 2093ft
15. Spot 35 sx cement plug
16. Pull tubing and WOC
17. Run tubing and tag cement plug
18. Pull tubing to 350 ft
19. Spot 35 sx cement plug
20. Pull tubing and WOC
21. Run tubing and tag cement plug
22. Pull tubing to 60 ft
23. Circulate cement to surface
24. Pull tubing
25. Cut off wellhead and install PA marker
26. Rig down plugging unit
27. Cut off service unit anchors and clean location

BEFORE EXAMINER	
GEORGETOWN DEPARTMENT	
000	EXHIBIT NO. 9
CASE NO.	12976