


Well Welch "A" #3
 Unit F Section 4 Township 19 Range 31
 API # 30-015--05728

T. Salt 405
 B. Salt 2190
 Yates 2475
 Glorieta _____
 Delaware _____
 Bone Sp. _____
 Abo _____
 Wolfcamp _____
 Morrow _____
 Devonian _____
 Fusselman _____
 Other _____

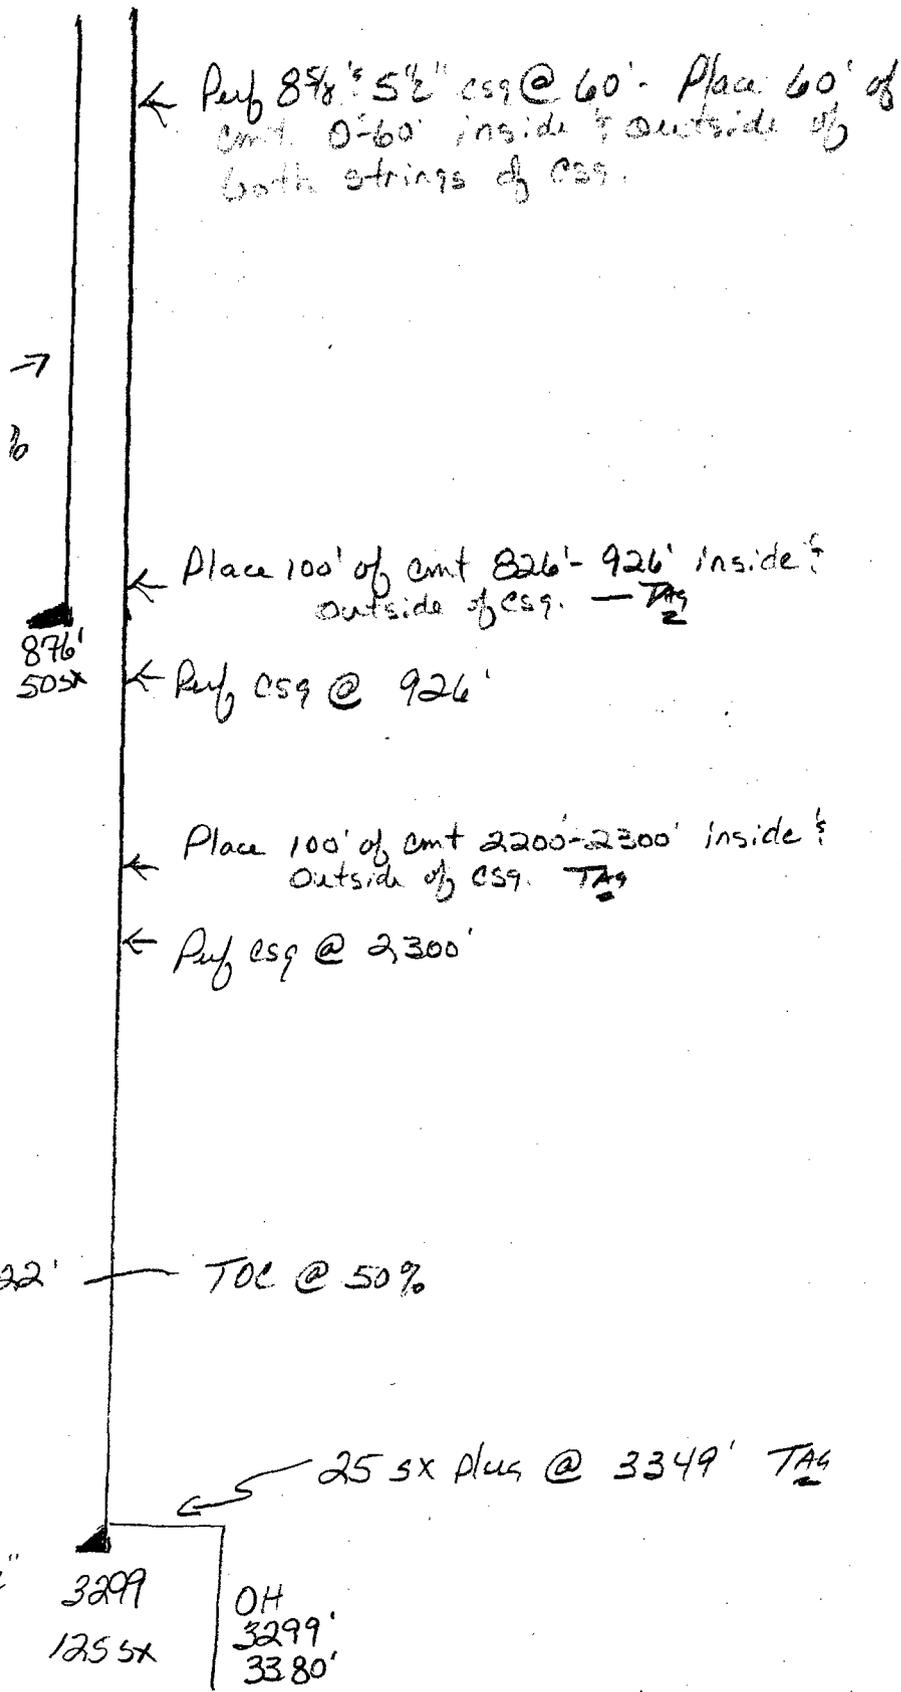

← Perf 8 7/8" 5 1/2" CS9 @ 60'. Place 60' of cmt. 0-60' inside & outside of both strings of CS9.

← Place 100' of cmt 826'-926' inside & outside of CS9. TAG

← Perf CS9 @ 926'

← Place 100' of cmt 2200'-2300' inside & outside of CS9. TAG

← Perf CS9 @ 2300'

- Contact OCD 24 hrs. prior to any work done.
- Salt gel mud consisting of 10# brine with 25# of gel per barrel must be placed between each plug
- Install dry hole marker as per rule 202.B.2
- Plugs are to be set from point indicated up. Plugs must not be less than 100' or 25 Sacks of cement, whichever is greater, unless specifically indicated.
- Shoe and stub plugs will be 50' above and below shoe or stub and tagged.
- Surface plug will be from 0' - 60'
- Where plugs are required cement must be placed inside and outside of all casing string(s), in the correct footage or sacks required, if no cement exists.
- Plugs to be tagged will be indicated.

BEFORE EXAMINER CATANACH
 OIL CONSERVATION DIVISION
OCD EXHIBIT NO. 29
 CASE NO. 12965