

Operator Reuben Monsen
 Well North State #1
 Unit G Section 23 Township 18 Range 27
 API # 30-015--00931

TOPS

T. Salt _____
 B. Salt _____
 Yates 190
 Glorieta 7 Rivers 580
 Delaware Bowers 910
 Bone Sp. Queen 1170
 Abo Grayby 1600
 Wolfcamp _____
 Morrow _____
 Devonian _____
 Fusselman _____
 Other _____

Perf + Spuz @ 240'
 Cement Plug In + Out
 TO SURFACE.

Perf + Spuz. Spnt 100' cement
 Plug In + Out. WUC TAG.

Perf + Spuz. @ 1700'
 100' cement plug In + Out WUC TAG.

T.O 2035'
 O H

- Contact OCD 24 hrs. prior to any work done.
- Salt gel mud consisting of 10# brine with 25# of gel per barrel must be placed between each plug
- Install dry hole marker as per rule 202.B.2
- Plugs are to be set from point indicated up. Plugs must not be less than 100' or 25 Sacks of cement, whichever is greater, unless specifically indicated.
- Shoe and stub plugs will be 50' above and below shoe or stub and tagged.
- Surface plug will be from 0' - 60'
- Where plugs are required cement must be placed inside and outside of all casing string(s), in the correct footage or sacks required, if no cement exists.
- Plugs to be tagged will be indicated.

OCD Exhibit 3
 Case No 13713
 Nov 2 2006