

Hamilton "A" #2 Well  
Knowles Field

Re-completion Procedure  
(Complete with Rod Pump Installation)

Devonian Formation

- Step 1 Move in and rig up workover rig. Nipple down tree, Nipple up and test BOP's.
- Step 2 Release 5-1/2" tubing anchor, if present. POOH with tubing and nipples.
- Step 3 Rig up wireline, tag for fill, run bottom hole pressure survey in present Devonian perforations.
- Step 4 Trip in hole with 5-1/2" packer, set at 12,250'(+/-). Circulate and condition hole.
- Step 5 Perform ball sealer acid job with 1000 gal. 15% HCL acid. Swab & test well.
- Step 7 Run rod pump setting. Install surface pump and hook-ups and place well on production.