



NEW MEXICO ENERGY, MINERALS and
 NEW MEXICO RESOURCES DEPARTMENT
 NATURAL RESOURCES DEPARTMENT

~~GARY L. JOHNSON~~
~~GARY L. JOHNSON~~
 Betty Rivera
~~Betty Rivera~~
 Cabinet Secretary

~~Lori Wrotenbery~~
~~Lori Wrotenbery~~
 Oil Conservation Division
 Oil Conservation Division

OK Operating
 Arco Federal # 2
 Lot 3, Sec 4, T10S, R38E 1973 FNL, 1980 FWL
 Plugging Procedure
 30-025-27669

8 5/8" casing set at 396 ft, Cement circulated
 4 1/2" casing set at 4999ft, Cement circulated
 Perfs 4924-4962ft
 Well fluids circulated to steel pit or plastic lined earthen pit

1. Move in plugging rig
2. Pull production equipment
3. Run and set CIBP at 4850ft
4. Cap CIBP with 35 ft of cement by dump bailer
5. Run tubing and tag cement plug
6. Displace well with gelled brine water
7. Pull tubing to 2395ft
8. Spot 25 sx cement plug
9. Pull tubing 446 feet
10. Circulate cement to surface
11. Pull tubing
12. Cut off well head and install PA marker
13. Rig down move out service unit
14. Remove pumping unit, cut off anchors, clean location

BEFORE EXAMINER SIGNATURE	
OIL CONSERVATION DIVISION	
OCD	EXAMINER NO. 8
CASE NO.	12945

Reported prodn thru 8-99