

Division Approved Plugging Program

Jack L. Cayias and/or J.R. Abraham
Charles M #3, L-1-25N-3W

Down Hole Equipment

8 5/8" at 110' with 100 sacks
4 1/2" at 3848' with 100 sacks
2 3/8" at unknown depth

1. Pull and check tubing.
2. Run Tubing to TD
3. Set a cement plug 3834'-3600' to cover Pictured Cliffs and Fruitland.
4. Come out of hole with tubing.
5. Find casing free point.
6. Shoot off and pull casing or perforate at free point.
7. Set a 100' cement plug at casing stub 50' inside and 50' outside or set a 100' plug inside and outside casing to isolate Ojo Alamo.
8. Set a cement plug 160'-60' below and inside surface pipe.
9. Set top plug and dry hole marker with a minimum of 10 sacks of cement.
10. Fill pits, clean and level location.

All plugs will be with Class A, B, or C cement with or without an accelerator.

REPORT NO.	1
CIL LC	
DATE	8-29-84
Submitted by	Cholson
Received by	9-5-84