

**Kelly H. Baxter  
Plugging Procedure  
State 26 #1**

- 1) Move in rig up plugging unit
- 2) Nipple up BOP
- 3) Release packer and pull tubing and packer
- 4) Pick up workstring and run in well
- 5) Tag PBTD 5097 feet
- 6) Displace well with mud laden fluid
- 7) Spot 30 sx cement
- 8) Pull tubing to 3762 feet
- 9) Spot 35 sx cement
- 10) Pull tubing and WOC
- 11) Run tubing and tag cement plug, maximum depth 3662 feet
- 12) Pull tubing to 2790 feet
- 13) Spot 30 sx cement
- 14) Pull tubing to 2450 feet
- 15) Spot 30 sx cement
- 16) Pull tubing to 462 feet
- 17) Spot 30 sx cement
- 18) Pull tubing and WOC
- 19) Run tubing and tag cement plug, maximum depth is 363 ft
- 20) Pull tubing to 60 feet and circulate cement to surface
- 21) Cut off wellhead and install PA marker
- 22) Rig down move out service unit
- 23) Cut off anchors 1 feet below ground level

|                           |                |
|---------------------------|----------------|
| BEFORE EXAMINER CATANACH  |                |
| OIL CONSERVATION DIVISION |                |
| OCD                       | EXHIBIT NO. 13 |
| CASE NO.                  | 12792          |