

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals, and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.
30-059-20359

5. Indicate Type of Lease
STATE FEE

6. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

7. Lease Name or Unit Agreement Name
BRAVO DOME CO2 GAS UNIT

1. Type of Well
OIL WELL GAS WELL OTHER CO2

8. Well No.
1835-232D

2. Name of Operator
AMOCO PRODUCTION COMPANY

3. Address of Operator
P.O. Box 303, AMISTAD, NEW MEXICO 88410

9. Pool name or Wildcat
BRAVO DOME CO2 GAS UNIT - Tubb

4. Well Location
Unit Letter D : 204 Feet From The North Line and 1195 Feet From The West Line
Section 23 Township 18N Range 35E NMPM Union County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)
4571 GR

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>		CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work)
SEE RULE 1103.

4/26/98
Move in rig up service unit. Kill well with fresh water. Nipple up BOP. Pick up and run 2-3/8" workstring to 2426'. Spot 25 sacks of class C cement @ 2426'. Wait on cement. No tag. Re-spot 25 sacks class C cement @ 2426'. Wait on cement.
4/27/98
Tag @ 2201'. Circulate well with mud laden fluid with inhibitor. Pressure test to 500 psi. Spot 15 sacks class C cement @ 1767' - 1623'. Spot 5 sacks class C cement @ 30'-3' Cut off wellhead and anchors 3' below ground level. Cap well with steel plate. Install dry hole marker. Rig down move out service unit. Clean and level location.

OK 8-4-98

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE [Signature] TITLE Field Team Leader DATE 5/14/98

TYPE OR PRINT NAME D. J. Holcomb TELEPHONE NO. (505) 374-3010

(This space for State Use)
APPROVED BY [Signature] TITLE DISTRICT SUPERVISOR DATE 8/10/98

CONDITIONS OF APPROVAL, IF ANY: