

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II
811 S. First St., Artesia, NM 88210
Phone: (575) 748-1283 Fax: (575) 748-9720

District III
1000 Rio Brazos Road, Aztec, NM 87410
Phone: (505) 334-6178 Fax: (505) 334-6170

District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505
Phone: (505) 476-3460 Fax: (505) 476-3462

State of New Mexico

Form C-101
Revised July 18, 2013

Energy Minerals and Natural Resources

Oil Conservation Division

☐ AMENDED REPORT

1220 South St. Francis Dr.

Santa Fe, NM 87505

HOBBS OCD

MAY 15 2014

APPLICATION FOR PERMIT TO DRILL, RE-ENTER, DEEPEN, PLUGBACK, OR ADD A ZONE

¹ Operator Name and Address VANGUARD PERMIAN LLC 5847 SAN FELIPE SUITE 3000 HOUSTON, TEXAS 77057		² OGRID Number 258350
		³ API Number 30-025-37400
⁴ Property Code 301544	⁵ Property Name COLE STATE	⁶ Well No. 19

⁷ Surface Location

UL - Lot	Section	Township	Range	Lot Idn	Feet from	N/S Line	Feet From	E/W Line	County
G	16	22S	37E		1650	NORTH	1800	EAST	LEA

⁸ Proposed Bottom Hole Location

UL - Lot	Section	Township	Range	Lot Idn	Feet from	N/S Line	Feet From	E/W Line	County

⁹ Pool Information

¹⁰ Pool Name PENROSE SKELLY GRAYBURG SAN ANDRES	¹¹ Pool Code 50350
--	---

Additional Well Information

¹² Work Type P	¹³ Well Type OIL	¹⁴ Cable/Rotary 	¹⁵ Lease Type STATE	¹⁶ Ground Level Elevation 3411 GL
¹⁷ Multiple 	¹⁸ Proposed Depth 3710	¹⁹ Formation GRAYBURG SAN ANDRES	²⁰ Contractor 	²¹ Spud Date
²² Depth to Ground water 		²³ Distance from nearest fresh water well 		²⁴ Distance to nearest surface water

☐ We will be using a closed-loop system in lieu of lined pits

²⁵ Proposed Casing and Cement Program

Type	Hole Size	Casing Size	Casing Weight/ft	Setting Depth	Sacks of Cement	Estimated TOC

Casing/Cement Program: Additional Comments

--

²⁶ Proposed Blowout Prevention Program

Type	Working Pressure	Test Pressure	Manufacturer

²⁷ I hereby certify that the information given above is true and complete to the best of my knowledge and belief.
I further certify that I have complied with 19.15.14.9 (A) NMAC ☐ and/or 19.15.14.9 (B) NMAC ☐ if applicable.
Signature: *Gaye Heard*

Printed name: **GAYE HEARD**

Title: **AGENT**

E-mail Address: **gheard@oilreportsinc.com**

Date: **5-14-2014**

Phone: **575-393-2727**

OIL CONSERVATION DIVISION

Approved By:

Title:

Approved Date:

Expiration Date:

Conditions of Approval Attached

MAY 19 2014

Lee

VANGUARD PERMIAN LLC

COLE STATE #19

API #30-025-37400 Sec 16 T22S R37E

1. MIRU completion rig and test anchors.
2. Unseat pump and POOH w/ rods and pump.
3. ND WH and NU BOP. Kill well with 2% KCL water, if necessary. Release TAC and POOH w/ tubing.
4. PU, strap and TIH with 4-3/4" bit, 5-1/2" casing scrapper & 2-7/8" tubing. Clean out hole to ~3970' until clean returns, POOH and stand back 2-7/8" tubing.
5. MI wireline w/ packoff. RIH w/ CBP and GR/CCL & correlate to the Baker Hughes Gamma/Neutron Log dated 1-Nov-2005.
6. Set CBP @ ~3710'. Test CBP and casing to 1000 psi.
7. MU 3-1/8" slick casing guns set at 3 spf, 120° phasing (0.40" hole, 21" penetration).
8. Perforate as follows:
 - a. 3485' - 3488' (3', 3 spf, 9 shots)
 - b. 3530' - 3534' (4', 3 spf, 12 shots)
 - c. 3634' - 3636' (2', 3 spf, 6 shots) for a total of 27 shots
9. RD wireline.
10. PU a 5-1/2" Arrowset packer and 2-7/8" tubing. Test tubing going in the hole to 3500 psi.
11. MIRU pump truck (with 500 gals acid) and test lines to 3500 psi.
 - a. Spot 50 gals of acid across perforations. Load tubing with 2 % KCl and set packer at 3450'.
 - b. Pump 450 gals 15% NEFE acid and flush to 3636'.
 - c. Record ISIP, 5 min, 10 min and 30 min.
12. RU swabber and swab well in to test acid job. Recover load and report fluid/gas entry, if possible. If well is on vacuum, continue to Step 13.
13. Release packer and POOH laying down packer and tubing.
14. RDMO completion rig.
15. Call out 3-500 bbl tanks & fill with 2% KCl water. Install frac valve in preparation for frac job down 5-1/2" casing.
16. RU frac Co. and test lines & pump as per frac schedule.
17. Monitor ISIP, 5 min, 10 min, 15 min. Flowback until well dies.
18. Rig down frac valve and release frac tanks.
19. MIRU completion rig.
20. Kill well with water if necessary.
21. PU a 4-3/4" bit and 2-7/8" tubing and RIH to confirm perfs are open and cleanout to CBP @ 3710', POOH.
22. RU and bail sand if necessary.
23. RIH w/ 5-1/2" TAC, SN and 2-7/8" tubing.
24. RIH w/ rods and pump.
25. RD & MO.
26. Turn well on to production and test.



Cole State #19
P. Skelly/Graygurg/San Andres - 30-025-37400
Lea County, New Mexico
 PROPOSED COMPLETION - 5/2014


KB: 3421'
 GL: 3411'

TOC @ surf
 380 sxs

8 5/8" csg @ 1091'

TOC @ surf
 700 sxs

5 1/2" csg @ 4194'

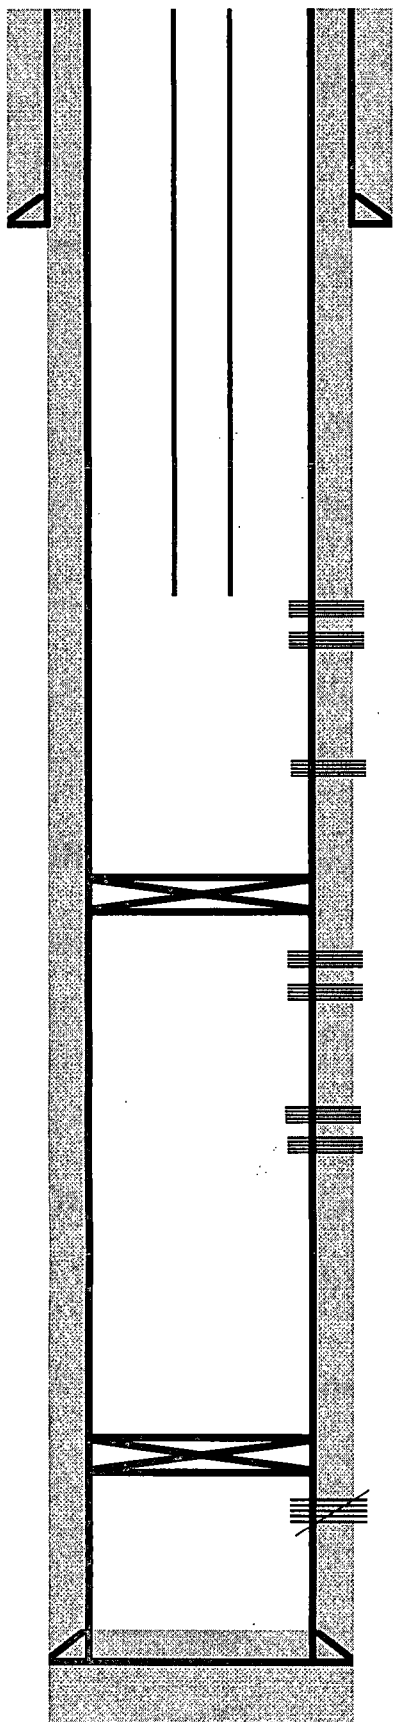

CASING PROGRAM

<u>Depth</u>	<u>Size</u>	<u>Weight</u>	<u>Grade</u>	<u>I.D.</u>	<u>Collapse</u>	<u>Burst</u>
1091'	8 5/8"	24#	K-55	8.097	1,370	2,950
4194'	5 1/2"	15.5#	K-55	4.950	4,040	4,810

PRODUCTION TUBING

<u>Depth</u>	<u>Size</u>	<u>Weight</u>	<u>Grade</u>	<u>Threads</u>
3890.00	2 7/8"	6.5#	J-55	EUE

Penrose Skelly Perforations 21 holes:

3,485' - 3,488' (3 spf, 9 holes)
 3,530' - 3,534' (3 spf, 12 holes)

Grayburg Perforations 6 holes:
 3,634' - 3,636' (3 spf, 6 holes)

CIBP @ 3710'

Acidized & frac'd

Grayburg Perforations 12 holes:
 3,722' - 3,724' (3 spf, 6 holes)
 3,794' - 3,796' (3 spf, 6 holes)

San Andres Perforations 15 holes:
 3,836' - 3,838' (3 spf, 6 holes)
 3,884' - 3,887' (3 spf, 9 holes)

CIBP @ 3970'

Lower San Andres Perforations:
 4,002' - 4,120' (110 holes)

PBTD = 4,138' FC

Note: This schematic is not to scale. For display purposes only.