Submit 1 Copy To Appropriate District Office  District 1 – (575) 393-6161  1625 N. French Dr., Hobbs, NM 88240  District II – (575) 748-1283 811 S. First St., Artesia, NM 88210  District III – (505) 334-6178  MAY 272014CONSERVATION DIVISION 1220 South St. Francis Dr.	Form C-103 Revised July 18, 2013 WELL API NO. 3002523786  5. Indicate Type of Lease	
1000 Rio Brazos Rd., Aztec, NM 87410 <u>District JV</u> – (505) 476-3460  1220 S. St. Francis Dr., Santa Fe, NM  87505  RECEIVED  Santa Fe, NM 87505	STATE S FEE  6. State Oil & Gas Lease No. SWD-0092	
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	7. Lease Name or Unit Agreement Name STATE AB SWD	
1. Type of Well: Oil Well Gas Well Other SWD	8. Well Number #1	
Name of Operator     NABORS COMPLETION & PRODUCTION SERVICES.	9. OGRID Number 170966- 295925	
3. Address of Operator PO BOX 5208 HOBBS NEW MEXICO 88240	10. Pool name or Wildcat SAN ANDRES	
4. Well Location		
Unit Letter C : 660 feet from the NORTH line and		
Section 03 Township 19S Range 37E	NMPM County Lea	
11. Elevation (Show whether DR, RKB, RT, GR, etc.)		
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data		
<u> </u>	JBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK   PLUG AND ABANDON   REMEDIAL WO		
TEMPORARILY ABANDON	DRILLING OPNS.☐ P AND A · ☐	
DOWNHOLE COMMINGLE		
CLOSED-LOOP SYSTEM		
	lace packer	
13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.		

# 5-20-14

MIRU Nabors PU #1408. Conduct safety meeting. NDWH NUBOP. Release "Model R" packer. POOH SB 146 jts 2-7/8 J-55 6.5# 8rd duo-lined tbg. LD XO and packer. Found large hole in PKR mandrel. SDFN waiting on packer.

### 5-21-14

AOL conduct safety meeting.PU RIH w/5-1/2" PC AD-1 tension PKR and tbg. Found several jts tbg w/bad liners. RIH w/ all tbg. Begin POOH LD tbg string. LD 75 jts. SDFN waiting on replacement string of tbg.

### 5-22-14

AOL conduct safety meeting. Finish LD tbg and packer. Unload and tally tbg. PU RIH w/ 5-1/2" PC AD-1 tension PKR, XO and 146 jts 2-7/8" J-55 6.5# 8rd duo-lined tbg. 1-10' 2-7/8" and 1-4' 2-7/8" duo-lined sub to 4605'. PKR will not set. SDFN

## 5-23-14

AOL conduct safety meeting. Worked PKR. PKR will not set. POOH w/ tbg and PKR. Found pin sheared on PKR. Repair shear pin. RIH w/tbg and PKR. Add 6' 2-7/8 sub, set PKR at 4517' w/ 18 pts. NDBOP NUWH RU pump truck load csg w/75 bbls. Test csg to 400# RD kill truck. Shut down for the weekend.

### 5-27-14

RU kill truck PU casing to 500psi ran chart 30 minutes. held ok

Chart attached.

See Attached
Conditions of Approval
Ment page

Spud Date: Rig Release Date:	
I hereby certify that the information above is true and complete to the best of my knowledge	and belief.
SIGNATURE Freeman & TITLE Area MANAGER	DATE 5-27-14
Type or print name Freeman Young E-mail address: Freeman, You	4
APPROVED BY:  Conditions of Approval (if any):  APPROVED BY:  APPROVED BY:  Conditions of Approval (if any):	WISOTDATE 6/5/2014
	•
·	
See Attached	
5/29/2014 Conditions of Approval	
3/27/2014	- 1 11 a 1 mark 1 of
- Provide 1888 bore diagram.	ncluding Pers & packusign
	na ckey sot
- Leave well Shut in due to	1 - 5 SN MA
over 100' above top perf.	santate EMNRD. ELD
- Provide Phillip Goetze nice	say information
- parties of setting	orth exemption.
- Provide well bore diagram, l' - Leave well Shut in Lue to over 100' above top perf Provide Phillip Goetze mece to review for packer setting d	410 07014
	$\mathcal{O}$
Male 23	Drown
Stripe	Blown Supervisor
Next i	Supervisor.
6/4/2014 PACKU EXCEPTION	
PACKU EXCEPTION	
Approved by	
	HOBBS OCD
Jami Bailey Santa Fe	MAY 2 7 2014
Some Francisco	MIM! # 2017
Santa TE	RECEIVED

