

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

NMOCD  
Hobbs

FORM APPROVED  
OMB No. 1004-0135  
Expires: January 31, 2004

**SUNDRY NOTICES AND REPORTS ON WELLS**

*Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.*

**SUBMIT IN TRIPLICATE- Other instructions on reverse side**

1. Type of Well  
☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator  
Ridgeway Arizona Oil Corp

3a. Address  
777 N Eldridge Pkwy, Ste 150, Houston, TX 77079

3b. Phone No. (include area code)  
832-485-8522

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)  
660 FNL, 1980 FEL, Section 24, T7S, R33E

5. Lease Serial No.

NMN0127782

6. If Indian, Allottee or Tribe Name

7. If Unit or CA/Agreement, Name and/or No.

8. Well Name and No.

TKL Federal 24 #7

9. API Well No.

30-041-10511

10. Field and Pool, or Exploratory Area

Chaveroo, San Andres

11. County or Parish, State

Roosevelt County, NM

**12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA**

| TYPE OF SUBMISSION                                   | TYPE OF ACTION                                |  |  |   |
|--|---|--|--|---|
| <input checked="" type="checkbox"/> Notice of Intent | <input type="checkbox"/> Acidize              | <input type="checkbox"/> Deepen                      | <input type="checkbox"/> Production (Start/Resume) | <input type="checkbox"/> Water Shut-Off |
| <input type="checkbox"/> Subsequent Report           | <input type="checkbox"/> Alter Casing         | <input type="checkbox"/> Fracture Treat              | <input type="checkbox"/> Reclamation               | <input type="checkbox"/> Well Integrity |
| <input type="checkbox"/> Final Abandonment Notice    | <input type="checkbox"/> Casing Repair        | <input type="checkbox"/> New Construction            | <input type="checkbox"/> Recomplete                | <input type="checkbox"/> Other          |
|  | <input type="checkbox"/> Change Plans         | <input checked="" type="checkbox"/> Plug and Abandon | <input type="checkbox"/> Temporarily Abandon       |   |
|  | <input type="checkbox"/> Convert to Injection | <input type="checkbox"/> Plug Back                   | <input type="checkbox"/> Water Disposal            |   |

13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompleate horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompleation in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.)

In response to INC 150T071

Ridgeway representative will contact BLM 24 hours prior to beginning plugging procedures.

Please see attached sheet for proposed plugging procedures.

**DENIED**

14. I hereby certify that the foregoing is true and correct  
Name (Printed/Typed)

Jamie L Hogue

Title VP Regulatory Affairs

Signature

*Jamie L Hogue*

Date

6/26/15

**THIS SPACE FOR FEDERAL OR STATE OFFICE USE**

**DENIED!-Please See Plugging  
Procedure Approved 04-16-2014.**

/s/ [Signature]  
[Title]

Title

Office

ROSWELL FIELD OFFICE

Date

JUL 08 2015

or any person knowingly and willfully to make to any department or agency of the United  
matter within its jurisdiction.

## **Plugging Procedure**

**TKL Federal 24 #7**

**API 30-041-10511**

**660 FNL, 1980 FEL, SECTION 24, 7S-33E**

1. Prepare location and test anchors
2. MIRU Plugging rig
3. Notify BLM 24 hours prior to commencement of P&A procedures
4. NDWH/NU BOP
5. RIH w/4 ½" CIBP on 2 3/8" workstring @ 4060' (+/- within 100' of top perf – 4011')
  - a. Spot 35' of cement on CIBP
  - b. WOC – bump plug @ 4025' (+/-)
6. Load well with a minimum of 9 lbs mud and conduct MIT to 500 psi testing for leak off
  - a. Bleed pressure off after MIT
7. MIRU WL and RIH w/perf gun to 3025'
  - a. Perforate @ 2 SPF
  - b. POOH w/WL
  - c. RDWL
8. TIH w/WS – Squeeze 40 sack cement plug @ 3025'-2925' (+/-)
  - a. Wait on cement
  - b. Tag plug @ 2925' or above
9. MIRU WK and RIH w/perf gun to 1875'
  - a. 8 5/8" casing shoe @ 1825'
  - b. Perforate @ 2 SPF
  - c. POOH w/WL
  - d. RDWL
10. TIH w/WS – Squeeze 40 sack cement plug @ 1875'-1775'
  - a. Wait on cement
  - b. Tag plug @ 1775' or above
11. MIRU WL and RIH w/perf gun to 900'
  - a. Perforate @ 2 SPF
  - b. POOH w/WL
  - c. RDWL
12. TIH w/WS – Squeeze 40 sacks cement plug @ 900'-800'
  - a. Wait on cement
  - b. Tag plug @ 800' or above
13. MIRU WL and RIH w/perf gun to 60'
  - a. Perforate @ 2 SPF
  - b. POOH w/WL
  - c. RDWL

14. TIH w/WS – Circulate cement plug from 60' to surface

- a. Wait on cement
- b. Cut off well head

15. RDMO plugging rig

- a. Install P&A marker
- b. Cut off dead men
- c. Remediate location