Office <u>District I</u> – (575) 393-6161 1625 N. French Dr., Hobbs, NM 88240	State of New Mexico	Form C-103
1625 N. French Dr. Hobbe NIM 99240	Energy, Minerals and Natural Resources	October 13, 2009
	CD	WELL API NO.
<u>District II</u> – (575) 748-1283 811 S. First St., Artesia, NM 88210	OIL CONSERVATION DIVISION	30-025-25787
District III – (505) 334-6178		5. Indicate Type of Lease
1000 Rio Brazos Rd., Aztec, NM 87410	Santa Fe, NM 87505	STATE FEE -
<u>District IV</u> – (505) 476-3460 1220 S. St. Francis Dr., Santa Fe, NM	Santa Fe, NM 87505	6. State Oil & Gas Lease No.
87505 SUNDRY NOTICE	ES AND REPORTS ON WELLS	7. Lease Name or Unit Agreement Name
(DO NOT USE THIS FORM FOR PROPOSA	LS TO DRILL OR TO DEEPEN OR PLUG BACK TO A TION FOR PERMIT" (FORM C-101) FOR SUCH	Petrus D
	as Well Other	8. Well Number 1
2. Name of Operator		9. OGRID Number
COG Operating LLC	. ,	229137
3. Address of Operator	,	10. Pool name or Wildcat
600 W. Illinois, Midland, TX 79701		Maljamar Grayburg-San Andres
4. Well Location		
Unit Letter O : 19	general feet from the <u>E</u> line and <u>6</u>	60 feet from the S line
Section 11		IMPM County Lea
	11. Elevation (Show whether DR, RKB, RT, GR, etc.	
	4154.8' GR	
12 Check An	propriate Box to Indicate Nature of Notice,	Report or Other Data
12. Check Ap	propriate Box to indicate reature of rectice,	report of other Data
	UB	SEQUENT REPORT OF:
Approved for Plugging of wellbore on	ration and /OR	
under bond is retained pending restor completion of the C-103, Specific for S	Subsequent INT TO PA DRI	ILLING OPNS.   P AND A
Report of Well Plugging, which may b	e found on P&A NR	T JOB
the OCD web page under forms.	P&A R	
Restoration Due By <u>03 - 20 - Z0</u>	o18	
Nestoration bac by		
· ·		
13. Describe proposed or complet	ed operations. (Clearly state all pertinent details, an	
Describe proposed or complet of starting any proposed work	ed operations. (Clearly state all pertinent details, and). SEE RULE 19.15.7.14 NMAC. For Multiple Con	
Describe proposed or complet of starting any proposed work proposed completion or recon	ed operations. (Clearly state all pertinent details, and). SEE RULE 19.15.7.14 NMAC. For Multiple Completion.	mpletions: Attach wellbore diagram of
13. Describe proposed or complet of starting any proposed work proposed completion or recon 03/17/17 MIRU Plugging eq	ed operations. (Clearly state all pertinent details, and). SEE RULE 19.15.7.14 NMAC. For Multiple Completion.  uipment, unset pump. POH w/ rods & pump. 03/2	mpletions: Attach wellbore diagram of 20/17 Dug out cellar, ND well head, NU
13. Describe proposed or complet of starting any proposed work proposed completion or recon 03/17/17 MIRU Plugging eq BOP. POH w/ 2 3/8 tbg. RII	ed operations. (Clearly state all pertinent details, and). SEE RULE 19.15.7.14 NMAC. For Multiple Completion.  uipment, unset pump. POH w/ rods & pump. 03/2 H w/ guage ring to 4500'. POH. Set 5 1/2 CIBP @	20/17 Dug out cellar, ND well head, NU 4400' (03/21/17) Circulated hole with mud
13. Describe proposed or complet of starting any proposed work proposed completion or recon 03/17/17 MIRU Plugging eq BOP. POH w/ 2 3/8 tbg. RII laden fluid. Pressure tested	ed operations. (Clearly state all pertinent details, and). SEE RULE 19.15.7.14 NMAC. For Multiple Completion.  uipment, unset pump. POH w/ rods & pump. 03/2 H w/ guage ring to 4500'. POH. Set 5 1/2 CIBP @ csg, held 500 psi. Spotted 25 sx class C cmt @ 440	20/17 Dug out cellar, ND well head, NU 4400' 03/21/17 Circulated hole with mud 00-4147'. Spotted 25 sx class C cmt @
13. Describe proposed or complet of starting any proposed work proposed completion or recon 03/17/17 MIRU Plugging eq BOP. POH w/ 2 3/8 tbg. RII laden fluid. Pressure tested 2850-2597'. WOC. Tagged p	ed operations. (Clearly state all pertinent details, and). SEE RULE 19.15.7.14 NMAC. For Multiple Completion.  uipment, unset pump. POH w/ rods & pump. 03/2 H w/ guage ring to 4500'. POH. Set 5 1/2 CIBP @ csg, held 500 psi. Spotted 25 sx class C cmt @ 440 plug @ 2595'. Spotted 25 sx class C cmt @ 1525-12	20/17 Dug out cellar, ND well head, NU 4400' 03/21/17 Circulated hole with mud 10-4147'. Spotted 25 sx class C cmt @ 272'. Spotted 50 sx class C cmt @ 465' &
13. Describe proposed or complet of starting any proposed work proposed completion or recon 03/17/17 MIRU Plugging eq BOP. POH w/ 2 3/8 tbg. RII laden fluid. Pressure tested 2850-2597'. WOC. Tagged principle circulated to surface. Rigged	ed operations. (Clearly state all pertinent details, and). SEE RULE 19.15.7.14 NMAC. For Multiple Completion.  uipment, unset pump. POH w/ rods & pump. 03/2 H w/ guage ring to 4500'. POH. Set 5 1/2 CIBP @ csg, held 500 psi. Spotted 25 sx class C cmt @ 440 olug @ 2595'. Spotted 25 sx class C cmt @ 1525-12 d down and moved off. 03/23/17 Moved in backho	20/17 Dug out cellar, ND well head, NU 4400' (03/21/17) Circulated hole with mud 10-4147'. Spotted 25 sx class C cmt @ 272'. Spotted 50 sx class C cmt @ 465' & 10-4147'. Dug out cellar. Cut off well
13. Describe proposed or complet of starting any proposed work proposed completion or recon 03/17/17 MIRU Plugging eq BOP. POH w/ 2 3/8 tbg. RII laden fluid. Pressure tested 2850-2597'. WOC. Tagged principle circulated to surface. Rigged	ed operations. (Clearly state all pertinent details, and). SEE RULE 19.15.7.14 NMAC. For Multiple Completion.  uipment, unset pump. POH w/ rods & pump. 03/2 H w/ guage ring to 4500'. POH. Set 5 1/2 CIBP @ csg, held 500 psi. Spotted 25 sx class C cmt @ 440 plug @ 2595'. Spotted 25 sx class C cmt @ 1525-12	20/17 Dug out cellar, ND well head, NU 4400' (03/21/17) Circulated hole with mud 10-4147'. Spotted 25 sx class C cmt @ 272'. Spotted 50 sx class C cmt @ 465' & 10-4147'. Dug out cellar. Cut off well
13. Describe proposed or complet of starting any proposed work proposed completion or recon 03/17/17 MIRU Plugging eq BOP. POH w/ 2 3/8 tbg. RII laden fluid. Pressure tested 2850-2597'. WOC. Tagged principle circulated to surface. Rigged	ed operations. (Clearly state all pertinent details, and). SEE RULE 19.15.7.14 NMAC. For Multiple Completion.  uipment, unset pump. POH w/ rods & pump. 03/2 H w/ guage ring to 4500'. POH. Set 5 1/2 CIBP @ csg, held 500 psi. Spotted 25 sx class C cmt @ 440 olug @ 2595'. Spotted 25 sx class C cmt @ 1525-12 d down and moved off. 03/23/17 Moved in backho	20/17 Dug out cellar, ND well head, NU 4400' (03/21/17) Circulated hole with mud 10-4147'. Spotted 25 sx class C cmt @ 272'. Spotted 50 sx class C cmt @ 465' & 10-4147'. Dug out cellar. Cut off well
13. Describe proposed or complet of starting any proposed work proposed completion or recon 03/17/17 MIRU Plugging eq BOP. POH w/ 2 3/8 tbg. RII laden fluid. Pressure tested 2850-2597'. WOC. Tagged principle circulated to surface. Rigged	ed operations. (Clearly state all pertinent details, and). SEE RULE 19.15.7.14 NMAC. For Multiple Completion.  uipment, unset pump. POH w/ rods & pump. 03/2 H w/ guage ring to 4500'. POH. Set 5 1/2 CIBP @ csg, held 500 psi. Spotted 25 sx class C cmt @ 440 olug @ 2595'. Spotted 25 sx class C cmt @ 1525-12 d down and moved off. 03/23/17 Moved in backho	20/17 Dug out cellar, ND well head, NU 4400' (03/21/17) Circulated hole with mud 10-4147'. Spotted 25 sx class C cmt @ 272'. Spotted 50 sx class C cmt @ 465' & 10-4147'. Dug out cellar. Cut off well
13. Describe proposed or complet of starting any proposed work proposed completion or recon 03/17/17 MIRU Plugging eq BOP. POH w/ 2 3/8 tbg. RII laden fluid. Pressure tested 2850-2597'. WOC. Tagged principle circulated to surface. Rigged	ed operations. (Clearly state all pertinent details, and). SEE RULE 19.15.7.14 NMAC. For Multiple Completion.  uipment, unset pump. POH w/ rods & pump. 03/2 H w/ guage ring to 4500'. POH. Set 5 1/2 CIBP @ csg, held 500 psi. Spotted 25 sx class C cmt @ 440 olug @ 2595'. Spotted 25 sx class C cmt @ 1525-12 d down and moved off. 03/23/17 Moved in backho	20/17 Dug out cellar, ND well head, NU 4400' (03/21/17) Circulated hole with mud 10-4147'. Spotted 25 sx class C cmt @ 272'. Spotted 50 sx class C cmt @ 465' & 10-4147'. Dug out cellar. Cut off well
13. Describe proposed or complet of starting any proposed work proposed completion or recon 03/17/17 MIRU Plugging eq BOP. POH w/ 2 3/8 tbg. RII laden fluid. Pressure tested 2850-2597'. WOC. Tagged principle circulated to surface. Rigged	ed operations. (Clearly state all pertinent details, and). SEE RULE 19.15.7.14 NMAC. For Multiple Completion.  uipment, unset pump. POH w/ rods & pump. 03/2 H w/ guage ring to 4500'. POH. Set 5 1/2 CIBP @ csg, held 500 psi. Spotted 25 sx class C cmt @ 440 olug @ 2595'. Spotted 25 sx class C cmt @ 1525-12 d down and moved off. 03/23/17 Moved in backho	20/17 Dug out cellar, ND well head, NU 4400' (03/21/17) Circulated hole with mud 10-4147'. Spotted 25 sx class C cmt @ 272'. Spotted 50 sx class C cmt @ 465' & 10-4147'. Dug out cellar. Cut off well
13. Describe proposed or complet of starting any proposed work proposed completion or recon 03/17/17 MIRU Plugging eq BOP. POH w/ 2 3/8 tbg. RII laden fluid. Pressure tested 2850-2597'. WOC. Tagged principle circulated to surface. Rigged	ed operations. (Clearly state all pertinent details, and). SEE RULE 19.15.7.14 NMAC. For Multiple Completion.  uipment, unset pump. POH w/ rods & pump. 03/2 H w/ guage ring to 4500'. POH. Set 5 1/2 CIBP @ csg, held 500 psi. Spotted 25 sx class C cmt @ 440 olug @ 2595'. Spotted 25 sx class C cmt @ 1525-12 d down and moved off. 03/23/17 Moved in backho	20/17 Dug out cellar, ND well head, NU 4400' (03/21/17) Circulated hole with mud 10-4147'. Spotted 25 sx class C cmt @ 272'. Spotted 50 sx class C cmt @ 465' & 10-4147'. Dug out cellar. Cut off well
13. Describe proposed or complet of starting any proposed work proposed completion or recon 03/17/17 MIRU Plugging eq BOP. POH w/ 2 3/8 tbg. RII laden fluid. Pressure tested 2850-2597'. WOC. Tagged principle circulated to surface. Rigged head. Welded on "Above Go	ed operations. (Clearly state all pertinent details, and). SEE RULE 19.15.7.14 NMAC. For Multiple Completion.  uipment, unset pump. POH w/ rods & pump. 03/21 w/ guage ring to 4500'. POH. Set 5 1/2 CIBP @ csg, held 500 psi. Spotted 25 sx class C cmt @ 4400 plug @ 2595'. Spotted 25 sx class C cmt @ 1525-12 d down and moved off. 03/23/17 Moved in backho round Dry Hole Marker". Backfilled cellar. Cut of	20/17 Dug out cellar, ND well head, NU 4400' (03/21/17) Circulated hole with mud 10-4147'. Spotted 25 sx class C cmt @ 272'. Spotted 50 sx class C cmt @ 465' & 10-4147'. Dug out cellar. Cut off well
13. Describe proposed or complet of starting any proposed work proposed completion or recon 03/17/17 MIRU Plugging eq BOP. POH w/ 2 3/8 tbg. RII laden fluid. Pressure tested 2850-2597'. WOC. Tagged principle circulated to surface. Rigged	ed operations. (Clearly state all pertinent details, and). SEE RULE 19.15.7.14 NMAC. For Multiple Completion.  uipment, unset pump. POH w/ rods & pump. 03/2 H w/ guage ring to 4500'. POH. Set 5 1/2 CIBP @ csg, held 500 psi. Spotted 25 sx class C cmt @ 440 olug @ 2595'. Spotted 25 sx class C cmt @ 1525-12 d down and moved off. 03/23/17 Moved in backho	20/17 Dug out cellar, ND well head, NU 4400' (03/21/17) Circulated hole with mud 10-4147'. Spotted 25 sx class C cmt @ 272'. Spotted 50 sx class C cmt @ 465' & 10-4147'. Dug out cellar. Cut off well
13. Describe proposed or complet of starting any proposed work proposed completion or recon 03/17/17 MIRU Plugging eq BOP. POH w/ 2 3/8 tbg. RII laden fluid. Pressure tested 2850-2597'. WOC. Tagged principle circulated to surface. Rigged head. Welded on "Above Go	ed operations. (Clearly state all pertinent details, and). SEE RULE 19.15.7.14 NMAC. For Multiple Completion.  uipment, unset pump. POH w/ rods & pump. 03/21 w/ guage ring to 4500'. POH. Set 5 1/2 CIBP @ csg, held 500 psi. Spotted 25 sx class C cmt @ 4400 plug @ 2595'. Spotted 25 sx class C cmt @ 1525-12 d down and moved off. 03/23/17 Moved in backho round Dry Hole Marker". Backfilled cellar. Cut of	20/17 Dug out cellar, ND well head, NU 4400' (03/21/17) Circulated hole with mud 10-4147'. Spotted 25 sx class C cmt @ 272'. Spotted 50 sx class C cmt @ 465' & 10-4147'. Dug out cellar. Cut off well
13. Describe proposed or complet of starting any proposed work proposed completion or recon 03/17/17 MIRU Plugging eq BOP. POH w/ 2 3/8 tbg. RII laden fluid. Pressure tested 2850-2597'. WOC. Tagged priculated to surface. Rigger head. Welded on "Above Gotton Date:	ed operations. (Clearly state all pertinent details, and). SEE RULE 19.15.7.14 NMAC. For Multiple Completion.  uipment, unset pump. POH w/ rods & pump. 03/2 Hw/ guage ring to 4500'. POH. Set 5 1/2 CIBP @ csg, held 500 psi. Spotted 25 sx class C cmt @ 440 polug @ 2595'. Spotted 25 sx class C cmt @ 1525-12 d down and moved off. 03/23/17 Moved in backho round Dry Hole Marker''. Backfilled cellar. Cut of Right Release Date:	mpletions: Attach wellbore diagram of 20/17 Dug out cellar, ND well head, NU 4400' (03/21/17) Circulated hole with mud 10-4147'. Spotted 25 sx class C cmt @ 272'. Spotted 50 sx class C cmt @ 465' & 10-4147'. Dug out cellar. Cut off well 10-4147'. Spotted 50 sx class C cmt @ 65'.
13. Describe proposed or complet of starting any proposed work proposed completion or recon 03/17/17 MIRU Plugging eq BOP. POH w/ 2 3/8 tbg. RII laden fluid. Pressure tested 2850-2597'. WOC. Tagged priculated to surface. Rigger head. Welded on "Above Gotton Date:	ed operations. (Clearly state all pertinent details, and). SEE RULE 19.15.7.14 NMAC. For Multiple Completion.  uipment, unset pump. POH w/ rods & pump. 03/21 w/ guage ring to 4500'. POH. Set 5 1/2 CIBP @ csg, held 500 psi. Spotted 25 sx class C cmt @ 4400 plug @ 2595'. Spotted 25 sx class C cmt @ 1525-12 d down and moved off. 03/23/17 Moved in backho round Dry Hole Marker". Backfilled cellar. Cut of	mpletions: Attach wellbore diagram of 20/17 Dug out cellar, ND well head, NU 4400' (03/21/17) Circulated hole with mud 10-4147'. Spotted 25 sx class C cmt @ 272'. Spotted 50 sx class C cmt @ 465' & 10-4147'. Dug out cellar. Cut off well 10-4147'. Spotted 50 sx class C cmt @ 65'.
13. Describe proposed or complet of starting any proposed work proposed completion or recon 03/17/17 MIRU Plugging eq BOP. POH w/ 2 3/8 tbg. RII laden fluid. Pressure tested 2850-2597'. WOC. Tagged priculated to surface. Rigger head. Welded on "Above Gotton Date:	ed operations. (Clearly state all pertinent details, and). SEE RULE 19.15.7.14 NMAC. For Multiple Completion.  uipment, unset pump. POH w/ rods & pump. 03/2 Hw/ guage ring to 4500'. POH. Set 5 1/2 CIBP @ csg, held 500 psi. Spotted 25 sx class C cmt @ 440 polug @ 2595'. Spotted 25 sx class C cmt @ 1525-12 d down and moved off. 03/23/17 Moved in backho round Dry Hole Marker''. Backfilled cellar. Cut of Right Release Date:	mpletions: Attach wellbore diagram of 20/17 Dug out cellar, ND well head, NU 4400' (03/21/17) Circulated hole with mud 10-4147'. Spotted 25 sx class C cmt @ 272'. Spotted 50 sx class C cmt @ 465' & 10-4147'. Dug out cellar. Cut off well 10-4147'. Spotted 50 sx class C cmt @ 65'.
13. Describe proposed or complet of starting any proposed work proposed completion or recon 03/17/17 MIRU Plugging eq BOP. POH w/ 2 3/8 tbg. RII laden fluid. Pressure tested 2850-2597'. WOC. Tagged perculated to surface. Rigged head. Welded on "Above Gotto Date:	ed operations. (Clearly state all pertinent details, and). SEE RULE 19.15.7.14 NMAC. For Multiple Completion.  uipment, unset pump. POH w/ rods & pump. 03/2 Hw/guage ring to 4500'. POH. Set 5 1/2 CIBP @ csg, held 500 psi. Spotted 25 sx class C cmt @ 440 plug @ 2595'. Spotted 25 sx class C cmt @ 1525-12 d down and moved off. 03/23/17 Moved in backho round Dry Hole Marker''. Backfilled cellar. Cut of the complete to the best of my knowledge.	mpletions: Attach wellbore diagram of  20/17 Dug out cellar, ND well head, NU 4400' (03/21/17) Circulated hole with mud 00-4147'. Spotted 25 sx class C cmt @ 272'. Spotted 50 sx class C cmt @ 465' & oe and welder. Dug out cellar. Cut off well off deadmen. Cleaned location, moved off.
13. Describe proposed or complet of starting any proposed work proposed completion or recon 03/17/17 MIRU Plugging eq BOP. POH w/ 2 3/8 tbg. RII laden fluid. Pressure tested 2850-2597'. WOC. Tagged priculated to surface. Rigger head. Welded on "Above Gotton Date:	ed operations. (Clearly state all pertinent details, and). SEE RULE 19.15.7.14 NMAC. For Multiple Completion.  uipment, unset pump. POH w/ rods & pump. 03/2 H w/ guage ring to 4500'. POH. Set 5 1/2 CIBP @ csg, held 500 psi. Spotted 25 sx class C cmt @ 440 polug @ 2595'. Spotted 25 sx class C cmt @ 1525-12 d down and moved off. 03/23/17 Moved in backho round Dry Hole Marker''. Backfilled cellar. Cut of the complete to the best of my knowledge.  Rig Release Date:	mpletions: Attach wellbore diagram of  20/17 Dug out cellar, ND well head, NU 4400' (03/21/17) Circulated hole with mud 10-4147'. Spotted 25 sx class C cmt @ 272'. Spotted 50 sx class C cmt @ 465' & 10-4147'. Spotted 50 sx class C cmt @ 465' & 10
13. Describe proposed or complet of starting any proposed work proposed completion or recon 03/17/17 MIRU Plugging eq BOP. POH w/ 2 3/8 tbg. RII laden fluid. Pressure tested 2850-2597'. WOC. Tagged princulated to surface. Rigged head. Welded on "Above Gotto Date:  I hereby certify that the information above Signature 1.5 p. 1.2 p	ed operations. (Clearly state all pertinent details, and). SEE RULE 19.15.7.14 NMAC. For Multiple Completion.  uipment, unset pump. POH w/ rods & pump. 03/2 H w/ guage ring to 4500'. POH. Set 5 1/2 CIBP @ csg, held 500 psi. Spotted 25 sx class C cmt @ 440 polug @ 2595'. Spotted 25 sx class C cmt @ 1525-12 d down and moved off. 03/23/17 Moved in backho round Dry Hole Marker''. Backfilled cellar. Cut of the complete to the best of my knowledge.  Rig Release Date:	mpletions: Attach wellbore diagram of  20/17 Dug out cellar, ND well head, NU 4400' (03/21/17) Circulated hole with mud 10-4147'. Spotted 25 sx class C cmt @ 272'. Spotted 50 sx class C cmt @ 465' & 10-4147'. Spotted 50 sx class C cmt @ 465' & 10
13. Describe proposed or complete of starting any proposed work proposed completion or recomposed complete on the starting any proposed work proposed work proposed complete on the starting any proposed work proposed work proposed work proposed work proposed complete on the starting any proposed work proposed work proposed work proposed complete on the starting any proposed work proposed work proposed work proposed complete on the starting and starting any proposed work pro	ed operations. (Clearly state all pertinent details, and). SEE RULE 19.15.7.14 NMAC. For Multiple Completion.  uipment, unset pump. POH w/ rods & pump. 03/2 H w/ guage ring to 4500'. POH. Set 5 1/2 CIBP @ csg, held 500 psi. Spotted 25 sx class C cmt @ 440 polug @ 2595'. Spotted 25 sx class C cmt @ 1525-12 d down and moved off. 03/23/17 Moved in backho round Dry Hole Marker''. Backfilled cellar. Cut of the complete to the best of my knowledge.  Rig Release Date:	mpletions: Attach wellbore diagram of  20/17 Dug out cellar, ND well head, NU 4400' (03/21/17) Circulated hole with mud 00-4147'. Spotted 25 sx class C cmt @ 272'. Spotted 50 sx class C cmt @ 465' & oe and welder. Dug out cellar. Cut off well off deadmen. Cleaned location, moved off.
13. Describe proposed or complet of starting any proposed work proposed completion or recon 03/17/17 MIRU Plugging eq BOP. POH w/ 2 3/8 tbg. RII laden fluid. Pressure tested 2850-2597'. WOC. Tagged princulated to surface. Rigged head. Welded on "Above Gotto Date:  I hereby certify that the information above Signature 1.5 p. 1.2 p	Rig Release Date:  Rig Release Date:  Rig Release Date:  E-mail address:  Clearly state all pertinent details, and a SEE RULE 19.15.7.14 NMAC. For Multiple Completion.  Wipment, unset pump. POH w/ rods & pump. 03/21 w/ guage ring to 4500'. POH. Set 5 1/2 CIBP @ csg, held 500 psi. Spotted 25 sx class C cmt @ 440 polug @ 2595'. Spotted 25 sx class C cmt @ 1525-12 down and moved off. 03/23/17 Moved in backhoround Dry Hole Marker''. Backfilled cellar. Cut of the complete to the best of my knowledge.  TITLE Law Pay Latery A. E-mail address: Kashilogco.	mpletions: Attach wellbore diagram of  20/17 Dug out cellar, ND well head, NU 4400' (03/21/17) Circulated hole with mud 10-4147'. Spotted 25 sx class C cmt @ 272'. Spotted 50 sx class C cmt @ 465' & 10-4147'. Spotted 50 sx class C cmt @ 10-4147'. Spotted 50 sx
13. Describe proposed or complete of starting any proposed work proposed completion or recomposed complete on the starting any proposed work proposed work proposed complete on the starting any proposed work proposed work proposed work proposed work proposed complete on the starting any proposed work proposed work proposed work proposed complete on the starting any proposed work proposed work proposed work proposed complete on the starting and starting any proposed work pro	ed operations. (Clearly state all pertinent details, and). SEE RULE 19.15.7.14 NMAC. For Multiple Completion.  uipment, unset pump. POH w/ rods & pump. 03/2 H w/ guage ring to 4500'. POH. Set 5 1/2 CIBP @ csg, held 500 psi. Spotted 25 sx class C cmt @ 440 polug @ 2595'. Spotted 25 sx class C cmt @ 1525-12 d down and moved off. 03/23/17 Moved in backho round Dry Hole Marker''. Backfilled cellar. Cut of the complete to the best of my knowledge.  Rig Release Date:	mpletions: Attach wellbore diagram of  20/17 Dug out cellar, ND well head, NU 4400' (03/21/17) Circulated hole with mud 10-4147'. Spotted 25 sx class C cmt @ 272'. Spotted 50 sx class C cmt @ 465' & 10-4147'. Spotted 50 sx class C cmt @ 465' & 10