	Submit 1 Copy To Appropriate District Office	State of New Mexico				Form C-103			
	Energy Minerals and Notural Passurass					Revised August 1, 2011 WELL API NO.			
	1625 N. French Dr., Hobbs, NM 88240 District II – (575) 748-1283	5 000				30-025-29002).		/
	District II – (575) 393-6161 1625 N. French Dr., Hobbs, NM 88240 District II – (575) 748-1283 811 S. First St., Artesia, NM 88210 District III – (505) 334-6178	OIL CONSERV	ATION .	DIVISIO	N	5. Indicate Ty	pe of Leas		KA
	811 S. First St., Artesia, NM 88210 <u>District III</u> – (505) 334-6178 1000 Rio Brazos Rd., Aztec, NM 87410 SEP District IV – (505) 476-3460	1 2011 220 South	St. Franc	cis Dr.		STATE	(FE	EE X	A STATE OF THE STA
	District IV – (505) 476-3460	Santa Fe	e, NM 87	505		6. State Oil &	Gas Lease	No.	
	1220 S. St. Francis Dr., Santa Fe, NM 87505	EIVED							
	SUNDRY NOTICES	S AND REPORTS ON		0 D 1 0V TO		7. Lease Name	e or Unit A	Agreement Nam	ie
	(DO NOT USE THIS FORM FOR PROPOSALS DIFFERENT RESERVOIR. USE "APPLICATION"				A	R.E. GRAHAN	A "7"		
	PROPOSALS.)	Wall Other			ŀ	8. Well Numb			
	1. Type of Well: Oil Well X Gas	Well Other				001			1
	2. Name of Operator					9. OGRID Nu	mber		,
	3. Address of Operator				-	215099 10. Pool name	or Wildea	nt .	
	600 N. MARIENFELD, SUITE 600, M	IIDLAND, TEXAS 79	9701	,		YOUNG, NOR			
	4. Well Location								
	Unit Letter: I ; 1980	feet from the S	OUTH	line and	660	feet from the	EAST	line	/
	Section 07	Township	18S	Range	32E	NMPM	LEA	County	
	11	1. Elevation (Show wh			GR, etc.)				
			3,785' - D	F					
	12 Charle Ame	nomicato Doveto In	dianta Na	tuma of N	latica I	Domont on Oth	an Data		
	12. Check Appl	ropriate Box to Inc	dicate Na	ture of N	otice, i	Report or Oth	er Data		
r	pproved for Plugging of wellbore only	v. Liability	1		BS	SEQUENT F	REPORT	OF:	
ın	nder bond is retained pending restora	ation and	NT TO P	۸)RK	_		RING CASING	
0	ompletion of the C-103, Specific for S	unsequent	P&A NR	$\overline{}$		LING OPNS.	PAND	A	X
\ (eport of Well Plugging, which may be se OCD web page under forms.		P&AR	, , , ,	=141	30B			
38	estoration Due By <u>B-28-2018</u>		- A		-				
	VIIILIN.					UGGED AND A			1-4-
	13. Describe proposed or completed	operations. (Clearly	state all pe	ertinent dei	aiis, and	give pertinent of	iates, inclu	iding estimated	date
		SEE RULE 19 15 7	14 NMAC		inle Com				
	of starting any proposed work). proposed completion or recomp		.14 NMAC.		iple Com				
	of starting any proposed work). proposed completion or recomp	letion.		For Mult		pletions: Attac	h wellbore	e diagram of	
	of starting any proposed work). proposed completion or recomp 08/22/17: SET 5-1/2" CIBP @ 8,300	oletion. 0'; CIRC. WELL W/	M.L.F.; PR	For Mult		pletions: Attac	h wellbore	e diagram of	
	of starting any proposed work). proposed completion or recomp 08/22/17: SET 5-1/2" CIBP @ 8,300 CMT. @ 8,300'-8,120'; Pl	oletion. 0'; CIRC. WELL W/1 UMP 25 SXS. CMT.	M.L.F.; PR @ 6,301'-6	For Multi ES. TEST 5,141'.	CSG. TO	o 700# - HELD	h wellbore	e diagram of	
	of starting any proposed work). proposed completion or recomp 08/22/17: SET 5-1/2" CIBP @ 8,300	oletion. 0'; CIRC. WELL W/ I UMP 25 SXS. CMT. ,698'; ATTEMPT TC D); WOC X TAG CM	M.L.F.; PR @ 6,301'-6 D EST. INJ MT. @ 4,70	For Multi ES. TEST 5,141'. RATE – F 0'; PERF.	CSG. TO PRES. UI X SQZ.	O 700# - HELD P TO 700# X H 50 SXS. CMT.	h wellbore OK; PUM	e diagram of MP 25 SXS. MP 40 SXS.	
	of starting any proposed work). proposed completion or recomp 08/22/17: SET 5-1/2" CIBP @ 8,300	oletion. O'; CIRC. WELL W/ I UMP 25 SXS. CMT. ,698'; ATTEMPT TC D); WOC X TAG CM K'D BY OCD); CUT I	M.L.F.; PR @ 6,301'-6 D EST. INJ MT. @ 4,70 X PULL 5-	ES. TEST 5,141'. RATE – HO'; PERF1/2" CSG.	CSG. TO PRES. UI X SQZ. @ 2,650	O 700# - HELD P TO 700# X H 50 SXS. CMT. O'.	OK; PUMOLD; PUM@ 4,700';	e diagram of MP 25 SXS. MP 40 SXS. WOC.	
	of starting any proposed work). proposed completion or recomp 08/22/17: SET 5-1/2" CIBP @ 8,300	oletion. O'; CIRC. WELL W/ I UMP 25 SXS. CMT. ,698'; ATTEMPT TC D); WOC X TAG CM K'D BY OCD); CUT I 2,700'; WOC X TAG	M.L.F.; PR @ 6,301'-6 D EST. INJ. MT. @ 4,70 X PULL 5- G CMT. @ 2	ES. TEST 5,141'. RATE – HO'; PERF1/2" CSG. 2,637'; PU	CSG. TO PRES. UI X SQZ. @ 2,650 MP 55 S	O 700# - HELD P TO 700# X H 50 SXS. CMT. O'.	OK; PUMOLD; PUM@ 4,700';	e diagram of MP 25 SXS. MP 40 SXS. WOC. R OCD); WOC.	
	of starting any proposed work). proposed completion or recomp 08/22/17: SET 5-1/2" CIBP @ 8,300	oletion. O'; CIRC. WELL W/1 UMP 25 SXS. CMT. ,698'; ATTEMPT TO D); WOC X TAG CM K'D BY OCD); CUT I 2,700'; WOC X TAG IMP 45 SXS. CMT.	M.L.F.; PR @ 6,301'-6 D EST. INJ. MT. @ 4,70 X PULL 5- G CMT. @ 2	ES. TEST 5,141'. RATE – HO'; PERF1/2" CSG. 2,637'; PU	CSG. TO PRES. UI X SQZ. @ 2,650 MP 55 S	O 700# - HELD P TO 700# X H 50 SXS. CMT. O'.	OK; PUMOLD; PUM@ 4,700';	e diagram of MP 25 SXS. MP 40 SXS. WOC. R OCD); WOC.	
	of starting any proposed work). proposed completion or recomp 08/22/17: SET 5-1/2" CIBP @ 8,300	oletion. O'; CIRC. WELL W/ 1 UMP 25 SXS. CMT. ,698'; ATTEMPT TO D); WOC X TAG CM X'D BY OCD); CUT 1 2,700'; WOC X TAG MP 45 SXS. CMT. @ /OC.	M.L.F.; PR @ 6,301'-6 D EST. INJ MT. @ 4,70 X PULL 5- G CMT. @ 2 @ 1,705'; W	For Mult ES. TEST 5,141'. RATE – H 0'; PERF1/2" CSG. 2,637'; PU /OC X TA	CSG. TO PRES. UI X SQZ. @ 2,650 MP 55 S G CMT.	P TO 700# A HELD P TO 700# X H 50 SXS. CMT. O'. SXS. CMT. @ 2. @ 1,580' (OK'	OK; PUM OLD; PUM @ 4,700'; 637' (PER D BY OC	e diagram of MP 25 SXS. MP 40 SXS. WOC. R OCD); WOC. D); PUMP	
	of starting any proposed work). proposed completion or recomp 08/22/17: SET 5-1/2" CIBP @ 8,300	oletion. O'; CIRC. WELL W/ 1 UMP 25 SXS. CMT. ,698'; ATTEMPT TO D); WOC X TAG CM X'D BY OCD); CUT 1 2,700'; WOC X TAG MP 45 SXS. CMT. @ /OC.	M.L.F.; PR @ 6,301'-6 D EST. INJ MT. @ 4,70 X PULL 5- G CMT. @ 2 @ 1,705'; W	For Mult ES. TEST 5,141'. RATE – H 0'; PERF1/2" CSG. 2,637'; PU /OC X TA	CSG. TO PRES. UI X SQZ. @ 2,650 MP 55 S G CMT.	P TO 700# A HELD P TO 700# X H 50 SXS. CMT. O'. SXS. CMT. @ 2. @ 1,580' (OK'	OK; PUM OLD; PUM @ 4,700'; 637' (PER D BY OC	e diagram of MP 25 SXS. MP 40 SXS. WOC. R OCD); WOC. D); PUMP	
	of starting any proposed work). proposed completion or recomp 08/22/17: SET 5-1/2" CIBP @ 8,300	oletion. O'; CIRC. WELL W/ 1 UMP 25 SXS. CMT. ,698'; ATTEMPT TO D); WOC X TAG CM X'D BY OCD); CUT 1 2,700'; WOC X TAG MP 45 SXS. CMT. @ /OC.	M.L.F.; PR @ 6,301'-6 D EST. INJ MT. @ 4,70 X PULL 5- G CMT. @ 2 @ 1,705'; W	For Mult ES. TEST 5,141'. RATE – H 0'; PERF1/2" CSG. 2,637'; PU /OC X TA	CSG. TO PRES. UI X SQZ. @ 2,650 MP 55 S G CMT.	P TO 700# A HELD P TO 700# X H 50 SXS. CMT. O'. SXS. CMT. @ 2. @ 1,580' (OK'	OK; PUM OLD; PUM @ 4,700'; 637' (PER D BY OC	e diagram of MP 25 SXS. MP 40 SXS. WOC. R OCD); WOC. D); PUMP	
	of starting any proposed work). proposed completion or recomp 08/22/17: SET 5-1/2" CIBP @ 8,300	oletion. O'; CIRC. WELL W/ 1 UMP 25 SXS. CMT. ,698'; ATTEMPT TO D); WOC X TAG CM X'D BY OCD); CUT 1 2,700'; WOC X TAG MP 45 SXS. CMT. @ /OC.	M.L.F.; PR @ 6,301'-6 D EST. INJ MT. @ 4,70 X PULL 5- G CMT. @ 2 @ 1,705'; W	For Mult ES. TEST 5,141'. RATE – H 0'; PERF1/2" CSG. 2,637'; PU /OC X TA	CSG. TO PRES. UI X SQZ. @ 2,650 MP 55 S G CMT.	P TO 700# A HELD P TO 700# X H 50 SXS. CMT. O'. SXS. CMT. @ 2 @ 1,580' (OK' CUT OFF WEL Y HOLE MARK	OK; PUM OLD; PUM @ 4,700'; 637' (PER D BY OC	e diagram of MP 25 SXS. MP 40 SXS. WOC. R OCD); WOC. D); PUMP	
	of starting any proposed work). proposed completion or recomp 08/22/17: SET 5-1/2" CIBP @ 8,300	oletion. O'; CIRC. WELL W/ 1 UMP 25 SXS. CMT. ,698'; ATTEMPT TO D); WOC X TAG CM X'D BY OCD); CUT 1 2,700'; WOC X TAG MP 45 SXS. CMT. @ /OC.	M.L.F.; PR @ 6,301'-6 D EST. INJ MT. @ 4,70 X PULL 5- G CMT. @ 2 @ 1,705'; W	For Mult ES. TEST 5,141'. RATE – H 0'; PERF1/2" CSG. 2,637'; PU /OC X TA	CSG. TO PRES. UI X SQZ. @ 2,650 MP 55 S G CMT.	P TO 700# A HELD P TO 700# X H 50 SXS. CMT. O'. SXS. CMT. @ 2. @ 1,580' (OK'	OK; PUM OLD; PUM @ 4,700'; 637' (PER D BY OC	e diagram of MP 25 SXS. MP 40 SXS. WOC. R OCD); WOC. D); PUMP	
	of starting any proposed work). proposed completion or recomp 08/22/17: SET 5-1/2" CIBP @ 8,300	oletion. O'; CIRC. WELL W/ 1 UMP 25 SXS. CMT. ,698'; ATTEMPT TO D); WOC X TAG CM X'D BY OCD); CUT 1 2,700'; WOC X TAG MP 45 SXS. CMT. @ /OC.	M.L.F.; PR @ 6,301'-6 D EST. INJ MT. @ 4,70 X PULL 5- G CMT. @ 2 @ 1,705'; W	For Mult ES. TEST 5,141'. RATE – H 0'; PERF1/2" CSG. 2,637'; PU /OC X TA	CSG. TO PRES. UI X SQZ. @ 2,650 MP 55 S G CMT.	P TO 700# A HELD P TO 700# X H 50 SXS. CMT. O'. SXS. CMT. @ 2 @ 1,580' (OK' CUT OFF WEL Y HOLE MARK	OK; PUM OLD; PUM @ 4,700'; 637' (PER D BY OC	e diagram of MP 25 SXS. MP 40 SXS. WOC. R OCD); WOC. D); PUMP	
	of starting any proposed work). proposed completion or recomp 08/22/17: SET 5-1/2" CIBP @ 8,300	oletion. O'; CIRC. WELL W/ 1 UMP 25 SXS. CMT. ,698'; ATTEMPT TO D); WOC X TAG CM X'D BY OCD); CUT 1 2,700'; WOC X TAG MP 45 SXS. CMT. @ /OC.	M.L.F.; PR @ 6,301'-6 D EST. INJ MT. @ 4,70 X PULL 5- G CMT. @ 2 @ 1,705'; W	For Mult ES. TEST 5,141'. RATE – H 0'; PERF1/2" CSG. 2,637'; PU /OC X TA	CSG. TO PRES. UI X SQZ. @ 2,650 MP 55 S G CMT.	P TO 700# A HELD P TO 700# X H 50 SXS. CMT. O'. SXS. CMT. @ 2 @ 1,580' (OK' CUT OFF WEL Y HOLE MARK	OK; PUM OLD; PUM @ 4,700'; 637' (PER D BY OC	e diagram of MP 25 SXS. MP 40 SXS. WOC. R OCD); WOC. D); PUMP	
	of starting any proposed work). proposed completion or recomp 08/22/17: SET 5-1/2" CIBP @ 8,300	oletion. O'; CIRC. WELL W/ I UMP 25 SXS. CMT. ,698'; ATTEMPT TC D); WOC X TAG CM (A'D BY OCD); CUT I 2,700'; WOC X TAG IMP 45 SXS. CMT. (A'OC. IX CIRC. 20 SXS. CM TE TO CSGS. X INST	M.L.F.; PR @ 6,301'-6 D EST. INJ. MT. @ 4,70 X PULL 5-6 G CMT. @ 2 @ 1,705'; W MT. @ 100 FALL GRO	For Mult ES. TEST 5,141'. RATE – H 0'; PERF. -1/2" CSG. 2,637'; PU /OC X TA '-3'; DIG (UND LEV	CSG. TO PRES. UI X SQZ. @ 2,650 MP 55 S G CMT. OUT X O	D 700# - HELD P TO 700# X H 50 SXS. CMT. O'. SXS. CMT. @ 2. @ 1,580' (OK' CUT OFF WEL Y HOLE MARK	OK; PUM OLD; PUM @ 4,700'; 637' (PER D BY OC	e diagram of MP 25 SXS. MP 40 SXS. WOC. R OCD); WOC. D); PUMP	
	of starting any proposed work). proposed completion or recomp 08/22/17: SET 5-1/2" CIBP @ 8,300	oletion. O'; CIRC. WELL W/ I UMP 25 SXS. CMT. ,698'; ATTEMPT TC D); WOC X TAG CM (A'D BY OCD); CUT I 2,700'; WOC X TAG IMP 45 SXS. CMT. (A'OC. IX CIRC. 20 SXS. CM TE TO CSGS. X INST	M.L.F.; PR @ 6,301'-6 D EST. INJ. MT. @ 4,70 X PULL 5-6 G CMT. @ 2 @ 1,705'; W MT. @ 100 FALL GRO	For Mult ES. TEST 5,141'. RATE – H 0'; PERF. -1/2" CSG. 2,637'; PU /OC X TA '-3'; DIG (UND LEV	CSG. TO PRES. UI X SQZ. @ 2,650 MP 55 S G CMT. OUT X O	D 700# - HELD P TO 700# X H 50 SXS. CMT. O'. SXS. CMT. @ 2. @ 1,580' (OK' CUT OFF WEL Y HOLE MARK	OK; PUM OLD; PUM @ 4,700'; 637' (PER D BY OC	e diagram of MP 25 SXS. MP 40 SXS. WOC. R OCD); WOC. D); PUMP	
	of starting any proposed work). proposed completion or recomp 08/22/17: SET 5-1/2" CIBP @ 8,300	oletion. O'; CIRC. WELL W/ UMP 25 SXS. CMT. ,698'; ATTEMPT TO D); WOC X TAG CM X'D BY OCD); CUT 2,700'; WOC X TAG UMP 45 SXS. CMT. @ YOC. XX CIRC. 20 SXS. CM TE TO CSGS. X INST	M.L.F.; PR @ 6,301'-6 D EST. INJ. MT. @ 4,70 X PULL 5-6 G CMT. @ 2 @ 1,705'; W MT. @ 100 FALL GRO	ES. TEST 5,141'. RATE – HO'; PERF. 1/2" CSG. 2,637'; PU /OC X TA '-3'; DIG O UND LEV	CSG. TO PRES. UI X SQZ. @ 2,650 MP 55 S G CMT. OUT X O	P TO 700# A HELD P TO 700# X H 50 SXS. CMT. O'. SXS. CMT. @ 2 @ 1,580' (OK' CUT OFF WEL Y HOLE MARK	h wellbore OK; PUM OLD; PUN @ 4,700'; 637' (PER D BY OC LHEAD 3 CER.	e diagram of MP 25 SXS. MP 40 SXS. WOC. R OCD); WOC. D); PUMP ' B.G.L.;	
	of starting any proposed work). proposed completion or recomp 08/22/17: SET 5-1/2" CIBP @ 8,300	oletion. O'; CIRC. WELL W/ UMP 25 SXS. CMT. ,698'; ATTEMPT TO D); WOC X TAG CM X'D BY OCD); CUT 2,700'; WOC X TAG UMP 45 SXS. CMT. @ YOC. X CIRC. 20 SXS. CM TE TO CSGS. X INST	M.L.F.; PR @ 6,301'-6 D EST. INJ. MT. @ 4,70 X PULL 5- G CMT. @ 2 @ 1,705'; W MT. @ 100 FALL GRO	For Mult ES. TEST 6,141'. RATE – I 0'; PERF. 1/2" CSG. 2,637'; PU /OC X TA '-3'; DIG 0 UND LEV	CSG. TO PRES. UI X SQZ. @ 2,650 MP 55 S G CMT. OUT X O FEL DRY	P TO 700# X H 50 SXS. CMT. O'. EXS. CMT. @ 2 @ 1,580' (OK') CUT OFF WELLY HOLE MARK	OK; PUM OLD; PUM @ 4,700'; ,637' (PEF D BY OC LHEAD 3 XER.	e diagram of AP 25 SXS. MP 40 SXS. WOC. R OCD); WOC. D); PUMP B.G.L.;	
	of starting any proposed work). proposed completion or recomp 08/22/17: SET 5-1/2" CIBP @ 8,300	oletion. O'; CIRC. WELL W/ UMP 25 SXS. CMT. ,698'; ATTEMPT TO D); WOC X TAG CM X'D BY OCD); CUT 2,700'; WOC X TAG UMP 45 SXS. CMT. @ YOC. X CIRC. 20 SXS. CM TE TO CSGS. X INST	M.L.F.; PR @ 6,301'-6 D EST. INJ. MT. @ 4,70 X PULL 5- G CMT. @ 2 @ 1,705'; W MT. @ 100 FALL GRO	For Mult ES. TEST 6,141'. RATE – I 0'; PERF. 1/2" CSG. 2,637'; PU /OC X TA '-3'; DIG 0 UND LEV	CSG. TO PRES. UI X SQZ. @ 2,650 MP 55 S G CMT. OUT X O FEL DRY	P TO 700# X H 50 SXS. CMT. 0'. SXS. CMT. @ 2. @ 1,580' (OK' CUT OFF WEL Y HOLE MARK	OK; PUM OLD; PUM @ 4,700'; ,637' (PEF D BY OC LHEAD 3 XER.	e diagram of MP 25 SXS. MP 40 SXS. WOC. R OCD); WOC. D); PUMP ' B.G.L.;	
	of starting any proposed work). proposed completion or recomp 08/22/17: SET 5-1/2" CIBP @ 8,300	oletion. O'; CIRC. WELL W/ I UMP 25 SXS. CMT. ,698'; ATTEMPT TO D); WOC X TAG CM ('D BY OCD); CUT I 2,700'; WOC X TAG IMP 45 SXS. CMT. (a) INCOC. IX CIRC. 20 SXS. CM TE TO CSGS. X INST	M.L.F.; PR @ 6,301'-6 D EST. INJ. MT. @ 4,70 X PULL 5-6 G CMT. @ 2 @ 1,705'; W MT. @ 100 TALL GRO te to the bes LE: A ldress: DEY	For Mult ES. TEST 5,141'. RATE – H 0'; PERF1/2" CSG. 2,637'; PU /OC X TA '-3'; DIG 0 UND LEV	CSG. TO PRES. UI X SQZ. @ 2,650 MP 55 S G CMT. OUT X O FEL DRY	P TO 700# A HELD P TO 700# X H 50 SXS. CMT. O'. SXS. CMT. @ 2. @ 1,580' (OK' CUT OFF WEL Y HOLE MARK MO: 08/29/17	DATE: 0 PHONE: 4	e diagram of MP 25 SXS. MP 40 SXS. WOC. R OCD); WOC. D); PUMP B.G.L.; 8/29/17	
	of starting any proposed work). proposed completion or recomp 08/22/17: SET 5-1/2" CIBP @ 8,300	oletion. O'; CIRC. WELL W/ I UMP 25 SXS. CMT. ,698'; ATTEMPT TO D); WOC X TAG CM ('D BY OCD); CUT I 2,700'; WOC X TAG IMP 45 SXS. CMT. (a) INCOC. IX CIRC. 20 SXS. CM TE TO CSGS. X INST	M.L.F.; PR @ 6,301'-6 D EST. INJ. MT. @ 4,70 X PULL 5- G CMT. @ 2 @ 1,705'; W MT. @ 100 FALL GRO	For Mult ES. TEST 5,141'. RATE – H 0'; PERF1/2" CSG. 2,637'; PU /OC X TA '-3'; DIG 0 UND LEV	CSG. TO PRES. UI X SQZ. @ 2,650 MP 55 S G CMT. OUT X O FEL DRY	P TO 700# A HELD P TO 700# X H 50 SXS. CMT. O'. SXS. CMT. @ 2. @ 1,580' (OK' CUT OFF WEL Y HOLE MARK MO: 08/29/17	OK; PUM OLD; PUM @ 4,700'; ,637' (PEF D BY OC LHEAD 3 XER.	e diagram of MP 25 SXS. MP 40 SXS. WOC. R OCD); WOC. D); PUMP B.G.L.; 8/29/17	7_