Office HOBBS OG Prgy, Minerals and Natural Resources	Form C-103 June 19, 2008
1625 N. French Dr., Hobbs, NM 88240	WELL API NO.
District II 1301 W. Grand Ave., Artesia, FFR88 101 2019 OIL CONSERVATION DIVISION	30-025-22704
District III 1220 South St. Erongia Dr.	5. Indicate Type of Lease STATE 7 FEE
1000 Rio Brazos Rd., Aztec NASTAIO District IV RECEIVED Santa Fe, NM 87505	6. State Oil & Gas Lease No.
1220 S. St. Francis Dr., Santa Fe, NM 87505	o. State off & Gas Lease 110.
SUNDRY NOTICES AND REPORTS ON WELLS	7. Lease Name or Unit Agreement Name
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH	UNA
PROPOSALS.)	
1. Type of Well: Oil Well 🗹 Gas Well 🗌 Other	
2. Name of Operator JAY MANAGEMENT COMPANY, LLC	9. OGRID Number 247692
3. Address of Operator	10. Pool name or Wildcat
1001 WEST LOOP SOUTH, SUITE 750 HOUSTON,TX 77027 4. Well Location	BAGLEY PERMO PENN NORTH
	1980 feet from the EAST line
Section 32 Township 11S Range 33E	NMPM County LEA
11. Elevation (Show whether DR, RKB, RT, GR, etc.)	
4287' GR	
12. Check Appropriate Box to Indicate Nature of Notice,	Report or Other Data
NOTICE OF INTENTION TO: SUB	SEQUENT REPORT OF:
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WOR	
PULL OR ALTER CASING D MULTIPLE COMPL CASING/CEMEN	τ JOB 🗌 ΥΝΚ
OTHER: OTHER:	
13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date	
of starting any proposed work). SEE RULE 1103. For Multiple Completions: At or recompletion.	
of starting any proposed work). SEE RULE 1103. For Multiple Completions: At	
of starting any proposed work). SEE RULE 1103. For Multiple Completions: At or recompletion.	tach wellbore diagram of proposed completion
of starting any proposed work). SEE RULE 1103. For Multiple Completions: At or recompletion. 01/04/2019: Tag CIBP at 5610'. Circulate MLF	tach wellbore diagram of proposed completion
of starting any proposed work). SEE RULE 1103. For Multiple Completions: At or recompletion. 01/04/2019 : Tag CIBP at 5610'. Circulate MLF 01/07/2019 : Perforate at 5600' attempted to squeeze. Call Kerry/OCD for instruction. RIH to 5610' Spot 25 sx class C cement (Per	tach wellbore diagram of proposed completion
of starting any proposed work). SEE RULE 1103. For Multiple Completions: At or recompletion. 01/04/2019 : Tag CIBP at 5610'. Circulate MLF 01/07/2019 : Perforate at 5600' attempted to squeeze. Call Kerry/OCD for instruction. RIH to 5610' Spot 25 sx class C cement (Per Perforate at 3780'. Squeeze 40 sx class C cement. WOC.	tach wellbore diagram of proposed completion
of starting any proposed work). SEE RULE 1103. For Multiple Completions: At or recompletion. 01/04/2019 : Tag CIBP at 5610'. Circulate MLF 01/07/2019 : Perforate at 5600' attempted to squeeze. Call Kerry/OCD for instruction. RIH to 5610' Spot 25 sx class C cement (Per Perforate at 3780'. Squeeze 40 sx class C cement. WOC. 01/08/2019 : Tag @ 3582'. Perforate @ 2398'. Squeeze 40 sx class C cement. WOC.	tach wellbore diagram of proposed completion
of starting any proposed work). SEE RULE 1103. For Multiple Completions: At or recompletion. 01/04/2019 : Tag CIBP at 5610'. Circulate MLF 01/07/2019 : Perforate at 5600' attempted to squeeze. Call Kerry/OCD for instruction. RIH to 5610' Spot 25 sx class C cement (Per Perforate at 3780'. Squeeze 40 sx class C cement. WOC. 01/08/2019 : Tag @ 3582'. Perforate @ 2398'. Squeeze 40 sx class C cement. WOC. 01/09/2019 : Tag @ 2290'. Perforate @ 1666'. Squeeze 40 sx class C cement. WOC. No Tag. Call Kerry/OCD for instruction.	tach wellbore diagram of proposed completion
of starting any proposed work). SEE RULE 1103. For Multiple Completions: At or recompletion. 01/04/2019 : Tag CIBP at 5610'. Circulate MLF 01/07/2019 : Perforate at 5600' attempted to squeeze. Call Kerry/OCD for instruction. RIH to 5610' Spot 25 sx class C cement (Per Perforate at 3780'. Squeeze 40 sx class C cement. WOC. 01/08/2019 : Tag @ 3582'. Perforate @ 2398'. Squeeze 40 sx class C cement. WOC. 01/09/2019 : Tag @ 2290'. Perforate @ 1666'. Squeeze 40 sx class C cement. WOC. No Tag. Call Kerry/OCD for instruction. Squeeze 25 sx class C cement (Per Kerry w/OCD). WOC.	tach wellbore diagram of proposed completion
of starting any proposed work). SEE RULE 1103. For Multiple Completions: At or recompletion. 01/04/2019 : Tag CIBP at 5610'. Circulate MLF 01/07/2019 : Perforate at 5600' attempted to squeeze. Call Kerry/OCD for instruction. RIH to 5610' Spot 25 sx class C cement (Per Perforate at 3780'. Squeeze 40 sx class C cement. WOC. 01/08/2019 : Tag @ 3582'. Perforate @ 2398'. Squeeze 40 sx class C cement. WOC. 01/09/2019 : Tag @ 2290'. Perforate @ 1666'. Squeeze 40 sx class C cement. WOC. No Tag. Call Kerry/OCD for instruction. Squeeze 25 sx class C cement (Per Kerry w/OCD). WOC. 01/10/2019 : Tag @ 1550'. Perforate @ 426'. Circulate 120 sx class C cement to surface.	tach wellbore diagram of proposed completion
of starting any proposed work). SEE RULE 1103. For Multiple Completions: At or recompletion. 01/04/2019 : Tag CIBP at 5610'. Circulate MLF 01/07/2019 : Perforate at 5600' attempted to squeeze. Call Kerry/OCD for instruction. RIH to 5610' Spot 25 sx class C cement (Per Perforate at 3780'. Squeeze 40 sx class C cement. WOC. 01/08/2019 : Tag @ 3582'. Perforate @ 2398'. Squeeze 40 sx class C cement. WOC. 01/09/2019 : Tag @ 2290'. Perforate @ 1666'. Squeeze 40 sx class C cement. WOC. 01/09/2019 : Tag @ 2290'. Perforate @ 1666'. Squeeze 40 sx class C cement. WOC. 01/09/2019 : Tag @ 1550'. Perforate @ 1666'. Squeeze 40 sx class C cement to Surface. 01/10/2019 : Tag @ 1550'. Perforate @ 426'. Circulate 120 sx class C cement to surface. 01/11/2019 : Cut off welfhead 3' below ground level and verify cement to surface. Install dry hole marker.	tach wellbore diagram of proposed completion
of starting any proposed work). SEE RULE 1103. For Multiple Completions: At or recompletion. 01/04/2019 : Tag CIBP at 5610'. Circulate MLF 01/07/2019 : Perforate at 5600' attempted to squeeze. Call Kerry/OCD for instruction. RIH to 5610' Spot 25 sx class C cement (Per Perforate at 3780'. Squeeze 40 sx class C cement. WOC. 01/08/2019 : Tag @ 3582'. Perforate @ 2398'. Squeeze 40 sx class C cement. WOC. 01/09/2019 : Tag @ 2290'. Perforate @ 1666'. Squeeze 40 sx class C cement. WOC. 01/09/2019 : Tag @ 2290'. Perforate @ 1666'. Squeeze 40 sx class C cement. WOC. 01/09/2019 : Tag @ 1550'. Perforate @ 1666'. Squeeze 40 sx class C cement to Surface. 01/10/2019 : Tag @ 1550'. Perforate @ 426'. Circulate 120 sx class C cement to surface. 01/11/2019 : Cut off welfhead 3' below ground level and verify cement to surface. Install dry hole marker.	tach wellbore diagram of proposed completion
of starting any proposed work). SEE RULE 1103. For Multiple Completions: At or recompletion. 01/04/2019 : Tag CIBP at 5610'. Circulate MLF 01/07/2019 : Perforate at 5600' attempted to squeeze. Call Kerry/OCD for instruction. RIH to 5610' Spot 25 sx class C cement (Per Perforate at 3780'. Squeeze 40 sx class C cement. WOC. 01/08/2019 : Tag @ 3582'. Perforate @ 2398'. Squeeze 40 sx class C cement. WOC. 01/09/2019 : Tag @ 2290'. Perforate @ 1666'. Squeeze 40 sx class C cement. WOC. No Tag. Call Kerry/OCD for instruction. Squeeze 25 sx class C cement (Per Kerry w/OCD). WOC. 01/10/2019 : Tag @ 1550'. Perforate @ 426'. Circulate 120 sx class C cement to surface. 01/11/2019 : Cut off wellhead 3' below ground level and verify cement to surface. Install dry hole marker.	tach wellbore diagram of proposed completion
of starting any proposed work). SEE RULE 1103. For Multiple Completions: At or recompletion. 01/04/2019 : Tag CIBP at 5610'. Circulate MLF 01/07/2019 : Perforate at 5600' attempted to squeeze. Call Kerry/OCD for instruction. RIH to 5610' Spot 25 sx class C cement (Per Perforate at 3780'. Squeeze 40 sx class C cement. WOC. 01/08/2019 : Tag @ 3582'. Perforate @ 2398'. Squeeze 40 sx class C cement. WOC. 01/09/2019 : Tag @ 2290'. Perforate @ 1666'. Squeeze 40 sx class C cement. WOC. 01/09/2019 : Tag @ 2290'. Perforate @ 1666'. Squeeze 40 sx class C cement. WOC. No Tag. Call Kerry/OCD for instruction. Squeeze 25 sx class C cement (Per Kerry w/OCD). WOC. 01/10/2019 : Tag @ 1550'. Perforate @ 426'. Circulate 120 sx class C cement to surface. 01/11/2019 : Cut off wellhead 3' below ground level and verify cement to surface. Install dry hole marker. Spud Date: 01/03/2019 Rig Release Date: 01/03/2019	tach wellbore diagram of proposed completion Kerry w/OCD).
of starting any proposed work). SEE RULE 1103. For Multiple Completions: At or recompletion. 01/04/2019 : Tag CIBP at 5610'. Circulate MLF 01/07/2019 : Perforate at 5600' attempted to squeeze. Call Kerry/OCD for instruction. RIH to 5610' Spot 25 sx class C cement (Per Perforate at 3780'. Squeeze 40 sx class C cement. WOC. 01/08/2019 : Tag @ 3582'. Perforate @ 2398'. Squeeze 40 sx class C cement. WOC. 01/09/2019 : Tag @ 2290'. Perforate @ 1666'. Squeeze 40 sx class C cement. WOC. No Tag. Call Kerry/OCD for instruction. Squeeze 25 sx class C cement (Per Kerry w/OCD). WOC. 01/10/2019 : Tag @ 1550'. Perforate @ 426'. Circulate 120 sx class C cement to surface. 01/11/2019 : Cut off wellhead 3' below ground level and verify cement to surface. Install dry hole marker.	tach wellbore diagram of proposed completion Kerry w/OCD).
of starting any proposed work). SEE RULE 1103. For Multiple Completions: At or recompletion. 01/04/2019: Tag CIBP at 5610'. Circulate MLF 01/07/2019: Perforate at 5600' attempted to squeeze. Call Kerry/OCD for instruction. RIH to 5610' Spot 25 sx class C cement (Per Perforate at 3780'. Squeeze 40 sx class C cement. WOC. 01/08/2019: Tag @ 3582'. Perforate @ 2398'. Squeeze 40 sx class C cement. WOC. 01/09/2019: Tag @ 2290'. Perforate @ 1566'. Squeeze 40 sx class C cement. WOC. No Tag. Call Kerry/OCD for instruction. Squeeze 25 sx class C cement (Per Kerry w/OCD). WOC. 01/10/2019: Tag @ 1550'. Perforate @ 426'. Circulate 120 sx class C cement to surface. 01/11/2019: Cut off wellhead 3' below ground level and verify cement to surface. 01/11/2019: Cut off wellhead 3' below ground level and verify cement to surface. Install dry hole marker. Spud Date: 01/03/2019 Rig Release Date: 0'	tach wellbore diagram of proposed completion Kerry w/OCD). 1/10/2019 e and belief.
of starting any proposed work). SEE RULE 1103. For Multiple Completions: At or recompletion. 01/04/2019 : Tag CIBP at 5610'. Circulate MLF 01/07/2019 : Perforate at 5600' attempted to squeeze. Call Kerry/OCD for instruction. RIH to 5610' Spot 25 sx class C cement (Per Perforate at 3780'. Squeeze 40 sx class C cement. WOC. 01/08/2019 : Tag @ 3582'. Perforate @ 2398'. Squeeze 40 sx class C cement. WOC. 01/09/2019 : Tag @ 2290'. Perforate @ 1666'. Squeeze 40 sx class C cement. WOC. 01/09/2019 : Tag @ 2290'. Perforate @ 1666'. Squeeze 40 sx class C cement. WOC. No Tag. Call Kerry/OCD for instruction. Squeeze 25 sx class C cement (Per Kerry w/OCD). WOC. 01/10/2019 : Tag @ 1550'. Perforate @ 426'. Circulate 120 sx class C cement to surface. 01/11/2019 : Cut off wellhead 3' below ground level and verify cement to surface. Install dry hole marker. Spud Date: 01/03/2019 Rig Release Date: 01/03/2019	tach wellbore diagram of proposed completion Kerry w/OCD).
of starting any proposed work). SEE RULE 1103. For Multiple Completions: At or recompletion. 01/04/2019 : Tag ClBP at 5610'. Circulate MLF 01/07/2019 : Perforate at 5600' attempted to squeeze. Call Kerry/OCD for instruction. RIH to 5610' Spot 25 sx class C cement (Per Perforate at 3780'. Squeeze 40 sx class C cement. WOC. 01/08/2019 : Tag @ 3582'. Perforate @ 2398'. Squeeze 40 sx class C cement. WOC. 01/09/2019 : Tag @ 2290'. Perforate @ 1666'. Squeeze 40 sx class C cement. WOC. 01/09/2019 : Tag @ 2290'. Perforate @ 1666'. Squeeze 40 sx class C cement. WOC. 01/10/2019 : Tag @ 2290'. Perforate @ 466'. Squeeze 40 sx class C cement. WOC. 01/10/2019 : Tag @ 1550'. Perforate @ 426'. Circulate 120 sx class C cement to surface. 01/11/2019 : Cat off wellhead 3' below ground level and verify cement to surface. 01/11/2019 : Cat off wellhead 3' below ground level and verify cement to surface. Install dry hole marker. Spud Date: 01/03/2019 T hereby certify that the information above is true and complete to the best of my knowledg SIGNATURE	tach wellbore diagram of proposed completion Kerry w/OCD). I/10/2019 e and belief. DATE_01/30/2019
of starting any proposed work). SEE RULE 1103. For Multiple Completions: At or recompletion. 01/04/2019: Tag CIBP at 5610'. Circulate MLF 01/07/2019: Perforate at 5600' attempted to squeeze. Call Kerry/OCD for instruction. RIH to 5610' Spot 25 sx class C cement (Per Perforate at 3780'. Squeeze 40 sx class C cement. WOC. 01/08/2019: Tag @ 3582'. Perforate @ 2398'. Squeeze 40 sx class C cement. WOC. 01/09/2019: Tag @ 2290'. Perforate @ 1666'. Squeeze 40 sx class C cement. WOC. 01/09/2019: Tag @ 2290'. Perforate @ 1666'. Squeeze 40 sx class C cement. WOC. 01/10/2019: Tag @ 1550'. Perforate @ 1666'. Squeeze 40 sx class C cement. WOC. 01/10/2019: Tag @ 1550'. Perforate @ 426'. Circulate 120 sx class C cement to surface. 01/11/2019: Cut off wellhead 3' below ground level and verify cement to surface. 01/11/2019: Cut off wellhead 3' below ground level and verify cement to surface. 01/11/2019: Cut off wellhead 3' below ground level and verify cement to surface. 01/10/2019: Cut off wellhead 3' below ground level and verify cement to surface. 01/10/2019: Cut off wellhead 3' below ground level and verify cement to surface. 01/10/2019: Cut off wellhead 3' below ground level and verify cement to surface. 01/11/2019: Cut off wellhead 3' below ground level and verify cement to surface. 01/10/2019: Cut off wellhead 3' below ground level and verify cement to surface. 01/10/2019: Cut off wellhead 3' below ground level and verify cement to surface. 01/10/2019: Cut off wellhead 3' below ground level and verify cement to surface. 01/10/2019: Cut off wellhead 3' below ground level and verify cement to surface. 01/10/2019: Cut off wellhead 3' below ground level and verify cement to surface. 01/10/2019: Cut off wellhead 3' below ground level and verify cement to surface. 01/10/2019: Cut off wellhead 3' below ground below group to surface. 01/10/2019: Cut off wellhead 3'	tach wellbore diagram of proposed completion Kerry w/OCD). I/10/2019 e and belief. DATE_01/30/2019
of starting any proposed work). SEE RULE 1103. For Multiple Completions: At or recompletion. 01/04/2019: Tag CIBP at 5610'. Circulate MLF 01/07/2019: Perforate at 5600' attempted to squeeze. Call Kerry/OCD for instruction. RIH to 5610' Spot 25 sx class C cement (Per Perforate at 3780'. Squeeze 40 sx class C cement. WOC. 01/08/2019: Tag @ 3582'. Perforate @ 2398'. Squeeze 40 sx class C cement. WOC. 01/09/2019: Tag @ 3582'. Perforate @ 1666'. Squeeze 40 sx class C cement. WOC. 01/09/2019: Tag @ 1550'. Perforate @ 1666'. Squeeze 40 sx class C cement. WOC. No Tag. Call Kerry/OCD for instruction. Squeeze 25 sx class C cement (Per Kerry w/OCD). WOC. 01/10/2019: Tag @ 1550'. Perforate @ 426'. Circulate 120 sx class C cement to surface. 01/11/2019: Cut off wellhead 3' below ground level and verify cement to surface. 01/11/2019: Cut off wellhead 3' below ground level and verify cement to surface. Install dry hole marker. Spud Date: 01/03/2019 1 hereby certify that the information above is true and complete to the best of my knowledg SIGNATURE	tach wellbore diagram of proposed completion Kerry w/OCD). I/10/2019 e and belief. DATE_01/30/2019 pt.com PHONE: 574-707-5691
of starting any proposed work). SEE RULE 1103. For Multiple Completions: At or recompletion. 01/04/2019: Tag CIBP at 5610'. Circulate MLF 01/07/2019: Perforate at 5600' attempted to squeeze. Call Kerry/OCD for instruction. RIH to 5610' Spot 25 sx class C cement (Per Perforate at 3780'. Squeeze 40 sx class C cement. WOC. 01/08/2019: Tag @ 3582'. Perforate @ 2398'. Squeeze 40 sx class C cement. WOC. 01/09/2019: Tag @ 3582'. Perforate @ 1666'. Squeeze 40 sx class C cement. WOC. 01/09/2019: Tag @ 1550'. Perforate @ 1666'. Squeeze 40 sx class C cement. WOC. No Tag. Call Kerry/OCD for instruction. Squeeze 25 sx class C cement (Per Kerry w/OCD). WOC. 01/10/2019: Tag @ 1550'. Perforate @ 426'. Circulate 120 sx class C cement to surface. 01/11/2019: Cut off wellhead 3' below ground level and verify cement to surface. 01/11/2019: Cut off wellhead 3' below ground level and verify cement to surface. Install dry hole marker. Spud Date: 01/03/2019 1 hereby certify that the information above is true and complete to the best of my knowledg SIGNATURE	tach wellbore diagram of proposed completion Kerry w/OCD). I/10/2019 e and belief. DATE_01/30/2019