

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.
30-025-026895

5. Indicate Type of Lease
STATE ☒ FEE ☐

6. State Oil & Gas Lease No.
L-4945

7. Lease Name or Unit Agreement Name
Saunders 16 State

8. Well No.
1

9. Pool name or Wildcat
Saunders Permo ^{upper} Penn

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. Name of Operator
MWJ Producing Company

3. Address of Operator
400 W. Illinois, Ste. 1100, Midland, TX 79701

4. Well Location
Unit Letter I : 660 Feet From The East Line and 1980 Feet From The South Line
Section 16 Township 14-S Range 33-E NMPM Lea County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)
4211.5' GL

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>		CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1/23/92-MIRU Pride Pulling Unit.
1/24/92-Pulled & LD 74 jts 1".
1/25/92-Pulled & LD; Add'1 164 jts 1", changeover jt, 50 jts 1" IJ, & 1" seal assy. POOH w/212 2-3/8" tbg.
1/27/92-Set CIBP @ 9800'. Dmpd 35 sx cmt. Loaded hole w/125 bbls mud f/5765-5000'. Shot 5-1/2" csg @ 5980', failed to pull.
1/28/92-Shot csg @ 4910'. POOH w/122 jts 5-1/2" csg.
1/29/92-Spt'd 20 sx (w/mud) f/6040-5830', 60 sx plug @ 4937-4701. WOC 4 hrs. Tagged plug @ 4701'. Spt'd 60 sx (w/mud) f/4180-4047'.
1/30/92-Tagged plug @ 4047'. Spt'd 30 sx plug f/465-365. Spt'd 10 sx plug @ surf. Installed dry hole marker. RDMO.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Sabra Fury TITLE Agent DATE 2/17/92
TYPE OR PRINT NAME Sabra Fury TELEPHONE NO. 915/682-5216

(This space for State Use) ORIGINAL SIGNED BY JOHNNY ROBINSON DATE AUG 28 1998
APPROVED BY OIL & GAS INSPECTOR TITLE _____
CONDITIONS OF APPROVAL, IF ANY: _____