Form 3160-5

FORM APPROVED

APTMENT OF THE INTERIOR 103BS, NEW MACHINE BURBAU NO. 1004-0135

Duage, Dan				^
Expires:	March	31,	1993	

	BUREAU (OF LAND MANAGEMENT	Expires: March 31, 1993 5. Lease Designation and Serial No.	
			LC 029410A	
	SUNDRY NOTICE	ES AND REPORTS ON WELLS	6. If Indian, Allottee or Tribe Name	
Oo not use this form f	for proposals to drill or to	deepen or reentry to a different reservoir.		
Use APPLI	ICATION FOR PERMIT f		7. If Unit or CA, Agreement Designation	
	SUBMIT	IN TRIPLICATE		
Type of Well				
X Oil Gas	INJECTION		8. Well Name and No.	
Well Well Name of Operator	Other		MCA Unit	
CONOCO INC.			WELL # 112	
Address and Telephone No	· · · · · · · · · · · · · · · · · · ·			
40 DECTA DD CTE	400M MIDIAND TV 7070	684-6381 05 (915) 686 - 5424	30-025-00752 10. Field and Pool, or Exploratory Area	
_ocation of Well (Footage :	100W, MIDLAND, TX. 7970 Sec., T., R., M., or Survey Description	1)	···-	
, ,	L & 660' 'FEL of Section 29,		Maljamar Grayburg San Andres 11. County or Parish, State	
TD: Same	IL & 000 FEL OF SECTION 29,	:7-0, 522, 6711 25165 71		
			LEA, NM	
CHECK YDDD	ODDIATE BOY(s) TO II	NDICATE NATURE OF NOTICE, REPO	RT. OR OTHER DATA	
CHECK AFFIX	OF NIATE BOX(3) TO II			
TYPE OF S	SUBMISSION	TYPE OF ACT	TION	
Notice of	Intent	X Abandonment P&A	Change of Plans	
_		Recompletion	New Construction	
X Subsequ	ent Report	Plugging Back	Non-Routine Fracturing	
		Casing Repair	Water Shut-Off	
Final Abandonment Notice		Altering Casing	Conversion to Injection	
			Conversion to injustion	
T INGLES		Other	Dispose Water	
The second of Con	malakat (Yaciatikas (Classik) stola all r		Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) date of starting any proposed work. If well is	
The collection of the Collecti	mpleted Operations (Clearly state all persubsurface locations and measured MIRU. Hold safety meeting, RIH w/ cement retainer and Pull casing to 2250' and speat 920' Spot 50 sx under an	pertinent details, and give pertinent dates, including estimated of and true vertical depths for all markers and zones pertinent to a rig up, install BOP, pull and tally 2-7/8" tubing. If set at 3000'. Pump in 50 sx under and 10 sx on to to 25 sx plug from 2250' to 2100'. Pull tubing, perfind 25 sx on top of retainer. Perforate at 350' circular	Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) date of starting any proposed work. If well is this work.)*	
Describe Proposed or Condirectionally drilled, giv	inpleted Operations (Clearly state all persubsurface locations and measured MIRU. Hold safety meeting, RIH w/ cement retainer and Pull casing to 2250' and spe	pertinent details, and give pertinent dates, including estimated of and true vertical depths for all markers and zones pertinent to a rig up, install BOP, pull and tally 2-7/8" tubing. If set at 3000'. Pump in 50 sx under and 10 sx on to to 25 sx plug from 2250' to 2100'. Pull tubing, perfind 25 sx on top of retainer. Perforate at 350' circular	Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) date of starting any proposed work. If well is of this work.)* op of retainer. Circulate mud, test casing to 500#. orate at 1000'. RIH w/ 7" cement retainer and set	
Describe Proposed or Condirectionally drilled, giv	mpleted Operations (Clearly state all persubsurface locations and measured MIRU. Hold safety meeting, RIH w/ cement retainer and Pull casing to 2250' and speat 920' Spot 50 sx under an	pertinent details, and give pertinent dates, including estimated of and true vertical depths for all markers and zones pertinent to a rig up, install BOP, pull and tally 2-7/8" tubing. If set at 3000'. Pump in 50 sx under and 10 sx on to to 25 sx plug from 2250' to 2100'. Pull tubing, perfind 25 sx on top of retainer. Perforate at 350' circular	Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) date of starting any proposed work. If well is of this work.)* op of retainer. Circulate mud, test casing to 500#. orate at 1000'. RIH w/ 7" cement retainer and set	
Describe Proposed or Condirectionally drilled, giv 8/13/96 8/14/96	mpleted Operations (Clearly state all pre subsurface locations and measured MIRU. Hold safety meeting, RIH w/ cement retainer and Pull casing to 2250' and sprat 920' Spot 50 sx under ar wellhead, install marker, cle	pertinent details, and give pertinent dates, including estimated of and true vertical depths for all markers and zones pertinent to a rig up, install BOP, pull and tally 2-7/8" tubing. If set at 3000'. Pump in 50 sx under and 10 sx on to to 25 sx plug from 2250' to 2100'. Pull tubing, perfind 25 sx on top of retainer. Perforate at 350' circular	Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) date of starting any proposed work. If well is this work.)* op of retainer. Circulate mud, test casing to 500#. orate at 1000'. RJH w/ 7" cement retainer and set ate 85 sx down 7" and up 8-5/8" to surface. Cut off	
Describe Proposed or Condirectionally drilled, giv 8/13/96 8/14/96	mpleted Operations (Clearly state all presubsurface locations and measured MIRU. Hold safety meeting, RIH w/ cement retainer and Pull casing to 2250' and sprat 920' Spot 50 sx under an wellhead, install marker, cle	pertinent details, and give pertinent dates, including estimated of and true vertical depths for all markers and zones pertinent to a rig up, install BOP, pull and tally 2-7/8" tubing. If set at 3000'. Pump in 50 sx under and 10 sx on to to 25 sx plug from 2250' to 2100'. Pull tubing, perfind 25 sx on top of retainer. Perforate at 350' circular	Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) date of starting any proposed work. If well is of this work.)* op of retainer. Circulate mud, test casing to 500#. For the starting and set at 1000'. RIH w/ 7" cement retainer and set at 85 sx down 7" and up 8-5/8" to surface. Cut off	
Describe Proposed or Condirectionally drilled, giv 8/13/96 8/14/96	mpleted Operations (Clearly state all pre subsurface locations and measured MIRU. Hold safety meeting, RIH w/ cement retainer and Pull casing to 2250' and sprat 920' Spot 50 sx under ar wellhead, install marker, cle	pertinent details, and give pertinent dates, including estimated of and true vertical depths for all markers and zones pertinent to a rig up, install BOP, pull and tally 2-7/8" tubing. If set at 3000'. Pump in 50 sx under and 10 sx on to to 25 sx plug from 2250' to 2100'. Pull tubing, perfind 25 sx on top of retainer. Perforate at 350' circular	Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) date of starting any proposed work. If well is of this work.)* op of retainer. Circulate mud, test casing to 500#. For the start of t	
Describe Proposed or Condirectionally drilled, giv 8/13/96 8/14/96	mpleted Operations (Clearly state all pre subsurface locations and measured MIRU. Hold safety meeting, RIH w/ cement retainer and Pull casing to 2250' and sprat 920' Spot 50 sx under ar wellhead, install marker, cle	pertinent details, and give pertinent dates, including estimated of and true vertical depths for all markers and zones pertinent to a rig up, install BOP, pull and tally 2-7/8" tubing. If set at 3000'. Pump in 50 sx under and 10 sx on to to 25 sx plug from 2250' to 2100'. Pull tubing, perfind 25 sx on top of retainer. Perforate at 350' circular	Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) date of starting any proposed work. If well is of this work.)* op of retainer. Circulate mud, test casing to 500#. For the start of t	
Describe Proposed or Condirectionally drilled, giv 8/13/96 8/14/96	mpleted Operations (Clearly state all pre subsurface locations and measured MIRU. Hold safety meeting, RIH w/ cement retainer and Pull casing to 2250' and sprat 920' Spot 50 sx under ar wellhead, install marker, cle	pertinent details, and give pertinent dates, including estimated of and true vertical depths for all markers and zones pertinent to a rig up, install BOP, pull and tally 2-7/8" tubing. If set at 3000'. Pump in 50 sx under and 10 sx on to to 25 sx plug from 2250' to 2100'. Pull tubing, perfind 25 sx on top of retainer. Perforate at 350' circular	Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) date of starting any proposed work. If well is of this work.)* op of retainer. Circulate mud, test casing to 500#. For the start of t	
Describe Proposed of Condirectionally drilled, giv 8/13/96 8/14/96	mpleted Operations (Clearly state all pre subsurface locations and measured MIRU. Hold safety meeting, RIH w/ cement retainer and Pull casing to 2250' and sprat 920' Spot 50 sx under ar wellhead, install marker, cle	pertinent details, and give pertinent dates, including estimated of and true vertical depths for all markers and zones pertinent to a rig up, install BOP, pull and tally 2-7/8" tubing. If set at 3000'. Pump in 50 sx under and 10 sx on to to 25 sx plug from 2250' to 2100'. Pull tubing, perfind 25 sx on top of retainer. Perforate at 350' circular	Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) date of starting any proposed work. If well is of this work.)* op of retainer. Circulate mud, test casing to 500#. For the starting and set at 1000'. RIH w/ 7" cement retainer and set at 85 sx down 7" and up 8-5/8" to surface. Cut off	
Describe Proposed or Condirectionally drilled, giv 8/13/96 8/14/96	mpleted Operations (Clearly state all pre subsurface locations and measured MIRU. Hold safety meeting, RIH w/ cement retainer and Pull casing to 2250' and sprat 920' Spot 50 sx under ar wellhead, install marker, cle	pertinent details, and give pertinent dates, including estimated of and true vertical depths for all markers and zones pertinent to a rig up, install BOP, pull and tally 2-7/8" tubing. If set at 3000'. Pump in 50 sx under and 10 sx on to to 25 sx plug from 2250' to 2100'. Pull tubing, perfind 25 sx on top of retainer. Perforate at 350' circular	Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) date of starting any proposed work. If well is of this work.)* op of retainer. Circulate mud, test casing to 500#. For the starting and set at 1000'. RIH w/ 7" cement retainer and set at 85 sx down 7" and up 8-5/8" to surface. Cut off	
Describe Proposed or Condirectionally drilled, giv 8/13/96 8/14/96	mpleted Operations (Clearly state all pre subsurface locations and measured MIRU. Hold safety meeting, RIH w/ cement retainer and Pull casing to 2250' and sprat 920' Spot 50 sx under ar wellhead, install marker, cle	pertinent details, and give pertinent dates, including estimated of and true vertical depths for all markers and zones pertinent to a rig up, install BOP, pull and tally 2-7/8" tubing. If set at 3000'. Pump in 50 sx under and 10 sx on to to 25 sx plug from 2250' to 2100'. Pull tubing, perfind 25 sx on top of retainer. Perforate at 350' circular	Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) date of starting any proposed work. If well is this work.)* op of retainer. Circulate mud, test casing to 500#. For the at 1000'. RIH w/ 7" cement retainer and set at 85 sx down 7" and up 8-5/8" to surface. Cut off	
Describe Proposed or Condirectionally drilled, given 8/13/96 8/14/96 Cement Mud:	mpleted Operations (Clearly state all persubsurface locations and measured MIRU. Hold safety meeting, RIH w/ cement retainer and Pull casing to 2250' and speat 920' Spot 50 sx under an wellhead, install marker, clearly clearly considered to the constant of the constant	pertinent details, and give pertinent dates, including estimated of and true vertical depths for all markers and zones pertinent to a rig up, install BOP, pull and tally 2-7/8" tubing. If set at 3000'. Pump in 50 sx under and 10 sx on to to 25 sx plug from 2250' to 2100'. Pull tubing, perfind 25 sx on top of retainer. Perforate at 350' circular	Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) date of starting any proposed work. If well is of this work.)* op of retainer. Circulate mud, test casing to 500#. For the start of t	
Describe Proposed or Condirectionally drilled, given 8/13/96 8/14/96	mpleted Operations (Clearly state all persubsurface locations and measured MIRU. Hold safety meeting, RIH w/ cement retainer and Pull casing to 2250' and speat 920' Spot 50 sx under an wellhead, install marker, clearly clearly considered to the constant of the constant	pertinent details, and give pertinent dates, including estimated of and true vertical depths for all markers and zones pertinent to a rig up, install BOP, pull and tally 2-7/8" tubing. If set at 3000'. Pump in 50 sx under and 10 sx on to to 25 sx plug from 2250' to 2100'. Pull tubing, perfind 25 sx on top of retainer. Perforate at 350' circular	Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) date of starting any proposed work. If well is of this work.)* op of retainer. Circulate mud, test casing to 500#. For the starting and set at 1000'. RIH w/ 7" cement retainer and set at 85 sx down 7" and up 8-5/8" to surface. Cut off	
Describe Proposed or Condirectionally drilled, given 8/13/96 8/14/96 Cement Mud:	mpleted Operations (Clearly state all persubsurface locations and measured MIRU. Hold safety meeting, RIH w/ cement retainer and Pull casing to 2250' and speat 920' Spot 50 sx under an wellhead, install marker, clearly considered to the constant of the c	pertinent details, and give pertinent dates, including estimated of and true vertical depths for all markers and zones pertinent to a rig up, install BOP, pull and tally 2-7/8" tubing. If set at 3000'. Pump in 50 sx under and 10 sx on to to 25 sx plug from 2250' to 2100'. Pull tubing, perfind 25 sx on top of retainer. Perforate at 350' circular	Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) date of starting any proposed work. If well is of this work.)* op of retainer. Circulate mud, test casing to 500#. forate at 1000'. RIH w/ 7" cement retainer and set ate 85 sx down 7" and up 8-5/8" to surface. Cut off	

Take 18 U.S.C. Section 1001, makes it a crime for any porson knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.