

OIL CONSERVATION DIVISION
P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-73

NO. OF COPIES RECEIVED	
DIST. DIVISION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

3a. Indicate Type of Lease	
State ☒	Fee ☐
3. State Oil & Gas Lease No.	
B-7766	

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

OIL WELL ☒ GAS WELL ☐ OTHER ☐

7. Unit Agreement Name
Lovington San Andres Unit

8. Farm or Lease Name

9. Well No.

11

10. Field and Pool, or Wildcat

Lovington San Andres

Name of Operator

Texaco Producing Inc.

Address of Operator

P. O. Box 728, Hobbs, NM 88240

Location of well

UNIT LETTER F 1980 FEET FROM THE North LINE AND 1980 FEET FROM

THE West LINE, SECTION 36 TOWNSHIP 16S RANGE 36E N.M.P.M.

15. Elevation (Show whether SF, RT, GR, etc.)

3847' DF

12. County

Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

INFORM REWELL WORK ☒

PLUG AND ABANDON ☐

REMEDIAL WORK ☐

ALTERING CASING ☐

TEMPORARILY ABANDON ☐

COMMENCE DRILLING OPNS. ☐

PLUG AND ABANDONMENT ☐

PULL OR ALTER CASING ☐

CHANGE PLANS ☐

CASING TEST AND CEMENT JOB ☐

OTHER ☐

OTHER ☐

Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- 1) MIRU. pull rods & pump.
- 2) Install BOP. Pull tbg.
- 3) GIH w/4 3/4" bit Tag TD
- 4) GIH w/RBP tp +4550'
- 5) Pressure test csg to 500#. Repair if necessary.
- 6) GIH w/4 3/4" bit. Deepen from 5025'-5130' (105')
- 7) Run GR-CNL-CAL-CCL 5130-2500' pick perms.
- 8) GIH w/pkr to +4500'. Load backside.
- 9) Acidize S.A. OH 4575-5130' w/10,000 gal gelled 15% NEFE in 3 stages. Use +1000# rocksalt in gelled brine between each stage as a block. Mix 2 drums scale inhibitor w/the acid. (5 BPM, 4000#).
- 0) Flow back load.
- 1) GIH w/RBP TO +4550'.
- 2) Perforate GB w/4" csg gun w/2 JSPI.
- 3) gih w/pkr to +4300'.
- 4) Acidize Grayburg perms w/5000 gal gelled 15% NEFE and ball sealers. Mix 1 drum scale inhibitor w/the acid (5 BPM, 4000#).
- 5) Flow back Load
- 6) Pull RBP.
- 7) Place on production

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED [Signature]

TITLE District Admin. Supervisor

DATE 10/09/86

ORIGINAL SIGNED BY JERRY SEXTON

DISTRICT 1 SUPERVISOR

TITLE _____

DATE OCT 16 1986

CONDITIONS OF APPROVAL, IF ANY: