## STATE OF NEW MEXICO ENERGY AND MINERALS DEPARTMENT

wa. of Carles Accelves	T	
DISTRIBUTION		
BANYA FE		
FILE		
U.S.O.S.		
LAND OFFICE		
OPERATOR	1	

## L CONSERVATION DIVISION P. O. BOX 2088 SANTA FE, NEW MEXICO 87501

Form C-103 Revised 10-1-78

FILE		
U.S.O.S.	5a. Indicate Type of Lease	
LAND OFFICE	State X Fee	
OPERATOR .	5. State Oil & Gas Lease No.	
	LG-8295	
	mmmmmm	
SUNDRY NOTICES AND REPORTS ON WELLS		
(DO NOT USE THIS FORM FOR PROPOSALS TO CRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.  USE "APPLICATION FOR PERMIT "" (FORM C-101) FOR SUCH PROPOSALS.)		
01L	7. Unit Agreement Name	
WELL Dry		
2. Name of Operator	8. Farm or Lease Hame	
Gulf Oil Corporation	Lea "AAK" State	
1, Address of Operator	9. Well No.	
P. O. Box 670, Hobbs, NM 88240	_	
	1	
t. Location of Well	10. Field and Pool, or Wildcat	
UNIT LETTER 0 , 1980 FEET FROM THE <u>Fast</u> line and 3300 FEET FROM	Wildont Downson	
THE PROM THE STATE OF THE PROM	THE PROPERTY OF THE PARTY OF TH	
Good Control of the C		
THE SOUTH LINE, SECTION 6 TOWNSHIP 16S RANGE 32E NMPM.		
15. Elevation (Show whether DF, RT, GR, etc.)	12. County	
4377' GL	Lea	
Check Appropriate Box To Indicate Nature of Notice, Report or Oth		
NOTICE OF INTENTION TO: SUBSEQUENT	REPORT OF:	
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK	ALTERING CASING	
TEMPORARILY ABANDON COMMENCE DRILLING OPNS.	PLUG AND ABANDONMENT	
PULL OR ALTER CABING CHANGE PLANS CASING TEST AND CEMENT JOB		
	<u></u>	
OTHER		
OTHER		
17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including		
work) SEE RULE 1 103.	estimated date of starting any proposed	
•		
POH with tubing. Set CIBP at 9925', test 1000#. Cap CIBP with	351 coment	
Cut casing at 8906. Pumped 50 sacks Class "C". WOC. Tag ceme	of cement.	
Circulate hele with short-out of 1001	ent at 8835'.	
Circulate hole with abandonment mud. Set 100' cement plug with	35 sacks Class	
"C" at 7642'. Set 100' cement plug with 35 sacks Class "C" at 6	8251. Set cement	
plug 5690'-5586' with 35 sacks Class "C". Set plug 5000'-4900'	with 50 sacks	
Class "C". Tag cement at 4929'. Pump 10 sack surface plug. Se	t dry hole marker	
Clear and clean location. Well now P&A.	and the same same same same same same same sam	
8. I hereby certify that the information above is true and complete to the best of my knowledge and belief.		
POP'Y		
RDPite Area Engineer	DATE 5-25-82	
POD'4	DATE 5-25-82	
POD'4	<b>6</b> 10	
POP'4	, and	
POP'4		

RECEIVED

MAY 27 1982

O.C.D. HOBBS OFFICE