

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease
State ☒ Fee ☐
5. State Oil & Gas Lease No. E-398

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT --" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL ☐ GAS WELL ☐ OTHER- <u>Water Injection Well</u>	7. Unit Agreement Name SMGSAU
2. Name of Operator <u>Cities Service Company</u>	8. Farm or Lease Name Tract 10
3. Address of Operator <u>Box 1919 Midland, Texas 79702</u>	9. Well No. 4
4. Location of Well UNIT LETTER <u>C</u> . <u>330</u> FEET FROM THE <u>North</u> LINE AND <u>2970</u> FEET FROM THE <u>East</u> LINE, SECTION <u>32</u> TOWNSHIP <u>17S</u> RANGE <u>33E</u> NMPM.	10. Field and Pool, or Wildcat Maljamar (G-SA)
15. Elevation (Show whether DF, RT, GR, etc.) Unknown	12. County Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☒	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐	OTHER ☐	CASING TEST AND CEMENT JOBS ☐	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- OTD 4298'. It is proposed to plug and abandon this well in the following manner:
1. MIRU. NU BOP. POOH with tubing and packer.
 2. RIH w/tbg. Set CIBP @ approx. 4050'. Circ. hole w/mud laden fluid. Dump a 50 sack cmt. plug on top of CIBP. POOH.
 3. RIH w/cmt. retainer & tbg. Set retainer @ approx. 2400'. Press csg. to 1000#. Est. IR. into csg. leak. Cmt. squeeze csg. leak w/300 sacks Class C cement containing 3% CaCl₂ & 5# sd./sk. RO cmt. CHC. Dump 50 sack cmt. on top of retainer.
 4. RU and perf. 2 holes in csg. @ 1300'.
 5. RIH w/tubing and cement retainer. Set retainer @ approx. 1200', Press csg. to 1000#. Open valve, pump down tbg. and break circ. to surface, Cmt. csg. to surface w/125 sacks Class C cmt. containing 2% Ca Cl₂. CHC. Dump 20 sack cmt. plug on top of retainer. POOH.
 6. ND BOP. CO WH. Spot cmt. plug from approx 200'- surface. Install dry hole marker to designate a plugged and abandoned location.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Elmer Startz TITLE Region Operations Manager Prod. DATE 2-25-83

APPROVED BY ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT 1 SUPERVISOR
CONDITIONS OF APPROVAL, IF ANY:

TITLE _____ DATE MAR 4 1983