

NO. OF COPIES RECEIVED	
DISTRIBUTION	
PAYMENT	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease
State Fee
5. State Oil & Gas Lease No.
B-5310

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL GAS WELL OTHER
2. Name of Operator
Cities Service Oil Company
3. Address of Operator
Box 4906 - Midland, Texas 79701
4. Location of Well
UNIT LETTER A 660 FEET FROM THE North LINE AND 660 FEET FROM
THE East LINE, SECTION 32 TOWNSHIP 17S RANGE 33E NMPM.
15. Elevation (Show whether DF, RT, GR, etc.)
N.A.
7. Unit Agreement Name
SMGSAU
8. Farm or Lease Name
Tract 9
9. Well No.
4
10. Field and Pool, or Well tract
Maljamar (G-SA)
12. County
Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK
TEMPORARILY ABANDON
PULL OR ALTER CASING
OTHER
PLUG AND ABANDON
CHANGE PLANS

SUBSEQUENT REPORT OF:

REMEDIAL WORK
COMMENCE DRILLING OPNS.
CASING TEST AND CEMENT JOB
OTHER
ALTERING CASING
PLUG AND ABANDONMENT

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

We propose to plug and abandon the above well in the following manner:

- MIRU pulling unit and load hole with mud laden fluid.
- Pull rods and tubing and set a CIBP @ approx. 3900'.
- Dump a 9 sack cement plug (est. 40') on top of CIBP.
- Cut and pull approx. 3700' of 7" csg.
- Spot a 20 sack cement plug @ approx. 3670'-3730' (1/2 in and 1/2 out of 7" csg. stub @ 3700').
- Spot a 40 sack cement plug across the base of the salt @ approx. 2420'-2520'.
- Spot a 40 sack cement plug across the top of the salt @ approx. 1280'-1380'.
- Spot a 35 sack cement plug @ approx. 1270'-1330' (1/2 in and 1/2 out of 9-5/8" csg. stub @ 1300').
- Set a 15 sack cement surface plug @ approx. 35'-0' and install a 4" dry hole marker.
- Clear location of all equipment and debris and notify your office for final inspection.

*All plugs 100' in length
24 hrs notice*

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED E. Spiller TITLE Region Operation Manager DATE June 15, 1973

APPROVED BY Joe [unclear] TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY: Dis. I copy.