

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

<p>SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO RE-ENTER OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT TO DRILL" (FORM C-101) FOR SUCH PROPOSALS.)</p>		<p>5a. Indicate Type of Lease State <input checked="" type="checkbox"/> Fee <input type="checkbox"/></p> <p>5. State Oil & Gas Lease No. B4118</p>
<p>1. <input checked="" type="checkbox"/> OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER-</p> <p>2. Name of Operator Murphy H. Baxter</p> <p>3. Address of Operator P. O. Box 2040 Midland, Texas 79702</p> <p>4. Location of Well UNIT LETTER E 1980 FEET FROM THE North LINE AND 330 FEET FROM THE West LINE, SECTION 6 TOWNSHIP 18S RANGE 34E N.M.P.M.</p>	<p>7. Unit Agreement Name N. E. K. Queen Unit</p> <p>8. Farm or Lease Name Tract 3</p> <p>9. Well No. 2</p> <p>10. Field and Pool, or Wildcat EK Yates 7 Rivers Qu</p> <p>12. County Lea</p>	
<p>15. Elevation (Show whether DF, RT, CR, etc.) 4091 GR</p>		

<p>16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data</p>			
NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
<p>PERFORM REMEDIAL WORK <input type="checkbox"/></p> <p>TEMPORARILY ABANDON <input type="checkbox"/></p> <p>PULL OR ALTER CASING <input type="checkbox"/></p> <p>OTHER <input type="checkbox"/></p>	<p>PLUG AND ABANDON <input type="checkbox"/></p> <p>CHANGE PLANS <input type="checkbox"/></p> <p>OTHER <input type="checkbox"/></p>	<p>REMEDIAL WORK <input type="checkbox"/></p> <p>COMMENCE DRILLING OPNS. <input type="checkbox"/></p> <p>CASING TEST AND CEMENT JOBS <input type="checkbox"/></p> <p>OTHER <input type="checkbox"/></p>	<p>ALTERING CASING <input type="checkbox"/></p> <p>PLUG AND ABANDONMENT <input type="checkbox"/></p>

7. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Pull out of hole with production equipment. Rig up wireline.
2. Set C.I.B.P @ 4075'.
3. Run in hole with tubing and circulate hole with mud. Spot 5 sks. of cement of top of CIBP.
4. Pull out of hole to 1798' and spot 25 sks. of cement.
5. Cut casing @ 939' and not free. Cut and pull 4½ casing @ 485'.
6. Run in hole with tubing to 1000' and spotted 25 sks. of cement.
7. Pull out of hole to 535' and spotted 75 sks.
8. Tagged plug @ 360' and spotted 75 sks. of cement. Wait on cement and tagged @ 330'.
9. Spotted 25 sks. of cement. WOC and tagged @ 200'.
10. Spotted 10 sks. surface plug. Cut off wellhead, anchors, and rig down, clean location.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED *[Signature]* Baber Well Service
TITLE Plug and Abandonment Supv. DATE 10-28-87
PROVED BY *[Signature]* OIL & GAS INSPECTOR
TITLE _____ DATE MAY 2 1989
CONDITIONS OF APPROVAL, IF ANY:

RECEIVED
NOV 2 1987
OCD
HOBBS OFFICE