

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

# NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103  
Supersedes Old  
C-102 and C-103  
Effective 1-1-65

5a. Indicate Type of Lease	
State <input type="checkbox"/>	Fee <input checked="" type="checkbox"/>
5. State Oil & Gas Lease No.	

## SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator <b>CITIES SERVICE OIL COMPANY</b>	8. Farm or Lease Name <b>Fowler</b>
3. Address of Operator <b>P.O. Box 69, Hobbs, N.M. 88240</b>	9. Well No. <b>5</b>
4. Location of Well UNIT LETTER <b>A</b> <b>380</b> FEET FROM THE <b>North</b> LINE AND <b>330</b> FEET FROM THE <b>East</b> LINE, SECTION <b>31</b> TOWNSHIP <b>18S</b> RANGE <b>38E</b> N.M.P.M.	10. Field and Pool, or Wildcat <b>Bowers Syn. Rvs.</b>
15. Elevation (Show whether DF, RT, GR, etc.) <b>3647 DF</b>	12. County <b>Lea</b>

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data  
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

This well was plugged and abandoned in the following manner:

1. Rigged up pulling unit and pulled rods and tubing.
2. Set a CIBP in 5 1/2" casing @ 3026' and dumped a 2 sack cement plug on top of CIBP from 3026--3010'
3. Loaded hole with mud laden fluid.
4. Displaced a 25 sack cement plug across top of salt @ 1560'--1360'.
5. Displaced a 10 sack cement surface plug @ 60'--0' with a 4" dry hole marker extending 4' above the surface to designate a plugged and abandoned location.
6. Location will be cleared of all equipment and debris and your office notified for final inspection.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief,

SIGNED \_\_\_\_\_ TITLE **Dist. Admin, Supervisor** DATE **3-1-72**  
APPROVED BY **Nathan E. Clegg** TITLE **OIL & GAS INSPECTOR** DATE **APR 26 1972**  
CONDITIONS OF APPROVAL, IF ANY: