

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. <input checked="" type="checkbox"/> OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- P&A		5a. Indicate Type of Lease State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
2. Name of Operator Atlantic Richfield Company		5. State Oil & Gas Lease No. E-1582
3. Address of Operator P. O. Box 1710, Hobbs, New Mexico 88240		7. Unit Agreement Name
4. Location of Well UNIT LETTER <u>K</u> <u>1980</u> FEET FROM THE <u>South</u> LINE AND <u>1980</u> FEET FROM THE <u>West</u> LINE, SECTION <u>22</u> TOWNSHIP <u>18S</u> RANGE <u>35E</u> NMPM.		8. Farm or Lease Name Lea 403 State
		9. Well No. 8
		10. Field and Pool, or Wildcat Vacuum-Dev So.
15. Elevation (Show whether DF, RT, GR, etc.) 3901' GR		12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Plugged & Abandoned well in the following manner: Ran & set 5 1/2" CIBP @ 11,650' & capped w/35' cmt 11,650-11,615'. Filled hole w/heavy mud. Shot 5 1/2" csg off @ 8400' & recovered 230 jts 8400' of 5 1/2" 17# N-80 X-line & 8rd csg. Spotted 50 sk cmt plug across 5 1/2" csg stub 8450-8280'. Set 50 sk cmt plug @ top of Bone Springs 7006-6846'. Set 50 sk cmt plug across 8-5/8" csg shoe 4060-3900'. Set 35 sk cmt plug @ top of salt 1853-1735'. Set 10 sk cmt plug in top of 8-5/8" csg. Welded on plate & installed regulation dry hole marker. Levelled & cleaned location. P&A 8/1/74. Your office to be notified when location is ready for inspection.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED H. J. Bernard TITLE Dist. Drlg. Supv. DATE 8/6/74

APPROVED BY Nathan E. Clegg TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY: