

Submit 3 Copies  
to Appropriate  
District Office

State of New Mexico  
Energy, Minerals and Natural Resources Department

Form C-103  
Revised 1-1-89

DISTRICT I  
P.O. Box 1980, Hobbs, NM 88240

OIL CONSERVATION DIVISION  
P.O. Box 2088  
Santa Fe, New Mexico 87504-2088

DISTRICT II  
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III  
1000 Rio Brazos Rd., Aztec, NM 87410

WELL API NO.  
30-025-23712

5. Indicate Type of Lease  
STATE  FEE

6. State Oil & Gas Lease No.  
14006

SUNDRY NOTICES AND REPORTS ON WELLS  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A  
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"  
(FORM C-101) FOR SUCH PROPOSALS.)

7. Lease Name or Unit Agreement Name

1. Type of Well:  
OIL WELL  GAS WELL  OTHER

Lea State

2. Name of Operator  
Dinero Operating Company

8. Well No.  
2

3. Address of Operator  
P.O. box 10505, Midland, Texas 79702

9. Pool name or Wildcat  
NW Vacuum Wolfcamp

4. Well Location  
Unit Letter H : 2183.7 Feet From The North Line and 660 Feet From The East Line

Section 5 Township 17-S Range 34-E NMPM Lea County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)  
4106.8 G R

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK   
TEMPORARILY ABANDON   
PULL OR ALTER CASING   
OTHER:

PLUG AND ABANDON   
CHANGE PLANS   
REMEDIAL WORK   
COMMENCE DRILLING OPNS.   
CASING TEST AND CEMENT JOB   
OTHER:

ALTERING CASING   
PLUG AND ABANDONMENT

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

4-9-91 -- Set cast iron bridge plug at 10,110' and placed 35' cement plug. Circulate hole with brine water gel. Cut and pulled 5 1/2" casing at 7110'. Ran in hole with tubig to 7300'. Spot 65 sack cement plug. Tag at 6920'. Spot 50 sack cement plug at 6070' to 5970'. Spot 50 sack cement plug at 4350' and tag at 4187'. Cut and pulled 8 5/8" casing at 385'. Spot 60 sack cement plug at 435' and tag cement at 321'. Spot 10 sack cement plug in top of surface casing. Cut 13 3/8" head off and install dry hole marker -- on 4-13-91.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Charlie Williams TITLE Production Supervisor DATE 4-23-91

TYPE OR PRINT NAME Charlie Williams TELEPHONE NO 915 684-5544

(This space for State Use)

APPROVED BY [Signature] TITLE OIL & GAS DIVISION DATE 4-23-91

CONDITIONS OF APPROVAL IF ANY:

E