

Shearw Federal #1

8-1 RIH w/2-7/8 WS, open end to 2803, spot 200 sxs Class "C" cmt plug 2803-2550, POH w/2-7/8 W.

8-2 TIH w/2-7/8 W.S. tagged cmt plug 2699' Spot 130 sxs Class "C" cmt plug 2699-2500/POH

8-3 RIH w/2-7/8 WS, tag cmt plug @2699, mix 10 sxs LCM, 20 sxs paper in 180 bbls 10# mud, circ hole, spotted 140 sxs Class "C" cmt w/1/6# Flocele from 2699-2500, POH w/2-7/8 WS.

8-4 RIH w/2-7/8 W.S., tag cmt plug @ 2488, raise tbg to 1052', spot 70 sxs cmt plug 1052-952, raise tbg to 62', spot 40 sxs cmt plug 62' to surface, cut well head off, cut csg off 6' below CPD level, weld on steel plate, install dry hole marker.