

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIPLICATE
(Other instructions on reverse side)
Budget Bureau No. 1004-0135
Expires August 31, 1985

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☐ GAS WELL ☐ OTHER INJECTOR		7. UNIT AGREEMENT NAME N. HOBBS (G/SA) UNIT	
2. NAME OF OPERATOR SHELL WESTERN E&P INC.		8. FARM OR LEASE NAME SECTION 29	
3. ADDRESS OF OPERATOR P. O. BOX 576, HOUSTON, TEXAS 77001 (WCK 4435)		9. WELL NO. 122	
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 1600' FNL & 180' FWL		10. FIELD AND POOL, OR WILDCAT HOBBS (G/SA)	
14. PERMIT NO. NA		12. COUNTY OR PARISH LEA	
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 3662' DF		13. STATE NM	

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETION

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other) INJECTION PROFILE CORRECTION

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

4-19 to 4-27-88:

POH w/inj equip. CO to 4285'. Set CICK @ 4030'. Sqzd San Andres perfs 4154' - 4306' w/25 SX Cls "C" cmt + 2% CaCl₂ + 1.5% Howco Suds + 0.75% HC-2 + 200 SCF N₂/bbl followed by 125 SX Cls "C" cmt + 2% CaCl₂. DO cmt (E CICK @ 4030') 4026' - 4145'. Pres tstd prev sqzd perfs 4132'-36' to 500#, held OK. DO cmt to 4266'. Pres tstd sqz to 500#, held OK. DO cmt to 4285' & tagged metal. Knocked down to 4324'. Perf'd San Andres 4154' - 4211' (2 JSPF). Set CIBP @ 4215'. Acid perfs 4154' - 4211' w/250 gals 15% HCl-NEA. Reperf'd 4154' - 4211' (2 JSPF). Acid perfs 4154' - 4211' w/336 gals 15% HCl-NEA. Reacid perfs 4154' - 4211' w/500 gals 15% HCl-NEA + 200# rock salt. Installed inj equip, setting Guiberson Uni-PKR VI @ 4037'. Returned well to inj.

18. I hereby certify that the foregoing is true and correct

SIGNED A. J. FORE

TITLE SUPERVISOR REG. & PERMITS

DATE 6-23-88

(This space for Federal or State office use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE

*See Instructions on Reverse Side

RECEIVED