

OIL CONSERVATION DIVISION

P. O. BOX 2088

SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

NO. OF COPIES RECEIVED		
DISTRIBUTION		
SANTA FE		
FILE		
U.S.G.S.		
LAND OFFICE		
OPERATOR		

5a. Indicate Type of Lease
 State Fee
 5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. <input type="checkbox"/> OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- <u>Water Injection</u>	7. Unit Agreement Name <u>West Pearl Queen Unit</u>
2. Name of Operator <u>Gulf Oil Corporation</u>	8. Farm or Lease Name
3. Address of Operator <u>P. O. Box 670, Hobbs, NM 88240</u>	9. Well No. <u>123</u>
4. Location of well UNIT LETTER <u>P</u> <u>990</u> FEET FROM THE <u>South</u> LINE AND <u>660</u> FEET FROM THE <u>East</u> LINE, SECTION <u>28</u> TOWNSHIP <u>19S</u> RANGE <u>35E</u> NMPM.	10. Field and Pool, or Wildcat <u>Pearl Queen</u>
15. Elevation (Show whether DF, RT, GR, etc.) <u>3714' GL</u>	12. County <u>Lea</u>

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
 NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

POH with tubing and packer. Found casing hole 1330'-1364'. GIH with 2 3/8" tubing open ended to 4670'. Circ hole with abandonment mud. Spot 35' plug in CIBP @ 4675'. Spot 100' plug 3910-3810. Perf 1825' with (4) 1/2" JH with 90° phasing. Pmp into perf 1825' (no show circ). Set CR 1767'. Pmp 300 sacks Class "H" with 16% gel and 50 sacks Class "C" neat (D/N circ). Found top of cmt @ 1040'. Perf 320' with (4) 1/2" JH with 90° phasing. Circ 100 sacks Class "C" cmt dn 4 1/2" and back to surf outside 4 1/2". Clear and clean location. Set dry hole marker, cut off anchors. Cpl after P&A 2-12-81.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED RDP [Signature] TITLE Area Engineer DATE 2-24-81

APPROVED BY [Signature] TITLE [Signature] DATE _____

CONDITIONS OF APPROVAL, IF ANY: