

OIL CONSERVATION DIVISION

P. O. BOX 2088

SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

NO. OF COPIES RECEIVED		
DISTRIBUTION		
SANTA FE		
FILE		
U.S.G.S.		
LAND OFFICE		
OPERATOR		

50. Indicate Type of Lease
State Fee

5. State Oil & Gas Lease No.
E-1638

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT - " (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name West Pearl Queen Unit
2. Name of Operator Gulf Oil Corporation	8. Farm or Lease Name
3. Address of Operator P. O. Box 670, Hobbs, NM 88240	9. Well No. 155
4. Location of well UNIT LETTER <u>K</u> <u>1980</u> FEET FROM THE <u>South</u> LINE AND <u>1980</u> FEET FROM THE <u>West</u> LINE, SECTION <u>31</u> TOWNSHIP <u>19S</u> RANGE <u>35E</u> NMPM.	10. Field and Pool, or Wildcat Pearl Queen
15. Elevation (Show whether DF, RT, GR, etc.) 3719' GL	12. County Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

GIH with 2 3/8" work string. Tst csg 500#. Circ hole with abandonment mud. Spot 35' cmt plug on top of CIBP @ 3950'. Spot cmt plug 3220'-3120'. Perf 1900' with (4) 1/2" JH with 90° phasing. Pmp into perf (D/N circ out 13 3/8"). Set ck @ 1822'. Pmp 400 sacks Class "H" with 16% gel followed with 100 sacks Class "C" neat. (D/N circ on 13 3/8"). TSTOC 1300'. Circ hole with mud. Perf 200' with (4) 1/2" JH with 90° phasing. Pmp 150 sacks Class "C" cement, circ to surf. Clean & clear location. Set dry hole marker, cut off anchors. P&A complete 1-26-81.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED RDP TITLE Area Engineer DATE 2-24-81

APPROVED BY Al Stettin TITLE Oil DATE

CONDITIONS OF APPROVAL, IF ANY: