

EMSU # 106
API # 30-025-04334
1980' FSL & 4290' FEL
S25, T20S, R36E. & Unit E
Eunice Monument South Unit
Lea County, New Mexico

February 14, 2001

PROCEDURE TO TEMPORARILY ABANDON WELL:

Notify OCD/BLM 24 hrs prior to work commencing.

1. Verify anchors have been set & tested.
2. MIRU PU. ND WH. NU BOP.
3. TOH w/tbg. TIH w/6-1/8" bit, csg scraper, & WS. Make bit trip to 3740'. POH.
4. Set CIBP @ 3730'. Dump 3 sx Class 'C' cmt on CIBP.
5. TIH w/WS to TOC. Circulate csg w/corrosion inhibited pkr fluid. TOH.
6. Perform MIT (500 PSI for 30 min.).
7. ND BOP. NU WH. RD PU.
8. Clean and clear location.

T. Love 687-7645

Well Bore
was OK.
on this one
(100)

Corrected