Submit 3 Copies to Appropriate

State of New Mexico Energy, Minerals and Natural Resources Department

Form C-103 Revised 1-1-89

District Office	
DISTRICT I P.O. Box 1980, Hobbs NM 88241-1980 OIL CONSERVATION DIVISION	WELL API NO.
P.O. Box 2088 <u>DISTRICT II</u> Santa Fe, New Mexico 87504-2088	30-025-05642
P.O. Drawer DD, Artesia, NM 88210	5. Indicate Type of Lease STATE FEE X
DISTRICT III 1000 Rio Brazos Rd., Aztec, NM 87410	6. State Oil & Gas Lease No.
SUNDRY NOTICES AND REPORTS ON WELLS	
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	7. Lease Name or Unit Agreement Name NORTH MONUMENT G/SA UNIT
1. Type of Well: OIL GAS GAS	BLK. 5
OIL GAS WELL OTHER INJECTION	
2. Name of Operator Amerada Hess Corporation	8. Well No. 5
3. Address of Operator	9. Pool name or Wildcat
P.O. DRAWER D, MONUMENT, NM 88265	EUNICE MONUMENT G/SA
4. Well Location Unit Letter E: 1980 Feet From The NORTH Line and	660 Feet From The WEST Line
Section 19 Township 19S Range 37E	NMPM LEA County
10. Elevation (Show whether DF, RKB, RT, GR,	
11. Check Appropriate Box to Indicate Nature of Notice	ce, Report, or Other Data
NOTICE OF INTENTION TO:	UBSEQUENT REPORT OF:
DEPTODAL PENEDIAL MICHAEL DE LE CONTROL DE LA CONTROL DE L	ALTERNO GARNO
ERFORM REMEDIAL WORK	ALTERING CASING
EMPORARILY ABANDON CHANGE PLANS COMMENCE DRILL	ING OPNS. PLUG AND ABANDONMENT
TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILL OR ALTER CASING CASING TEST AND	ING OPNS. PLUG AND ABANDONMENT
TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILL TULL OR ALTER CASING CASING TEST AND OTHER: OTHER: CON	ING OPNS. PLUG AND ABANDONMENT CEMENT JOB CEMENT TO INJECTION WELL.
TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILL CASING TEST AND OTHER: OTHER: OTHER: CON 12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent work) SEE RULE 1103.	PLUG AND ABANDONMENT CEMENT JOB VERT TO INJECTION WELL. I dates, including estimated date of starting any proposed JMP. ND WELLHEAD & INSTALL F TOOL & TBG. TO 3,641'. SET F FOR 30 MINS. LOST 60# IN 15 FILL CSG. W/FW. CUT OFF OLD OK. INSTALL BOP. EQUALIZE. TOH W/2-3/8" TBG, GR./FT. RD ROTARY WIRELINE. FILL FR. 4,009'-4,028'.
COMMENCE DRILL CASING TEST AND OTHER: Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent work) SEE RULE 1103. NMGSAU #505 (01-02-97 THRU 01-16-97) MIRU TYLER WELL SVC. TOH W/POLISH ROD & LINER, RODS, K-BARS & PUBOP. TOH W/TBG., 1 JT. SALTA LINED TBG. & SN. TIH W/RBP W/ON-OFRBP. RELEASE ON-OFF TOOL. CIRC. HOLE W/FW. PRESS. CSG. TO 550#, MINS. WELLHEAD LEAKING. TOH W/TBG. & ON-OFF TOOL. RMV. BOP. FWELLHEAD AND WELD NEW WELLHEAD ON. TST. NEW WELLHEAD TO 2,000#. TIH W/ON-OFF TOOL & 2-3/8" TBG. TO 3,641". LATCH ONTO RBP & LETON-OFF TOOL & RBP. RU ROTARY WIRELINE & STRING SHOOT O.H. W/400 TIH W/BIT & TBG. TAGGED FILL @ 4,009". RU REVERSE UNIT & CLEAN RCV'D. FORMATION & SCALE. RD REVERSE UNIT. TOH W/TUBING & BIT.	PLUG AND ABANDONMENT CEMENT JOB VERT TO INJECTION WELL. I dates, including estimated date of starting any proposed JMP. ND WELLHEAD & INSTALL FF TOOL & TBG. TO 3,641'. SET FF FOR 30 MINS. LOST 60# IN 15 FILL CSG. W/FW. CUT OFF OLD OK. INSTALL BOP. EQUALIZE. TOH W/2-3/8" TBG, GR./FT. RD ROTARY WIRELINE.
COMMENCE DRILL CASING CASING TEST AND OTHER: Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent work) SEE RULE 1103. NMGSAU #505 (01-02-97 THRU 01-16-97) MIRU TYLER WELL SVC. TOH W/POLISH ROD & LINER, RODS, K-BARS & PUBOP. TOH W/TBG., 1 JT. SALTA LINED TBG. & SN. TIH W/RBP W/ON-OF RBP. RELEASE ON-OFF TOOL. CIRC. HOLE W/FW. PRESS. CSG. TO 550# MINS. WELLHEAD LEAKING. TOH W/TBG. & ON-OFF TOOL. RMV. BOP. FWELLHEAD AND WELD NEW WELLHEAD ON. TST. NEW WELLHEAD TO 2,000#. TIH W/ON-OFF TOOL & 2-3/8" TBG. TO 3,641'. LATCH ONTO RBP & LETON-OFF TOOL & RBP. RU ROTARY WIRELINE & STRING SHOOT O.H. W/400 TIH W/BIT & TBG. TAGGED FILL @ 4,009'. RU REVERSE UNIT & CLEAN RCV'D. FORMATION & SCALE. RD REVERSE UNIT. TOH W/TUBING & BIT. (CONTINUED)	PLUG AND ABANDONMENT CEMENT JOB VERT TO INJECTION WELL. I dates, including estimated date of starting any proposed JMP. ND WELLHEAD & INSTALL FF TOOL & TBG. TO 3.641'. SET FF FOR 30 MINS. LOST 60# IN 15 FILL CSG. W/FW. CUT OFF OLD OK. INSTALL BOP. EQUALIZE. TOH W/2-3/8" TBG, GR./FT. RD ROTARY WIRELINE. FILL FR. 4,009'-4,028'.
COMMENCE DRILL CASING TEST AND OTHER: Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent work) SEE RULE 1103. NMGSAU #505 (01-02-97 THRU 01-16-97) MIRU TYLER WELL SVC. TOH W/POLISH ROD & LINER, RODS, K-BARS & PLBOP. TOH W/TBG., 1 JT. SALTA LINED TBG. & SN. TIH W/RBP W/ON-OF RBP. RELEASE ON-OFF TOOL. CIRC. HOLE W/FW. PRESS. CSG. TO 550# MINS. WELLHEAD LEAKING. TOH W/TBG. & ON-OFF TOOL. RMV. BOP. FWELLHEAD AND WELD NEW WELLHEAD ON. TST. NEW WELLHEAD TO 2,000#. TIH W/ON-OFF TOOL & 2-3/8" TBG. TO 3,641'. LATCH ONTO RBP & LET ON-OFF TOOL & RBP. RU ROTARY WIRELINE & STRING SHOOT O.H. W/400 TIH W/BIT & TBG. TAGGED FILL @ 4,009'. RU REVERSE UNIT & CLEAN RCV'D. FORMATION & SCALE. RD REVERSE UNIT. TOH W/TUBING & BIT. (CONTINUED)	PLUG AND ABANDONMENT CEMENT JOB VERT TO INJECTION WELL. I dates, including estimated date of starting any proposed JMP. ND WELLHEAD & INSTALL F TOOL & TBG. TO 3,641'. SET F FOR 30 MINS. LOST 60# IN 15 FILL CSG. W/FW. CUT OFF OLD OK. INSTALL BOP. EQUALIZE. TOH W/2-3/8" TBG, GR./FT. RD ROTARY WIRELINE. FILL FR. 4,009'-4,028'.
COMMENCE DRILL CASING TEST AND OTHER: Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent work) SEE RULE 1103. NMGSAU #505 (01-02-97 THRU 01-16-97) MIRU TYLER WELL SVC. TOH W/POLISH ROD & LINER, RODS, K-BARS & PUBOP. TOH W/TBG., 1 JT. SALTA LINED TBG. & SN. TIH W/RBP W/ON-OF RBP. RELEASE ON-OFF TOOL. CIRC. HOLE W/FW. PRESS. CSG. TO 550# MINS. WELLHEAD LEAKING. TOH W/TBG. & ON-OFF TOOL. RMV. BOP. FWELLHEAD AND WELD NEW WELLHEAD ON. TST. NEW WELLHEAD TO 2,000#. TIH W/ON-OFF TOOL & 2-3/8" TBG. TO 3,641'. LATCH ONTO RBP & LET ON-OFF TOOL & RBP. RU ROTARY WIRELINE & STRING SHOOT O.H. W/400 TIH W/BIT & TBG. TAGGED FILL @ 4,009'. RU REVERSE UNIT & CLEAN RCV'D. FORMATION & SCALE. RD REVERSE UNIT. TOH W/TUBING & BIT. (CONTINUED) Thereby certify that the information above is true and complete to the best of my knowledge and belief. SIGNATURE TITLE SR. STAFF ASS	PLUG AND ABANDONMENT CEMENT JOB VERT TO INJECTION WELL. I dates, including estimated date of starting any proposed JMP. ND WELLHEAD & INSTALL FF TOOL & TBG. TO 3.641'. SET FF FOR 30 MINS. LOST 60# IN 15 FILL CSG. W/FW. CUT OFF OLD OK. INSTALL BOP. EQUALIZE. TOH W/2-3/8" TBG, GR./FT. RD ROTARY WIRELINE. FILL FR. 4.009'-4.028'. DATE
COMMENCE DRILL CASING TEST AND OTHER: OTHER: OTHER: OTHER: CON OTHER: OTHER CON OTHER: CON OTHER: CON OTHER: OTHER	ING OPNS. PLUG AND ABANDONMENT CEMENT JOB VERT TO INJECTION WELL. I dates, including estimated date of starting any proposed JMP. ND WELLHEAD & INSTALL F TOOL & TBG. TO 3,641'. SET F FOR 30 MINS. LOST 60# IN 15 FILL CSG. W/FW. CUT OFF OLD OK. INSTALL BOP. EQUALIZE. TOH W/2-3/8" TBG, GR./FT. RD ROTARY WIRELINE. FILL FR. 4,009'-4,028'. DATE 01-17-97 TELEPHONE NO. 505-393-2144

