

90-19-37

AMERADA HESS CORPORATION

CIBP S

P. O. DRAWER "D"
MONUMENT, NEW MEXICO 88265

Workover Procedure
State T #6

- 1) Set 6-5/8" CIBP at Grayburg marker (3690'). Dump 6 sks. Class C neat cement on CIBP.
- 2) Perforate 6-5/8" casing at 2525' with 2 shots.
- 3) Attempt to establish circulation up intermediate casing.
- 4) Set cement retainer at 2400'±.
- 5) Cement intermediate casing in the following manner:
 - a) Pump 250 sks. Class C and 4% gel.
 - b) Pump 400 sks. Class C and 2% CaCl₂.
 - c) Evaluate for additional cement work.