

OIL CONSERVATION DIVISION
P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-77

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease
State Fee

5. State Oil & Gas Lease No.
E-6706

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL GAS WELL OTHER - Injection Well

2. Name of Operator
Texaco Producing Inc.

3. Address of Operator
P.O. Box 728, Hobbs, New Mexico 88240

4. Location of Well
UNIT LETTER 0 660 FEET FROM THE South LINE AND 1980 FEET FROM
East 22 19S 37E
THE _____ LINE, SECTION _____ TOWNSHIP _____ RANGE _____ NMPM.

7. Unit Agreement Name
East Eumont Unit

8. Farm or Lease Name

9. Well No.
60

10. Field and Pool, or Wildcat
Eumont Yates 7-R Queen

15. Elevation (Show whether DF, RT, GR, etc.)
3629' DF

12. County
Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- MIRU PU. TOH w/tbg and pkr.
- TIH w/5-1/2" CIBP and set @ 3800'. Cap with 35' cement.
- Run freepoint and cut 5-1/2" csg. TOH w/csg.
- TIH w/workstring. Tag cmt. at + 3765'. Load hole w/salt gel mud consisting of 10# brine containing 25 lbs gel per bbl.
- Pull up hole to 2730'. Spot 100' of cement below salt section.
- Pull up hole to 1600. Spot 150' of cement across 5-1/2" csg stub and top of salt section.
- Pull up hole to 425'. Spot 100' of cement across 8-5/8" casing shoe.
- Pull up hole to 40'. Spot 40' of cement to surface.
- RDPU. Cut off wellhead. Install marker. Clean location.

8. I hereby certify that the information above is true and complete to the best of my knowledge and belief.
397-3571

SIGNED [Signature] TITLE Hobbs Area Superintendent DATE 10-11-88

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY: