

DISTRICT I  
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II  
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III  
1000 Rio Brazos Rd., Aztec, NM 87410

**OIL CONSERVATION DIVISION**  
P.O. Box 2088  
Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-05736
5. Indicate Type of Lease	STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No.	B-1330
7. Lease Name or Unit Agreement Name	
Mexico X Com	
8. Well No.	1
9. Pool name or Wildcat	Eumont Yates 7 Rv Qn
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	
3629 GR	

**SUNDRY NOTICES AND REPORTS ON WELLS**  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:	OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER <input type="checkbox"/>
2. Name of Operator	Texaco Producing Inc.
3. Address of Operator	P.O. Box 730 Hobbs, NM 88240
4. Well Location	Unit Letter <u>H</u> : <u>1650</u> Feet From The <u>North</u> Line and <u>990</u> Feet From The <u>East</u> Line
Section <u>29</u>	Township <u>19S</u> Range <u>37E</u> NMPM Lea County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)	3629 GR
--	---------

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
<b>NOTICE OF INTENTION TO:</b>	<b>SUBSEQUENT REPORT OF:</b>
PERFORM REMEDIAL WORK <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
OTHER: <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
	CASING TEST AND CEMENT JOB <input type="checkbox"/>
	OTHER: <input type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Kill well. Tag PBTD @ 3656. POH w/ tbg. Cleanout to PBTD if necessary.
2. Run GR-CCL.
3. Perf 3510, 11, 21-24, 30-32, 42, 50-56, 77-84, 97-99, 3606-09, 25-28, 41, 44-46, 51.
4. Acidize Eumont w/ 3000 gal. 15% NEFE.
5. Frac Eumont w/ 32200 gal. 40# linear gel, 32200 gal. CO2 and 315000# 12/20 sand.
6. Flow back. Cleanout sand. Run rods & tbg. Place on test.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE L. D. Ridenour TITLE Engineer's Assistant DATE 8-24-90

TYPE OR PRINT NAME L. D. Ridenour TELEPHONE NO. 393-7191

(This space for State Use)

APPROVED BY \_\_\_\_\_ TITLE \_\_\_\_\_ DATE \_\_\_\_\_

CONDITIONS OF APPROVAL, IF ANY: