

G. C. Matthews #9
Section 6, T20S, R37E
Lea County, New Mexico
WBS UWPWB-A0019

Recommended P&A Procedure

1. MIRU PU. Conduct Safety Meeting. Contact OCD. ND WH. NU BOP.
2. PU Tbg and TIH.
3. Place a balanced cement plug from 5246' - 5095' (Paddock perms). Tag plug.
4. Place a 269' balanced cement plug 3598'-3329' (7 5/8" casing shoe & liner top). Tag plug.
5. Place a 100' balanced cement plug from 2390' - 2290' (9 5/8" casing shoe). Tag plug.
6. Place a 100' balanced cement plug from 345' - 245' (13 3/8" casing shoe). Tag plug.
7. Place a 100' balanced cement plug from 100' - surface. (surface plug)
8. Cut off well head and set P&A marker.
9. RD PU. Cut off anchors. Change well status to P&A.
10. Restore surface location.

→ SALT PLUG 1070 — 970

Lloyd Trautman
October 10, 2000