

ABANDONMENT PROCEDURES

BRITT "A" NO. 5 WELL
EUNICE - MONUMENT FIELD
LEA COUNTY, NEW MEXICO

- NOTIFICATION:
1. NOTIFY BLM @ (505) 887-6544 (MR. SHANNON SHAW) 24 HOURS PRIOR TO COMMENCING PLUGGING OPERATIONS. A COPY OF THE APPROVED BLM NOTICE AND PROCEDURES SHOULD BE AVAILABLE AT THE LOCATION.
 2. NOTIFY BLM AND UTP HOUSTON OF ANY CHANGES IN THE PROCEDURE DUE TO WELLBORE OR OTHER PROBLEMS.
 3. NOTIFY LANDOWNER 24 HOURS PRIOR TO COMMENCING PLUGGING OPERATIONS.

PROCEDURES:

1. MIRU plugging unit. Bleed any pressure off well. Kill well as required.
2. ND tree. NU BOP's. PU 2-3/8" or 2-7/8" work string, bit and scraper. TIH to PBTD (TOF @ $\pm 3230'$) and reverse circulate hole clean. POOH.
3. Run and set cement retainer at $\pm 3200'$. It may be run on either wireline or tubing.
4. Test running in hole with stinger and tubing. Sting into retainer. Establish injection rate and pressure. Mix and pump 75 sx cement. Squeeze 70 sx past retainer. PU tubing dumping 5 sx on retainer.
5. POOH.
6. ND BOP's. RU lift sub and casing jacks on 5 1/2" casing. Stretch test and determine freepoint of same.
7. Jet cut 5 1/2" casing at freepoint. POOH and LD 5-1/2" casing.
8. TIH with tubing to 75' below cut. Mix and spot 35 sx cement plug from 75' below cut to 75' above cut.
9. PU tubing to 2500'. Mix and spot 35 sx balanced common cement plug from 2500' to 2400'.
10. PU to 1100'. Mix and spot 35 sx balanced cement plug from 1100' to 1000'.
11. PU tubing to 690'. Mix and spot 35 sx from 690' to 580'.