

ABANDONMENT PROCEDURE

BRITT NO. 1 WELL
EUNICE MONUMENT FIELD
LEA COUNTY, NEW MEXICO

- NOTIFICATION:
1. NOTIFY BLM @ (505) 887-6544 (MR. SHANNON SHAW) 24 HOURS PRIOR TO COMMENCING PLUGGING OPERATIONS. A COPY OF THE APPROVED BLM NOTICE AND PROCEDURES SHOULD BE AVAILABLE AT THE LOCATION.
 2. NOTIFY BLM AND UTP HOUSTON OF ANY CHANGES IN THE PROCEDURE DUE TO WELLBORE OR OTHER PROBLEMS.
 3. NOTIFY LANDOWNER 24 HOURS PRIOR TO COMMENCING PLUGGING OPERATIONS.

PROCEDURES:

1. MIRU Plugging Unit with H₂S safety equipment (detector and air packs). Bleed any pressure off well. Kill well as required.
2. ND Tree, NU BOP's. Release packer and POOH w/tubing and packer. (It may be necessary to freepoint tubing and cut above packer if packer does not pull).
3. TIH w/ CIBP on tubing (wireline optional). Set same at 3520' to isolate perforations. Spot 35' (5 sx) common cement on top of BP (14.8 ppg and 1.32 cu.ft./sx). PU above cement and reverse hole full w/10.0 ppg brine mixed w/25 sx gel/100 bbls.
4. POOH w/tubing.
5. ND BOP's. RU casing jacks on 6 5/8" casing. Stretch and freepoint casing (*see notes).
6. RIH and cut 6 5/8" casing at ±2622 (anticipated recovery depth).
7. POOH and LD 6 5/8" casing.
8. TIH w/ tubing to 100' below casing cut (or 2720' whichever is deepest).
9. Mix and spot 45 sx balanced common cement plug from 2520 to 2720'.
10. POOH w/tubing.
11. RU casing jacks on 8 1/4" casing. Stretch and freepoint casing.
12. RIH and cut 8 1/4" casing at freepoint. Anticipated recovery is 1010'.