

Submit 3 Copies  
to Appropriate  
District Office

State of New Mexico  
Energy, Minerals and Natural Resources Department

Form C-103  
Revised 1-1-89

OIL CONSERVATION DIVISION

2040 Pacheco St.  
Santa Fe, NM 87505

DISTRICT I  
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II  
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III  
1000 Rio Brazos Rd., Aztec, NM 87410

WELL API NO.  
30-025-06013

Indicate Type of Lease  
STATE \_\_\_\_\_ FEE

State Oil & Gas Lease No.  
014896

Lease Name or Unit Agreement Name  
BERTIE WHITMIRE

Well No.  
3

Pool name or Wildcat  
EUMONT MONUMENT

**SUNDRY NOTICES AND REPORTS ON WELLS**  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

Type of Well:  
OIL WELL  GAS WELL  OTHER \_\_\_\_\_

Name of Operator  
ARCH PETROLEUM INC.

Address of Operator  
10 DESTA DRIVE SUITE 420E

Well Location  
Unit Letter F : 1980 Feet From The \_\_\_\_\_ N \_\_\_\_\_ Line and 1980 Feet From The \_\_\_\_\_ W \_\_\_\_\_ Line  
8 Section 20S Township 37E Range \_\_\_\_\_ NMPM LEA County

Elevation (Show whether DF, RKB, RT, GR, etc.)  
3549 GR

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK   
TEMPORARILY ABANDON   
PULL OR ALTER CASING   
OTHER: \_\_\_\_\_

PLUG AND ABANDON   
CHANGE PLANS   
REMEDIAL WORK   
COMMENCE DRILLING OPNS.   
CASING TEST AND CEMENT JOB   
ALTERING CASING   
PLUG AND ANBANDONMENT   
OTHER: \_\_\_\_\_

Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.  
MIRU PU. NDWH NU BOP. DMP 5 SX CMT ON CIBP @ 3415. DETERMINED FREE PT IN 5 1/2" CSG @ 5210'. ND BOP. SHOOT OFF CSG @ 5210'. NU BOP. SET CMT STUB PLUG @ 5210'-50 IN & 50 OUT. SET CMT SHOE PLUG @ 2328'-50 IN & 50 OUT. SET 25 SX CMT PLUG @ 1400'. DETERMINED FREE PT IN 7 5/8" CSG @ 1555'. ND BOP. SHOOT OFF CSG @ 1555'. NU BOP. SET CMT STUB PLUG @ 1555'-50 IN & 50 OUT. SET 25 SX CMT PLUG @ 350'. SET CMT SHOE PLUG @ 225'-50 IN & 50 OUT. SET 10 SX CMT PLUG @ SURFACE (DISPLACE BETWEEN PLUGS W/ 10# BRINE/ 25# GEL PER BBL MUD). ND BOP & RD PU.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.  
SIGNATURE \_\_\_\_\_ TITLE SUMMER ENGINEER DATE 07-01-97  
TYPE OR PRINT NAME DOUG PARKHURST TELEPHONE NO. 915-685-1961

(This space for State Use)  
APPROVED BY \_\_\_\_\_ ORIGINAL FILED BY CHRIS WILLIAMS DISTRICT I SUPERVISOR TITLE \_\_\_\_\_ DATE \_\_\_\_\_  
CONDITIONS OF APPROVAL, IF ANY:

Handwritten initials: JC and JP