

OIL CONSERVATION DIVISION

P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-77

NO. OF COPIES RECEIVED		
DISTRIBUTION		
SANTA FE		
FILE		
U.S.O.S.		
LAND OFFICE		
OPERATOR		

5a. Indicate Type of Lease
State Fee

5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT..." (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator Amoco Production Company	8. Farm or Lease Name South Hobbs (GSA) Unit
3. Address of Operator P. O. Box 68, Hobbs, NM 88240	9. Well No. 75
4. Location of Well UNIT LETTER <u>H</u> , <u>1980</u> FEET FROM THE <u>North</u> LINE AND <u>660</u> FEET FROM THE <u>East</u> LINE, SECTION <u>9</u> TOWNSHIP <u>19-S</u> RANGE <u>38-E</u> NMPM.	10. Field and Pool, or Wildcat Grayburg San Andres
15. Elevation (Show whether DF, RT, GR, etc.) 3604' DF	12. County Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input checked="" type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Propose to locate and repair casing leak by the following method:

Pull rods, pump and tubing. Run a retrievable bridge plug and set at 4025'. Cap with 15' of sand (Approx. 5 sacks of sand). Run a casing inspection log from 4025' to surface. If a leak is indicated on the log, run tubing and packer to locate the casing leak by moving the packer up the well bore. Wait on evaluation of results.

0+4-NMOCD, H 1-Hou 1-Susp 1-W. Stafford, Hou 1-GPM

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Mark Randolph TITLE Assist. Admin. Analyst DATE 8-25-81

APPROVED BY Jerry Saito TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY:

RECEIVED
AUG 26 1981

U.S. DEPARTMENT OF JUSTICE