

DISTRICT I  
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II  
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III  
1000 Rio Brazos Rd., Aztec, NM 87410

**OIL CONSERVATION DIVISION**  
P.O. Box 2088  
Santa Fe, New Mexico 87504-2088

WELL API NO. 300-2509880
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No. 010972
7. Lease Name or Unit Agreement Name Keohane BM "A"
8. Well No. 1
9. Pool name or Wildcat Funice Monument CSA
10. Elevation (Show whether DF, RKB, RT, GR, etc.)

**SUNDRY NOTICES AND REPORTS ON WELLS**  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER
2. Name of Operator Texaco E&P Inc.
3. Address of Operator P.O. Box 730 Hobbs, NM 88240
4. Well Location Unit Letter <u>A</u> : <u>660</u> Feet From The <u>North</u> Line and <u>660</u> Feet From The <u>East</u> Line Section <u>18</u> Township <u>19S</u> Range <u>37E</u> NMPM Lea County
10. Elevation (Show whether DF, RKB, RT, GR, etc.)

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data.

<b>NOTICE OF INTENTION TO:</b>		<b>SUBSEQUENT REPORT OF:</b>	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER: <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	OTHER: <input type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Notify NMOCD 10-24-94 of intent to plug. Talked to Ronnie.  
 10-25-94 MIRU POOL WO Rig. NUBOP. PU work string. TIH tag cmt. plug @ 3588, Mix 9.5# mud 25# per bbl. salt gel. & circ. hole w/120 bbl. POOH to 2900.  
 10-26-94 Spot 80 sxs cmt. plug f/2900-2423. POOH w/tub. RUWL & perf. 4 spf @ 1700' RDWL. TIH w/PKR to 1450 sq 100 sxs. Displace cmt. to 1650. Shut in overnite & WOC.  
 10-27-94 Test sq @ 1700' to 500PSI. Held ok. Tag plug @ 1571'. TOH w/tub. RUWL & perf. 4spf @ 1431 TIH w/PKR to 1110'. -est. inj. rate. circ 255sxs cmt. below PKR. up 7" & 9-5/8 csg. to surf. Displace TOC to 1210'. WOC overnite.  
 10-28-94 Test sq @ 1431' to 500 PSI held OK. (Notified Charlie Perrin w/NMOCD of all sq test & cmt tags) Tag TOC @ 1207'. POOH to 190' w/tub. Spot 50 sxs cmt. plug f/190'-surface. Rigdown; clean up location & move off. Cut off well head & weld on cap & install dryhole marker

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Jim Calder TITLE P&A Supervisor (Agent-Pool) DATE 10-30-94

TYPE OR PRINT NAME Jim Calder TELEPHONE NO 915-563-2805

(This space for State Use)

APPROVED BY Carly W. Hill TITLE \_\_\_\_\_ DATE DEC 21 1994

CONDITIONS OF APPROVAL, IF ANY: