

Union State #1
Unit A, Sec. 30, T-20-S, R-36-E
Lea County, New Mexico

Proposed Re-Entry Procedure Cont'd.

If CBL shows cmt behind 5 1/2", perforate & acidize as follows. If no cement, perforate squeeze holes @ 5600'. Set cement retainer @ 5550'. Cement 5 1/2" 5600-5200'. Sting out & POOH. WOC. DO cmt in 9 5/8". DO cement in 5 1/2". Circulate clean. Perforate & acidize 5420'-5440'. If non-productive, set CIBP @ 5100' & dump cement. Test prospective Queen & Yates sand.