

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE
(Other instructions on
reverse side)

Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

NM-0560408

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Aztec Federal "14"

9. WELL NO.

1

10. FIELD AND-POOL, OR WILDCAT

Lea (Penn)

11. SEC., T., R., M., OR BLM. AND SURVEY OR AREA

Sec. 14, T-20-S,
R-34-E

12. COUNTY OR PARISH, 13. STATE

Lea New Mexico

1. OIL WELL GAS WELL OTHER

2. NAME OF OPERATOR
Western States Producing Company

3. ADDRESS OF OPERATOR
900 Building of the Southwest Midland, Texas 79701

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface

1980' FSL
1830' FEL

14. PERMIT NO. 15. ELEVATIONS (Show whether DF, RT, GR, etc.)

- - - 3648' GL

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF <input type="checkbox"/>	PULL OR ALTER CASING <input type="checkbox"/>
FRACTURE TREAT <input type="checkbox"/>	MULTIPLE COMPLETE <input type="checkbox"/>
SHOOT OR ACIDIZE <input type="checkbox"/>	ABANDON* <input type="checkbox"/>
REPAIR WELL <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>
(Other) <input type="checkbox"/>	

SUBSEQUENT REPORT OF:

WATER SHUT-OFF <input type="checkbox"/>	REPAIRING WELL <input type="checkbox"/>
FRACTURE TREATMENT <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
SHOOTING OR ACIDIZING <input type="checkbox"/>	ABANDONMENT* <input checked="" type="checkbox"/>
(Other) <input type="checkbox"/>	

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

1. Spotted 35 sack cement plug from 9500' back to 9300'.
2. Laid down tubing and free point 7" casing.
3. Shot 7" casing at 8948, 8821, 6502, and cut off at 5000'. Spotted 35 sack cement plug at cut off point.
4. Spotted 35 sack cement plug at 5800', top of Glorieta.
5. Spotted 50 sack cement plug from 5100 back to 4980'.
6. Spotted 35 sack cement plug from 3400 back to 3500'.
7. Free point 9-5/8" casing and shot off casing at 3005'.
8. Spotted 50 sack cement plug from 1600 back to 1700'.
9. Spotted 75 sack cement plug from 750 back to 630'.
10. Spotted 10 sack cement plug at surface.
11. Cut off head, welded on plate, set marker and cleaned location.

18. I hereby certify that the foregoing is true and correct

SIGNED Arthur R. Brown TITLE Operations Manager DATE 9-20-72

(This space for Federal or State office use)

APPROVED BY _____ TITLE _____

CONDITIONS OF APPROVAL, IF ANY:

APPROVED
APR 4 1973
ARTHUR R. BROWN
DISTRICT ENGINEER

*See Instructions on Reverse Side