

14. STRIP IN HOLE W/ON-OFF TOOL AND 'F' NIPPLE W/CHECK VALVE. PUMP 5 BBLS 2% KCL ON TOP OF PKR BEFORE LATCHING ON-OFF TOOL TO REMOVE DEBRIS. LATCH PACKER. RU WL. RIH AND PULL CHECK VALVE. RIH AND PULL 'FWG' PLUG. RD WL. FLOWBACK FOR 16-24 HOURS.
15. RU WL. RIH W/CHECK VALVE AND SET IN 'F' NIPPLE. RELEASE PACKER, POH, LD WS. REPEAT STEPS 13 (A) AND (B) AS NECESSARY.
16. RIH W/2-3/8" PRODUCTION STRING W/CHECK VALVE LOCATED IN SEATING NIPPLE. RU AIR UNIT. CIRC SAND FILL UP ANNULUS AT HIGH RATE. CLEAN OUT TO APPROX. 100' BELOW BOTTOM PERF.
17. PU TBG. SEAT TO TOP PERF @ 2860'. HANG OFF. ND BOPS/NU TREE. RIH AND PULL CHECK VALVE IN SEATING NIPPLE. RDMO RIG. RTP.