

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease
State Fee

5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- _____	7. Unit Agreement Name
2. Name of Operator Jake L. Hamon	8. Farm or Lease Name West
3. Address of Operator 611 Petroleum Building, Midland, Texas 79701	9. Well No. 1
4. Location of Well UNIT LETTER <u>0</u> <u>660</u> FEET FROM THE <u>South</u> LINE AND <u>1980</u> FEET FROM THE <u>East</u> LINE, SECTION <u>8</u> TOWNSHIP <u>20-S</u> RANGE <u>36-E</u> N.M.P.M.	10. Field and Pool, or Wildcat N. Osudo Bone Spring
15. Elevation (Show whether DF, RT, GR, etc.) 3619.9' GR	12. County Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- Set Baker CIBP at 7725' and dump 35' (5 sks) of cement on plug.
- Run tubing open ended to 7680' and circulate around with 10# brine mud.
- Pull tubing, cut and pull 5-1/2" casing. Estimate 4100' of recovery.
- Run tubing, set 50 sks (100') cement plug in and out of 5-1/2" stub. Tag plug.
- Set 100 sks (200') cement plug 50' out and 150' in base of 8-5/8" casing set at 3228'. Tag plug.
Note: This plug will cover the base of the salt at 3045'.
- Set 50 sk (140') cement at top of salt at 1802', top of plug to be at 1660'.
- Set 50 sk (140') cement plug down base of 11-3/4" surface casing at 1425' back to 1285'.
- Set 10 sks cement plug in top of 8-5/8" casing.
- Install 4" marker at surface.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Cecil H Barton TITLE Petroleum Engineer DATE 2/14/83

ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT I SUPERVISOR

FEB 15 1983

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY: