

Tonto Federal #1
Section 10: SE/4 NE/4
Township 20 South, Range 33 East
1980' FNL & 660' FEL
Lea County, New Mexico
PLUG & ABANDON

COMPLETED CASING PROGRAM

- 13 3/8", 540, K-55 csg set @523' - cement circ to surface
- 8 5/8", 240, J-55 csg set @5,000' - cement circ to surface
- 5 1/2", 170, N-80 csg set @10,697' - cement top @4,000'

PROPOSED PLUG & ABANDON PROCEDURE

1. set cement plug from top of cast iron bridge plug @3,500' plug to cover from 3,500' to 3,250' - 100 sxs - tag plug
2. set 40 sxs plug from 1,600' to 1,500'
3. set 40 sxs plug from 575' to 475'
4. set 20 sxs plug @surface
5. install dry hole marker

COMPLETED PLUGGING OPERATIONS OF 10/14/85

cast iron bridge plug set @3,500'

Perfs.
3380' -
3456'

3545' -
3579'

10/11/85 - 5 1/2" csg cut off @free point 4,000' -- pulled
4,000' 5 1/2" csg cement plug 50' inside 5 1/2" & 50' outside -
cement plug 3950' to 4050' - 100' plug

10/11/85 - cement plug 6753' to 6534' - 219' plug

8081' -
8090'

10/10/85 - cement plug 8150' to 7931' - 219' plug

10/10/85 - cement plug 9200' to 9165' - 35' plug
8 31/85 - cast iron BP @9200'

9812' -
9824'

10,240' to
10,247.5'

10,446 to
10,455'

Call Vince Valdez prior to plugging @887-6544

RECEIVED
DEC 16 1985
C.C.P.
HOBBS OFFICE